IMAGES


Issue: March 2025



Caption: Barn at 118 Francis Street, Richmond (exterior) Photographer: K. Denny Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: June 2023

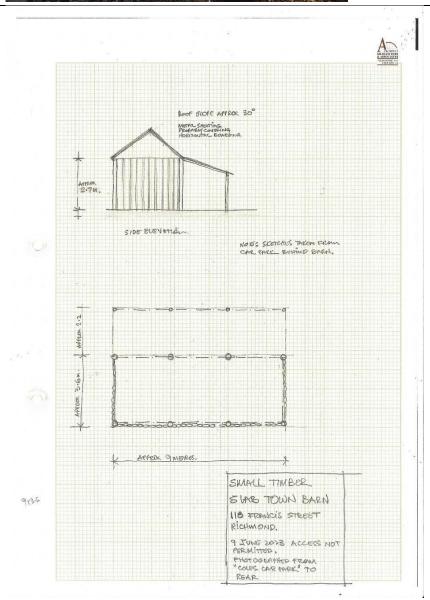

Caption: Measured drawing of Barn at 118 Francis Street, Richmond Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS			
NAME	Resited and Altered Slab Barn		
OTHER/FORMER NAMES	Clear Oaks/ Moxey's Farm House		
ADDRESS	135 Francis Street, Richmond		
LOCAL GOVT AREA	Hawkesbury		
PARISH	Ham Common		
LOT/DP	Lot 100 DP789415		
SHI No.	1743122		
EXISTING HERITAGE	Y – Local (I00058) and State (SHR 00058)		
ITEM?			
RECOMMENDED MANAGE			
MANAGEMENT	Not recommended for State or local listing		
SUMMARY			
ITEM CLASSIFICATION			
ITEM TYPE	Built		
ITEM GROUP	Farming and Grazing		
ITEM CATEGORY	Barn		
	DESCRIPTION		
CIRCA	Y		
PERIOD	Early 19th century?		
MODIFICATION/DATES	Relocated 1977		
CURRENT USE	?		
FORMER USE	Barn		
	tographed from public road only.		
HISTORY			
HISTORICAL NOTES	[2010 inventory sheet]		
	A re-sited and altered two storey slab barn. The slab barn was originally		
	located in Macquarie Street, Windsor and associated in the 19th century		
	with Samuel Marsden's Tannery. It was purchased 1977, dismantled and		
DIEGODION/INEA CENTECC	relocated to Clear Oaks, a highly significant historic site in Richmond.		
INTEGRITY/INTACTNESS	Resited and altered- site inspection required to determine integrity and		
	condition. Significance level cannot be determined without a site inspection but representational significance only.		
	inspection out representational significance only.		



Issue: March 2025

Caption: Barn at 135 Francis Street, Richmond (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd Date: July 2023

ITEM DETAILS		
NAME	Group of three barns- part of historic homestead	
OTHER/FORMER NAMES	Hobartville	
ADDRESS		
	36 and 40 Inalls Lane and 16 William Cox Drive, Richmond	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Ham Common	
LOT/DP	Lot 1 and 2 DP 596558	
SHI No.	1743059	
EXISTING HERITAGE	Y- Item I14 (SHI 1741548) and SHR 00035 (SHI 5045232)	
ITEM?		
RECOMMENDED MANAGE	<u> </u>	
MANAGEMENT	Retain as State item	
SUMMARY	Retain as Local item	
ITEM CLASSIFICATION	D. W.	
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barns Stables	
DESCRIPTION	77	
CIRCA	Y	
PERIOD	Barn 1 & 2: Early 19 th century	
MODUNGAMIONA	Barn 3: Late 19 th to early 20 th century	
MODIFICATION/DATES	20 th century	
CURRENT USE	Barns, storage, machinery sheds	
FORMER USE	Barns	
LOCATION ON SITE:	The three barns in this study are clustered in a complex of farm buildings to	
	the south-west of the house, Hobartville. All three barns are noted as of 'high'	
	cultural significance in the 2004 Conservation Management Plan by Clive	
DESCRIPTION DADY 1 (EQ	Lucas Stapleton & Partners.	
DESCRIPTION BARN 1 'TOP STABLES'		
MAIN BARN STRUCTURE	It is a large and high single storey barn (approx 20m long x 5.5m wide)	
	originally with loft, a feed storage area extending each side with integral	
	skillions (approx 3.6m wide each side) and the total floor area sectioned off	
	for cattle stables but partitions removed for a loading dock at the west end.	
	The main structure is round timber posts and sawn beams.	
	Condition: Good	
NO OF BAYE	Date: Early 19 th century but with extensive later modifications	
NO. OF BAYS	Six	
ROOF STRUCTURE	Roof framing replaced with 100 x 50 rafters @ 900 crs.	
	Condition: Good	
	Condition: Good Date: Late 20 th century?	
LOFT	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard	
	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding.	
	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A	
LOFT	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century	
	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn	
LOFT	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure.	
LOFT SKILLION 1	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good	
LOFT	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets.	
LOFT SKILLION 1	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets. Condition: Moderate	
LOFT SKILLION 1	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets.	
LOFT SKILLION 1	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets. Condition: Moderate Date: Mid-20 th century?	
LOFT SKILLION 1 ROOF CLADDING:	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets. Condition: Moderate Date: Mid-20 th century? Vertical timber slabs remain around three sides of the eastern skillion only.	
LOFT SKILLION 1 ROOF CLADDING:	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets. Condition: Moderate Date: Mid-20 th century? Vertical timber slabs remain around three sides of the eastern skillion only. Elsewhere there are vertical timber planks. Condition: Moderate	
LOFT SKILLION 1 ROOF CLADDING:	Condition: Good Date: Late 20 th century? Remains of loft floor frame evidence and wall framing for weatherboard cladding. Condition: N/A Date: Early 19 th century Skillions wrap around three sides and are integral with the main barn structure. Condition: Good Corrugated iron in short sheets. Condition: Moderate Date: Mid-20 th century? Vertical timber slabs remain around three sides of the eastern skillion only. Elsewhere there are vertical timber planks.	

OPENINGS	Stable doors have been inserted on north, east and south sides and double	
ELOOPHIG (CROUND)	doors to the loading dock at the western end.	
FLOORING (GROUND)	Brick flooring generally but raised timber floor in north-western corner.	
FLOORING (LOFT)	None	
FLOORING (SKILLION)	As above.	
CURRENT USE	Feed shed and stables	
CHANGES FROM 2010?	None	
DESCRIPTION BARN 2 'BO	TTOM STABLES'	
MAIN BARN STRUCTURE	A relatively low barn but large on plan (15 x 8m) with a loft originally as evidenced by the loft door in the east end. It is constructed with round pole columns, rafters and beams and has later added verandahs along each long side. Gable walls have posts at close centres to support the wide span. Condition: Good Date: Early 19 th century	
NO. OF BAYS	Six	
ROOF STRUCTURE	Round pole rafters with collar ties and shingle battens. Condition: Good Date: Early 19 th century	
LOFT	Removed	
ROOF CLADDING:	Corrugated iron short sheets Condition: Moderate Date: Early or mid-20 th century?	
WALL CLADDING	Vertical planks to long sides, horizontal corrugated iron to gable ends. Condition: Moderate Date: Early or mid-20 th century?	
OPENINGS	Stable doors both sides.	
FLOORING (GROUND)	Concrete slab	
CURRENT USE	Stables	
CHANGES FROM 2010?	None	
DESCRIPTION BARN 3 'OL	D BARN'	
MAIN BARN STRUCTURE	Large round posts are trenched at the top to take rectangular longitudinal beams with bolted connections. Large square cross beams have iron tie bars at mid span connected to the top of each rafter. Slabs are stockpiled within the barn but there is no evidence of their use in cladding the walls of this barn. Condition: Moderate – tops of posts have been repaired in places and longitudinal beams spliced or replaced. Date: Late 19 th early 20 th century?	
NO. OF BAYS	Eight	
ROOF STRUCTURE	Each pair of sawn rafters is triangulated by connection to a large rectangular cross beam and the sag in the latter member is limited by vertical iron tie rods connected to the apex of the roof. Condition: Moderate Date: Late 19 th early 20 th century?	
SKILLION 1	Low pitched skillion on east side intersects with the main barn approximately 1m below the eaves. It is constructed of round pole rafters with sawn battens for iron roofing. Condition: Moderate Date: Late 19 th early 20 th century?	

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

ROOF CLADDING:	Corrugated iron in short sheets. Condition: Moderate. Date: Late 19 th early 20 th century?
WALL CLADDING	None
OPENINGS	Sides are open
FLOORING (GROUND)	Earthen
FLOORING (SKILLION)	Earthen
OTHER (Fixings?)	Bolted with some later strengthening
CURRENT USE	Machinery shed and storage
HICTODY	

Issue: March 2025

The Hobartville estate, including the main house and associated outbuildings, the group of three barns and other agricultural outbuildings, is located on a 100 acre grant made to James Blackman in 1802 and 400 acres made to surgeon Edward Luttrell in 1804.

In 1816, William Cox Jnr. purchased Luttrell''s grant and the property become known as Hobartville and was advertised as having a house, garden and out offices. By 1818, Cox had also purchased Blackman's grant.

On the death of William Cox in 1850, the estate was left to his eldest son, yet another William, but with a life interest to his widow, Elizabeth. She moved permanently to England in 1864 and William had another property, so they passed Hobartville to another son, Sloper Cox who lived there until 1877.

In 1877 it was bought by Andrew Town, who established his famous horse stud and sales there. In 1900, the property was sold to Percy Reynolds who continued the use of the place as a thoroughbred stud. Reynolds had been born at Tocal Station, Paterson. The Reynolds family built up Australia's most renowned Hereford cattle herd in the 1930s.

Although the original estate lands have been subdivided and sold for residential development, the property still retains a large amount of land and continues to operate as a stud facility.

REFERENCES	Inventory sheet for Hobartville (SHR 00035)
STATEMENT OF SIGNIFICANCE	


The barns at No. 36-40 Inalls Lane, Richmond are of historical significance as forming part of a complex of agricultural outbuildings associated with the significant and rare colonial estate Hobartville, and as surviving early and late 19th century timber framed barns that remain in agricultural use today.

The barns have associations with a number of historically notable past owners of Hobartville, including William Cox, Andrew Towns and Percy Reynolds, and surgeon Edward Luttrell. The barns at Hobartville, a highly successful horse stud and cattle farm, are also associated with prize winning and famous stock animals including past Melbourne Cup winning sires and their offspring, trotters and the Hobartville Hereford cattle. Although modified over time, the barns at Hobartville are rare and of technical significance for surviving substantially intact to their original construction date and configurations and displaying a mix of early to late 19th century construction methods associated with timber agricultural buildings

19 th century construction methods associated with timber agricultural buildings.	
ASSESSED	State
SIGNIFICANCE TYPE	
CRITERIA A)	The barns at No. 36-40 Inalls Lane, Richmond are of historical significance as
HISTORICAL	forming part of a complex of agricultural outbuildings associated with the
	significant and highly intact colonial estate Hobartville, and as surviving early
	and late 19 th century timber framed barns that remain in agricultural use today.
	Meets the criterion on a State level.
CRITERIA B)	The barns have historical associations with a number of historically notable
HISTORICAL	past owners of Hobartville, including William Cox, Andrew Towns, Percy
ASSOCIATION	Reynolds and surgeon Edward Luttrell. The barns of Hobartville a highly
	successful horse stud and cattle farm, are also associated with prize winning
	and famous stock animals including past Melbourne Cup winning sires and
	their offspring, trotters and the Hobartville Hereford cattle.
	Meets the criterion on a State level.
CRITERIA C)	Forming part of the complex, the barns at Hobartville contribute to the
AESTHETIC/TECHNICAL	historical character and aesthetic significance of the whole of the place.
	Although modified over time, two of the barns at Hobartville are of technical

	significance for surviving substantially intact to their original construction
	date and configurations and displaying a mix of early to late 19th century
	construction methods associated with timber agricultural buildings.
	Meets the criterion on a State level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
1	development of the region, as evidenced by the numerous exhibitions,
1	artworks, historical tours, heritage studies and heritage listings associated with
1	these building types.
!	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	Forming part of a significant colonial estate, the barns at Hobartville
POTENTIAL	contribute to an understanding of the historical development of the estate and
1	its history of use.
	Meets the criterion on a State level.
CRITERIA F) RARITY	Barns 1 and 2 are rare as surviving early 19 th century timber framed barns that
	continue in agricultural use today. All three barns form part of a complex of
	buildings associated with the significant colonial estate Hobartville.
1	Meets the criterion on a State level.
CRITERIA G)	The barns at Hobartville are representative of the long history of agricultural
REPRESENTATIVE	development within the floodplains of the Hawkesbury River, which
1	commenced in the late 18th century and continues today.
	The basic forms of the barns with gabled roofs, skillions and lofts are
!	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level.
INTEGRITY/	Moderate to high
INTACTNESS	

IMAGES

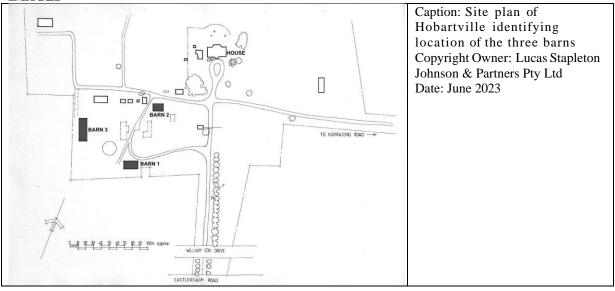



Caption: Barn 1 at 331 Hobartville, 36-40 Inalls Lane, Richmond (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023



Caption: Barn 1 at 331 Hobartville, 36-40 Inalls Lane, Richmond (interior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023



Issue: March 2025

Caption: Barn 2 at 331 Hobartville, 36-40 Inalls Lane, Richmond (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023



Caption: Barn 2 at 331 Hobartville, 36-40 Inalls Lane, Richmond (interior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023



Caption: Barn 3 at 331
Hobartville, 36-40 Inalls
Lane, Richmond (exterior)
Photographer: S. Johnson
Copyright Owner: Lucas Stapleton
Johnson & Partners Pty Ltd
Date: June 2023




Issue: March 2025

Caption: Barn 3 at 331
Hobartville, 36-40 Inalls
Lane, Richmond (interior looking north)
Photographer: S. Johnson
Copyright Owner: Lucas Stapleton
Johnson & Partners Pty Ltd
Date: June 2023




Caption: Barn 3 at 331 Hobartville, 36-40 Inalls Lane, Richmond (interior looking south) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023

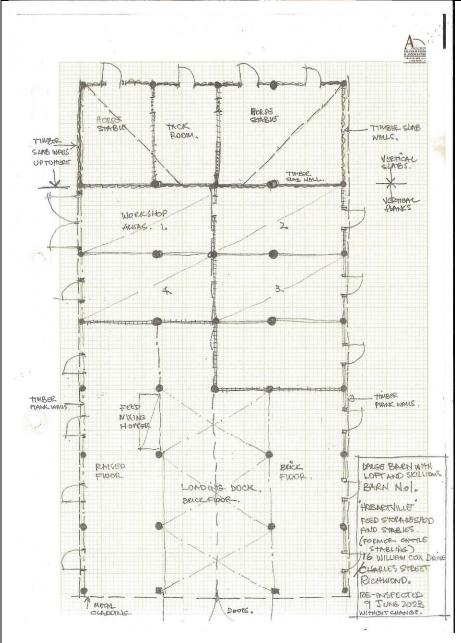


Issue: March 2025

Caption: Measured drawing of Barn 1 at Hobartville, 36-40 Inalls Lane, Richmond Copyright Owner: Graham Edds & Associates Date: June 2023

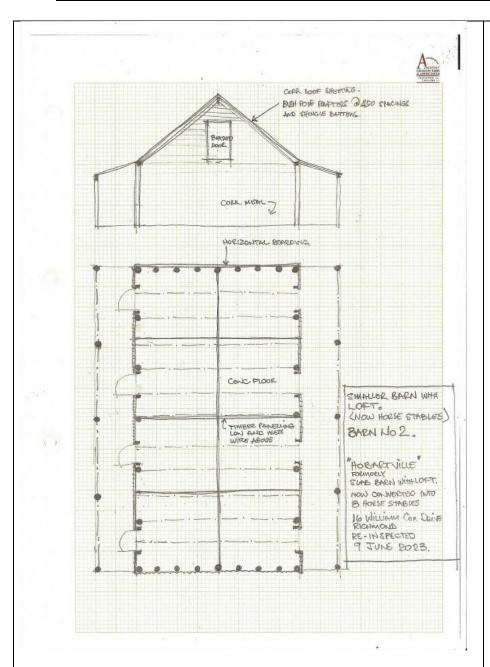

Caption: Measured drawing of Barn 2 at Hobartville, 36-40 Inalls Lane, Richmond Copyright Owner: Graham Edds & Associates Date: June 2023

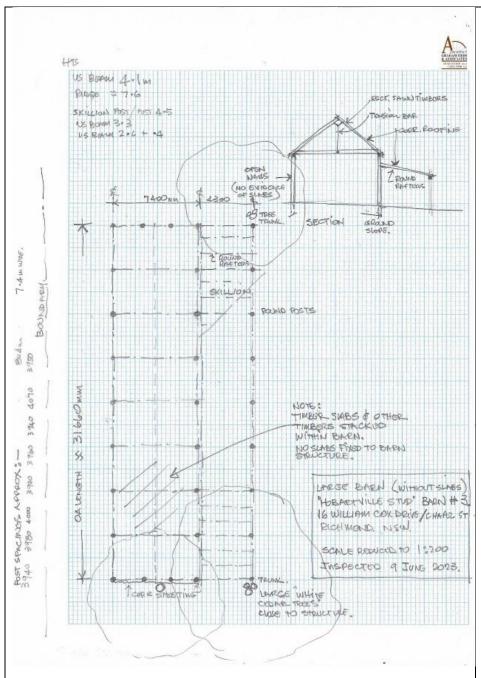

Caption: Measured drawing of Barn 3 at Hobartville, 36-40 Inalls Lane, Richmond Copyright Owner: Graham Edds & Associates Date: June 2023

ITEM DETAILS		
NAME	Single storey town barn with loft	
ADDRESS	102 Lennox Street, Richmond	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Ham Common	
LOT/DP	Lot 2 DP 207974	
SHI No.	Potential	
EXISTING HERITAGE	Yes- I49 (SHI No. 1741084)	
ITEM?	105 117 (511110.1711001)	
RECOMMENDED MANAG	EMENT	
MANAGEMENT	Not recommended for State listing	
SUMMARY	Retain Local listing.	
ITEM CLASSIFICATION	<u> </u>	
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	Mid 19 th century	
MODIFICATION/DATES	Mid 20 th century	
CURRENT USE	Barbeque and entertaining space.	
FORMER USE	Town barn	
LOCATION ON SITE:	Town barn in back yard to south of mid-19 th century cottage.	
MAIN BARN STRUCTURE	Town barn supported mostly on round posts but some are adzed square or	
	faceted. Some posts bases have splice repairs. Continuous loft floor beam indicates that loft extended over the whole structure (now only part). Additional light wall framing above loft floor to support weatherboard cladding. Posts extend to eaves level and are notched to receive the eaves beam. Condition: Moderate Date: Mid-19 th century with later repairs	
NO. OF BAYS	Five	
ROOF STRUCTURE	Light weight sawn rafters and battens (structure replaced) Condition: Good Date: Mid-20 th century replacement?	
LOFT	Loft floor of plain edge timber boarding is supported on original joists. Condition: Moderate Date: Mid-19 th century	
ROOF CLADDING:	Corrugated iron short sheets Condition: Poor Date: Mid-20 th century?	
WALL CLADDING	Vertical timber slabs (some 400 wide) up to loft floor level. Weatherboards to loft level and gables, early beaded weatherboards to western side, other weatherboards are more recent. Condition: Moderate Date: Mid 19 th century with late 20 th century repairs	
OPENINGS	All bays are open on eastern side and at each end.	
FLOORING (GROUND)	Brick paving	
FLOORING (LOFT)	Timber boarding	
OTHER (Fixings?)	Beams let into and bolted to posts.	

HISTORY

The barn at No. 102 Lennox Street, Richmond is located on Lot 2, Section 10 of the Town Plan of Richmond.

A copy of surveyor George B White's Survey of Richmond dated December 1827 made on 30 November 1831 by Walker Rannie Davidson showed the footprint of a building on this allotment marked 'T Wilcox'. A later notation added to the map in red showed the land was granted to George Guest. The footprint of the building shown on the plan appears to relate to the existing single storey cottage at the property.

By a deed of Lease and release of 21 & 22 July 1841 with the following parties 1st John Town senior, 2nd Andrew Badgery and 3rd George Guest, Lot 2 in section 10 in the town of Richmond was sold to Guest. It had been promised to Josiah Cooper on 29 October 1821, who later transferred the right to John Town. The transaction was for £20 paid by Guest to John Town and £30 from Guest to Badgery.

On 24 August 1841, George Guest of Richmond was granted lot 2 section 10, Town of Richmond with an area of 1 acre 2 roods 15 perches. It was bounded on the north east by Lennox Street 2 chains 64 links. It had originally been allotted to Josiah Cooper by Governor Lachlan Macquarie but was granted to Guest in accordance with the report under Court of Claims 5 Wm IV No 21, No 956.

George Guest arrived as a free-settler in 1832 and was a saddler and later also an auctioneer.

A deed of Lease and release and assignment in trust for the benefit of creditors was signed on 28 & 29 July 1841 with the following parties, 1st George Guest, Richmond, saddler and his wife Jane, 2nd John George Richardson, Sydney, draper, and Charles Younger, Sydney, ironmonger 3rd Creditors of George Guest. By that transaction, Guest transferred his right to the land to trustees Richardson and Younger who would use Guest's assets to meet the debts of Guest to those creditors. George Guest died in 1893.

The land was subsequently sold by the trustees to William Sharpe but the transaction never appears to have been registered. On 28 October 1896, William Sharpe of Richmond, signed his will leaving 3 roods 11 perches part of George Guest's grant to Martha McManis, wife of Arthur McManis, Parramatta, council clerk. Richard Dwyer currently lived in the house on the land that had been purchased from the trustees of George Guest's estate.

Based on the physical evidence, it appears the barn was constructed by George Guest in the mid 19th century.

1 7	/ 11	, E	,
REFERENCES	R.469, Crown Plan		
	R.469e, Crown Plan		
	Grants, Vol 52 No 70		
	Old System Deeds, No	858 Bk U; No 716 Bk W; No 551 No 63	6 and No 567
	No 636		
	The Sydney Morning /h	nerald, Saturday 5 th April 1856, p. 10	
	Windsor and Richmond	l Gazette, Saturday 18 February 1893, p.	6

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 102 Lennox Street, Richmond is of historical significance as a surviving mid 19th century timber framed barn, associated with a mid 19th century single storey cottage. The barn appears to be associated with free-settler George Guest, saddler, who was granted the property in 1841 and retained ownership potentially until the 1890s. Guest appears to have built the barn for use in his business at the premises.

As a town barn, it is potentially rare within the Hawkesbury City local government area and has the potential to provide further information into the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21st century.

Although modified and adapted, the barn is of technical significance for retaining evidence of its mid 19th century construction date including some adzed square or faced posts and the use of vertical timber slabs (some 400 wide) up to loft floor level. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area and

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 102 Lennox Street, Richmond is of historical significance as
HISTORICAL	a surviving mid 19 th century town barn, associated with an early 19 th century
	single storey cottage that appears to date from the 1820s. First established in
	the 1820s by T. Wilcox, the property was held from c1841 to possibly the
	1890s by local saddler George Guest. As a town barn, the building would
	have been used in association with farm lands located outside of the town of
	Windsor, emphasising the continued importance of agriculture in the district

	well into the 20 th century.
	Meets the criterion on a Local level.
CRITERIA B) HISTORICAL ASSOCIATION	The town barn at No. 102 Lennox Street, Richmond has historical associations with free-settler George Guest, saddler, who possibly built the barn for use in his business. Meets the criterion on a Local level.
CRITERIA C) AESTHETIC/ TECHNICAL	Located at the rear of the main residence, the barn is not visible from the street and makes no contribution to the historical character of Lennox Street. The single storey barn, although modified and adapted, is of technical significance for retaining evidence of its mid 19 th century construction date including some adzed square or faced posts and the use of vertical timber slabs (some 400 wide) up to loft floor level. Meets the criterion on a Local level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The barn No. 102 Lennox Street, Richmond, has the potential to provide further information into the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21 st century. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 102 Lennox Street, Richmond is potentially rare within the context of the Hawkesbury City local government area, as a surviving mid 19 th century town barn. Meets the criterion on a Local level.
CRITERIA G) REPRESENTATIVE	The barn at No. 102 Lennox Street, Richmond is representative of the long history of agricultural development within the Hawkesbury area, which commenced in the late 18 th century and continues today. The basic form of the barn with gabled roof, remains of a loft and vertical timber slab wall cladding is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.
INTEGRITY/ INTACTNESS	Moderate

IMAGES

Issue: March 2025



Caption: The town barn at No. 102 Lennox Street, Richmond (exterior). Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023




Caption: The town barn at No. 102 Lennox Street, Richmond (interior). Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023



Issue: March 2025

Caption: The town barn at No. 102 Lennox Street, Richmond (interior). Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

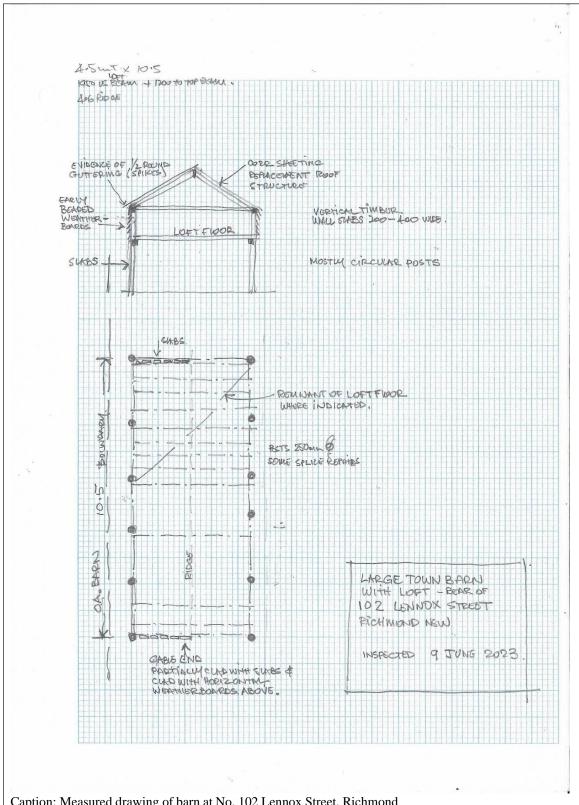

Caption: Measured drawing of barn at No. 102 Lennox Street, Richmond

Copyright Owner: Graham Edds & Associates

Issue: March 2025

Date: June 2023

ITEM DETAILS		
NAME	Single storey town barn	
OTHER/FORMER NAMES	Rutherglen	
ADDRESS		
	158 March Street, Richmond	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Ham Common	
LOT/DP	Lot A Section 6 DP 152400	
SHI No.	1743056	
EXISTING HERITAGE	Y- I69 (1741094)	
ITEM? RECOMMENDED MANAGE	MENT	
	Not recommended for State listing	
MANAGEMENT SUMMARY	Retain Local listing. Whole property potentially worthy of State listing.	
ITEM CLASSIFICATION	Retain Local listing. Whole property potentially worthly of State listing.	
ITEM TYPE	Built	
ITEM TITE ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn/shed	
DESCRIPTION	Dairionou	
PERIOD	Early 19th century (pre 1841)	
MODIFICATION/DATES	Mid 20 th century	
CURRENT USE	Storage	
FORMER USE	Barn/shed	
LOCATION ON SITE:	Behind two-storey Georgian townhouse approximately 50m south of the	
Econicon on Sile.	road (approximately the same location as shown on 1841 survey).	
MAIN BARN STRUCTURE	A small square town barn/shed composed of adzed square posts, sawn eaves	
	beams and slender pole cross beams.	
	Condition: Moderate	
	Date: Early 19 th century.	
NO. OF BAYS	Two	
ROOF STRUCTURE	Rafters are split timber pitched at 45°. Battens are suitable for iron.	
	Condition: Moderate	
	Date: Early 19 th century.	
SKILLION 1	Pole rafters supported on pole edge beam.	
	Condition: Moderate	
POOF CLAPSTYC	Date: Early 19 th century.	
ROOF CLADDING:	Corrugated iron short sheets.	
	Condition: Moderate Date: Mid-20 th century?	
	<u> </u>	
WALL CLADDING	Vertical timber slabs with shaped tops. Vertical timber boarding to gable is	
	modern.	
	Condition: Moderate	
	Date: Early 19 th & late 20 th century	
OPENINGS	Modern double doors.	
FLOORING (GROUND)	Earth	
FLOORING (SKILLION)	Earth	
OTHER (Fixings?)	Posts notched to accept beams in two directions.	
CURRENT USE	Store shed.	
CHANGES FROM 2010?	N/A	
HISTORY		
1		

The barn at Rutherglen, 158 March Street, Richmond is located on Lot 2 Section 6 of the Richmond Town Plan. This allotment, measuring 1 acre 3 roods 25 perches, was granted to William Sharp on 24 August 1841 in accordance with the report on Case 969 Court of Claims of 21 July 1841. The land had originally been

promised to Thomas Spencer by Governor Macquarie, however a list dated 1822 and deposited in the Surveyor-General's Office indicated that the land had previously been sold to Robert Burns. The Government Gazette noted that the widow of Robert Burns had married the claimant and probably the allotment belonged to the heir-at-law of Burns.

William Sharp's first wife was a Sarah Reeves (nee Rumble), who had previously been married to a Robert Reeves and so, perhaps the reference to a Robert Burns was a misnomer.

Building footprints were shown on survey of Richmond by surveyor J. J. Galloway of March 1841. A small building was shown behind the main house near the western boundary of the allotment in approximately the same location as the existing barn/shed. The property originally stretched from March Street southwards to Lennox Street and it is assumed that the land to the rear of the house was used for the production of food for the owners, hence the need for a barn.

William Sharpe [sic] of Richmond, farmer, conveyed Lot 2 Section 6 to Joseph Onus, of Richmond gentleman on 14 August 1888 for £825. Joseph was his second wife Ann's son by her first marriage, to Joseph Onus Snr., who was an ex-convict and successful landowner of cattle stations, with a number of properties in the town of Richmond. The property remained in the Onus family, passing to Joseph Onus's grandson until sold to Albert Grimwood in 1921.

REFERENCES	R.469b Crown plan
	Grants, Vol 52 No 94
	Old System Deed, No 320 Bk 395
	NSW Government Gazette, Friday 21st May 1841 (Issue No. 40), p. 726
	Statement of Heritage Impact: 158 March Street, Richmond, Archnex Designs, 2014
	https://convictrecords.com.au/convicts/oness/joseph/107246

SUMMARY STATEMENT OF SIGNFICANCE

Issue: March 2025

The town barn at Rutherglen, No. 158 March Street, Richmond is of historical significance as a rare, surviving early 19th century timber framed barn/shed, constructed prior to 1841, contemporary with the Georgian house located at the property. Granted in 1841 to William Sharp, farmer, the property remained in the hands of the extended Sharp family via his stepson Joseph Onus until the early 1920s.

The small single storey barn/shed is of technical significance for retaining evidence of its early 19th century construction date including adzed square posts, sawn eaves beams, slender cross beams and pole rafters supported on pole edge beam. The barn provides evidence of the continuity of use of historic agricultural buildings into the 21st century. In its overall form and configuration, it is a representative, although small scale, example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

A GGEGGED GLGAVEDIG ANGE	Y 1
ASSESSED SIGNIFICANCE	Local
TYPE	
CRITERIA A) HISTORICAL	The barn at Rutherglen, 158 March Street, Richmond is of historical
	significance as a surviving early 19 th century town barn. Documentary
	evidence indicates that it was constructed contemporary with the main
	Georgian house prior to 1841. As a small town barn or shed, the
	building was probably used for the cultivation of produce for the house
	on the original 1 acre grant.
	Meets the criterion on a Local level.
CRITERIA B) HISTORICAL	The town barn at No. 158 March Street, Windsor has historical
ASSOCIATION	associations with William Sharp, farmer, who was granted the property
	in 1841, although the site had already been developed at the time of
	the grant with the house and barn. The property remained in the hands
	of Sharp until the 1890s when it passed to his stepson Joseph Onus,
	farmer, and later Onus's grandson, who held the property until the
	1920s. The Onus family are associated with ex-convict and successful
	landowner of cattle stations Joseph Onus.
	Meets the criterion on a Local level.
CRITERIA C)	Located at the rear of the main residence, the small town barn is not
AESTHETIC/TECHNICAL	visible from the street and makes no contribution to the historical
	character of March Street.
	The single storey barn is of technical significance for retaining
	evidence of its early 19th century construction date including adzed

	square posts, sawn eaves beams, slender cross beams and pole rafters
	supported on pole edge beam.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the
SOCIAL/CULTURAL	local community and others, being symbolic of the history of the
	agricultural development of the region, as evidenced by the numerous
	exhibitions, artworks, historical tours, heritage studies and heritage
	listings associated with these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The town barn No. 158 March Street, Richmond provides evidence of
POTENTIAL	the long-term continuity of use of early 19 th century agricultural
	buildings into the 21st century.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 158 March Street, Richmond is potentially rare within
	the context of the Hawkesbury City local government area, as a
	surviving early 19 th century town barn that remains relatively intact.
	Meets the criterion on a Local level.
CRITERIA G)	The barn at No. 158 March Street, Richmond is representative of the
REPRESENTATIVE	long history of agricultural development within the Hawkesbury area,
	which commenced in the late 18 th century and continues today.
	The basic form of the barn with gabled roof and vertical timber slab
	wall cladding is representative of the typical form of barn found
	throughout the district, although a small example associated with the
	Georgian house.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Moderate to High

IMAGES

Issue: March 2025



Caption: The town barn at No. 158 March Street, Richmond (exterior).


Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson &

Partners

Date: May 2023



Caption: The town barn at No. 158 March Street, Richmond (interior). Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023

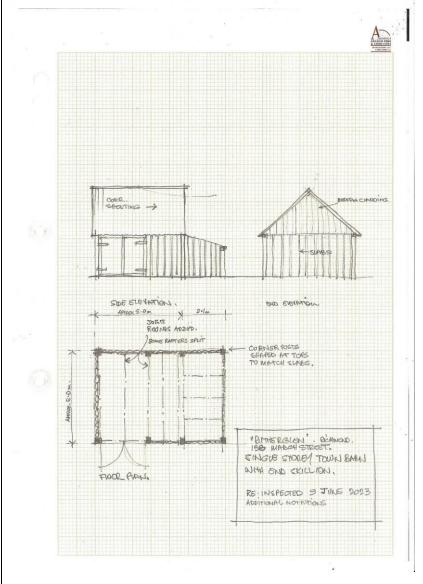

Issue: March 2025

Caption: Measured drawing of barn at No. 158 March Street, Richmond Copyright Owner: Grah am Edds and Associates Date: June 2023

ITEM DETAILS	
NAME	Single storey town barn with loft
ADDRESS	11 West Market Street/ 239 Windsor Street, Richmond
LOCAL GOVT AREA	,
PARISH	Hawkesbury Ham Common
LOT/DP	Lot 1 DP 770613
SHI No.	1743055
EXISTING HERITAGE ITEM?	Y- I90 (SHI No. 1743199)
RECOMMENDED MANAGEM	FNT
MANAGEMENT SUMMARY	Not recommended for State listing
WANAGEMENT SUMMART	Retain as local item- more information needed to confirm date of
	construction and modifications.
ITEM CLASSIFICATION	construction and modifications.
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid to late 19 th century (potentially)
CURRENT USE	Storage warehouse
FORMER USE	Town Barn
LOCATION ON SITE:	The barn stretches the entire width of the urban block of land from the
Eccition on site.	street frontage to the north-western corner of the block.
MAIN BARN STRUCTURE	A long town barn approximately 20 x 5m on plan with a continuous loft.
Will Brid Brid Brid Creat	Posts are mostly obscured by the building's contents but those that are
	visible are adzed square and extend through to the eaves level. The
	structure is robust and well built and appears to be partially rebuilt.
	Longitudinal beams are of a deep rectangular section, circular sawn. Loft
	floor joists are notched over beams and have herringbone strutting.
	Condition: Good
	Date: Mid to late 19 th century (potentially)
NO. OF BAYS	Not known
ROOF STRUCTURE	Roof framing is circular sawn hardwood. Rafters have low collar ties bolted
	with modern bolts and are birdsmouthed over the longitudinal beams.
	Condition: Good
	Date: Mid to late 19 th century (potentially)
LOFT	Loft is well built (rebuilt?) with deep joists spanning between longitudinal
	beams, herringbone strutting, tonged and grooved flooring and wall linings
	of beaded horizontal boards.
	Date: Mid to late 19th century (potentially)
SKILLION 1	Skillion addition to half the length of the southern side of the barn.
	Condition: Good.
POOF OF A PRINC	Date: Mid to late 19 th century (potentially)
ROOF CLADDING:	Corrugated steel long sheets.
	Condition: Good
WALL CLADDING	Date: Mid to late 19 th century (potentially)
WALL CLADDING	Vertical timber slabs with cover strips of galvanized steel. Weatherboard
	outer cladding added later. Condition: good
	Date: Mid to late 19 th century (potentially)
OPENINGS	The loft has a door on the street front with a beam over for hoisting in
OFEMINGS	goods. There are a series of louvred ventilation openings in the loft wall.
FLOORING (GROUND)	Concrete slab
FLOORING (GROCKD)	Timber boarding
FLOORING (EUF 1) FLOORING (SKILLION)	Not known
FLOORING (SKILLION)	TYUL MIOWII

INTERNAL STRUCTURE	Stair and additional support posts have been inserted under loft floor beam.
OTHER (Fixings?)	Bolts with square nuts indicating late 19 th early 20 th century construction.
CURRENT USE	Warehouse
CHANGES FROM 2010?	Change of use.
HISTORY	

The barn at No. 239 Windsor Street, Richmond is located on Lot 3 Section 4 of the Richmond Town Plan. This land forms part of a grant of 15 September 1841 to John Stephenson, Richmond for 1 acre 2 roods 9 perches. It had been promised to him by Lachlan Macquarie.

On 28 & 29 June 1842, by a deed of lease and release, John Stephenson conveyed 30½ perches bounded on the south west by Windsor Street 63 feet 5 inches and on the south east by West Market Street, 132 feet to Abraham Cornwell for £120. Cornwell was described as a settler and he owned substantial amounts of land including in Emu Plains as well as throughout the town of Richmond. Cornwell owned the property for many years. According to Sam Boughton's reminiscences published in the *Hawkesbury Herald* in 1903, the site was used for a bakery. Occupiers included a man named Williams, followed by James Martin Kelly, and then Frederick Withers. All would have been tenants of Abraham Cornwell.

On 19 September 1881, Abraham Cornwell of Richmond, tanner conveyed the 30½ perches described as in the 1842 deed to Thomas Chalmers, Richmond, baker for £1000. From the time of his purchase, Thomas Chalmers occupied the land as a bakery. In 1897, he demolished the existing buildings facing Windsor Street and erected Chalmers buildings on the corner.

Chalmers died in 1899 leaving the property to his wife, Mary. He had previously conducted a flour mill at Clarendon, and then as a miller in the old brewery, buildings, at Windsor.

REFERENCES	Grants, Vol 52 No 137
	Old System Deed, No 678 Bk 1
	Old System Deed, No 943 Bk 230
	Old System Deed, No 871 Bk 625
	Windsor and Richmond Gazette, 13 March 1897, p 12; 10 April 1897, p 12;
	21 Oct 1899, p 4
	Hawkesbury Herald 19 June 1903 p 11

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 239 Windsor Street, Richmond is of historical significance as a surviving mid to late 19th century timber framed barn, potentially associated with landowner Abraham Cornwell, who owned the site from the 1840s to 1880s. As the property was in use as a bakery, the town barn may have been constructed for this use.

Located at the rear of a notable row of shopfronts, the Chalmers Building, the barn faces West Market Street and is a notable historic feature in the streetscape, making a strong contribution to the locality of the area. The single storey barn is of technical significance for retaining evidence of its mid to late 19th century construction date including a continuous loft with adzed square posts extending through to the eaves level, loft floor joists notched over beams with herringbone strutting and vertical timber slabs with cover strips of galvanised steel.

The town barn has the potential to provide further information into mid to late 19th century commercial practices within the township and in its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

• • • • • • • • • • • • • • • • • • • •	
ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 239 Windsor Street, Richmond is of some historical
HISTORICAL	significance as a surviving mid to late 19th century town barn, associated with a
	notable Victoria row of shopfronts, the Chalmers Building, constructed 1897.
	As a town barn, the building would have been used in association with farm
	lands located outside of the town of Windsor, emphasising the continued
	importance of agriculture in the district well into the 20 th century.
	Meets the criterion on a Local level.
CRITERIA B)	The town barn at No. 239 Windsor Street, Richmond has some historical
HISTORICAL	associations with Abraham Cornwell, settler and landholder, who owned the
ASSOCIATION	property from the 1840s to 1880s. As a bakery operated from the property
	during this period, the barn was potentially built in association with this use.
	Meets the criterion on a Local level.

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

CRITERIA C) AESTHETIC/TECHNICAL	Located at the rear of a notable row of shopfronts, the Chalmers Building, the barn faces West Market Street and is a notable historic feature in the streetscape, making a strong contribution to the historic character of the locality. The single storey barn is of technical significance for retaining evidence of its mid to late 19 th century construction date including a continuous loft with adzed square posts extending through to the eaves level, loft floor joists notched over beams with herringbone strutting and vertical timber slabs with cover strips of galvanised steel. Meets the criterion on a Local level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The town barn at No. No. 239 Windsor Street, Richmond has the potential to provide further information into mid to late 19 th century commercial practices within the township and the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21 st century. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 239 Windsor Street, Richmond is potentially rare within the context of the Hawkesbury City local government area, as a surviving mid to late 19 th century town barn associated with a commercial premises. Meets the criterion on a Local level.
CRITERIA G) REPRESENTATIVE	The town barn at No. 239 Windsor Street, Richmond is representative of the long history of agricultural development within the Hawkesbury area, which commenced in the late 18 th century and continues today. The basic form of the barn with gabled roof, loft, skillion and vertical timber slab wall cladding is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.
INTEGRITY/ INTACTNESS	Moderate

IMAGES

Issue: March 2025



Caption: The town barn at No. 239 Windsor, Richmond (exterior).

Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: surviving original slabs at the town barn at No. 239 Windsor, Richmond (interior). Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: May 2023




Issue: March 2025

Caption: The town barn at No. 239 Windsor, Richmond (loft interior).

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: May 2023

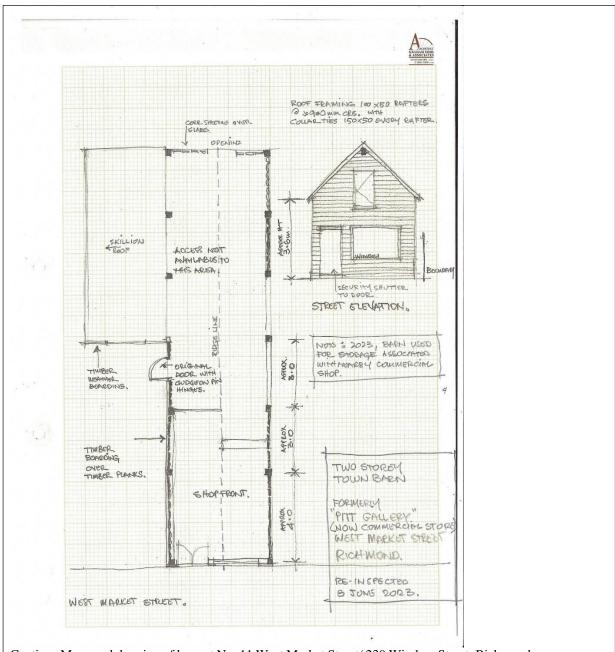

Caption: Measured drawing of barn at No. 11 West Market Street/ 239 Windsor Street, Richmond Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS		
NAME	Single Storey Slab Barn with Loft and Skillions	
ADDRESS	888 Sackville Road, Sackville	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Wilberforce	
LOT/DP	Lot 4 DP 616167	
SHI No.	1743071	
EXISTING HERITAGE	Y - I373 (SHI 1743057)	
ITEM?		
RECOMMENDED MANAGE	RECOMMENDED MANAGEMENT	
MANAGEMENT	Not recommended for State or local listing	
SUMMARY	Remove reference to barn in existing listing for the property.	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	Early 19 th century	
MODIFICATION/DATES	?	
CURRENT USE	Dilapidated	
FORMER USE	Barn	

2023: Site inspection revealed that the barn had substantially collapsed (only 3 bays of 8 remaining) and is not salvageable.

The following description is from the 2010 Hawkesbury Slab Barn Study, Graham Edds & Associates:

A long and tall rectangular barn with gabled roof containing 8 bays of differing widths, now only partially clad with timber slabs and horizontal boarding. The ground floor contains three horse stalls each with feed trough along one end and a drying loft above.

The opposite end also contains a loft in poor condition, with floor joists temporarily supported as the edge beam is missing. Only the perimeter of the horse stalls and the opposite end wall are clad with slabs. The remainder is open. The loft claddings are similarly missing except for a small section on the western side wall and the complete gabled end and corrugated metal along the opposite long side.

The barn is approx. 18 0 metres long x 5.5 metres wide with a 3.0 metre skillion at one end.

The barn is located on the rise from Sackville Road possibly higher than flood level and associated with an Inter-War house.

Structure:

A post and beam structure utilising roughly adzed square posts and beams with bolted plate connections. Wall plates for the spiking of the vertical timber slabs have been housed into the posts and double as the support for the loft floor joists. The loft floor remnants are clad with loose bush poles indicating this area was utilised for the drying of produce. The loft walls are framed with vertical timber studs for the fixing of horizontal external boarding.

The roof structure is framed at wide rafter spacings for metal roof sheeting.

HISTORY

Issue: March 2025

This land was originally promised to Edward Churchill by Governor Lachlan Macquarie in exchange for a piece of land at Windsor. On 11 & 12 January 1833, by a deed of Lease and release, Edward Churchill of Portland Head sold the land to Stephen Tuckerman of Portland Head for £500. It was described as 200 acres at Portland Head (Portion 3, Parish Wilberforce) adjoining the farms of Addy, Crawford and Hall. After the land was advertised for a grant in the name of Churchill, Tuckerman applied to receive the land. The case was sent to the Court of Claims, which decided in his favour.

Stephen Tuckerman of Sackville Reach, County Cook, was granted 200 acres, at Lower Portland Head, County Cook on 8 August 1835. The land was bounded on the east by Crawford's farm now Byrns and part of Addys Farm, on the north by the River Hawkesbury, on the west by Churchill's 80 acre farm, on the south by an easterly line 41 chains to a narrow drain of the swamp, and on the east by that drain to the corner of Crawford's farm. It had been promised on 31 January 1818 by Governor Macquarie to Edward Churchill and was granted in accordance with report 113 under the Court of Claims, 4 Wm IV No 9.

Stephen Tuckerman of Sackville Reach signed his will on 21 November 1874 leaving part of the property to his daughter Clara on condition of paying various sums to his other children. Stephen Tuckerman died on 1 February 1875.

On 10 November 1876, Arthur Charles Macquarie Bowman, lately of Sackville Reach but now of Hawthorn, Victoria gentleman, and his wife, Clara (originally Clara Tuckerman) conveyed 145 acres, including parts of Addy's Farm and Tuckerman's grant to James Holmes, Windsor, hotelkeeper for £500. It included 90 acres of Tuckerman's grant, which is the land upon which the barn is situated.

REFERENCES Grants, Vol 41 No 17

Old System Deed, No 667 Bk E Old System Deed, No 444 Bk 164

STATEMENT OF SIGNIFICANCE

SUMMARY STATEMENT OF SIGNFICANCE

[2010 inventory sheet]

A representative example of a long Hawkesbury barn with loft still utilised with horse stalls and close to the river located on the side of the hill above the location of the Sackville Ferry. This barn is probably associated with an earlier cottage and not the existing Inter-war bungalow on site.

INTEGRITY/INTACTNESS | Mostly collapsed- only 3 bays of 8 remain.

IMAGES

Issue: March 2025



Caption: Barn at 888 Sackville Road, Sackville (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners Pty

Ltd

Date: June 2023



Caption: Barn at 888 Sackville Road, Sackville (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners Pty

Ltd


Date: June 2023



Caption: Barn at 888 Sackville Road, Sackville (interior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners Pty

Ltd

Date: June 2023

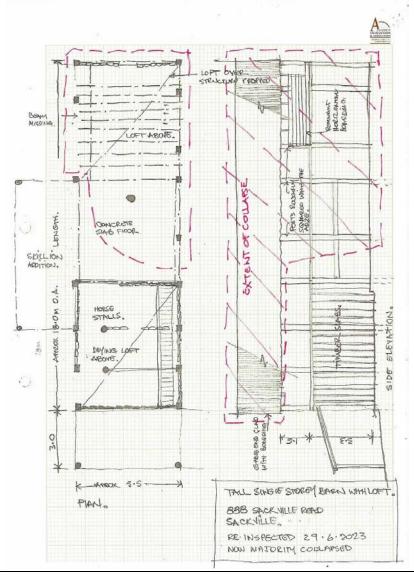

Issue: March 2025

Caption: Measured drawing of Barn at 88 Sackville Road,

Sackville

Copyright Owner: Graham Edds

& Associates
Date: June 2023

ITEM DETAILS	
NAME	Elevated Single Storey Slab Barn with Side Skillions
ADDRESS	
	1834 Settlers Road, St Albans
LOCAL GOVT AREA	Hawkesbury
PARISH	St Albans
LOT/DP	Lot 49 DP 1113128 (House Lot 2 755258)
SHI No.	1743115
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAC	GEMENT
MANAGEMENT	Not recommended for State listing.
SUMMARY	Recommend for Local listing-
	Site inspection required into condition and integrity.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid-late 19 th century
MODIFICATION/DATES	?
CURRENT USE	Not known
FORMER USE	Storing/drying corn
LOCATION ON SITE:	Approximately 90m north of the road. NB access was not available to this barn.
	The following description is based on the previous report by Graham Edds &
	Associates (2010) and viewing from the public road.
MAIN BARN	Single storey barn (8 x 3.6m on plan) with side skillions and suspended timber
STRUCTURE	floor. Floor beams are spiked to posts. Longitudinal beams are bush poles shaped
	and spiked at supports.
	Condition: Not known
NO. OF BAYS	Date: late 19 th century
NO. OF BAYS	Two
ROOF STRUCTURE	Rafters are of split timber with sawn battens and roof pitch is approximately 30°.
	Condition: Not known
	Date: late 19 th century
LOFT	N/A
SKILLIONS	Built integrally with the barn and used for drying corn.
SKILLIONS	Condition: Not known
	Date: late 19 th century
ROOF CLADDING:	Corrugated iron in short sheets.
	Condition: Not known
	Date: late 19 th century
WALL CLADDING	-
WALL CLADDING	Vertical timber slabs, weatherboards in gables. Condition: Not known
	Date: late 19 th century
OPENINGS	Double door at end of barn only.
	<u> </u>
FLOORING (GROUND)	Raised timber floor with some areas slatted for drying.
FLOORING (SKILLION)	Raised timber floor with some areas slatted for drying.
HISTORY	

The barn at No. 1834 Settlers Road, St. Albans is located on part of a 50 acre grant (Portion 49, Parish St. Albans) made to John Wait on 30 June 1823.

Issue: March 2025

On 22 & 23 July 1833 by a deed of Lease and release, John Wait, farmer of Sydney sold the 50 acres as granted

to James Comer, of Sydney innkeeper for £30. It was followed on 25 & 26 July 1833 by a deed of Lease and release, when James Comer sold the grant to Thomas Holmes, of Castlereagh Street, Sydney, builder for £50.

On 25 July 1843, Thomas Holmes, originally of Castlereagh Street, Sydney, builder but then a farmer of Williams River and his wife, Miriam sold the 50 acres to Matthew George Thompson of Macdonald River, farmer for £50.

Matthew George Thompson was a significant landholder in the area who died in 1899. The property was still in the hands of the Thompson family in 2010, when the owner at the time Norma Thompson indicated that she had lived on the property all her life and that the barn was used primarily to store and dry corn. The side skillions were the drying areas and the central bay used to unload and dehusk the corn before throwing them into the drying area.

A crown plan survey of adjacent land on 25 August 1898 marked a square in approximately the same position as the barn, possibly indicating a building or a fenced area. The 1934 St Albans topographic map sheet appears to show the footprint of a building in this approximate location.

REFERENCES	Grants, Volume 17 No 74
	Old System Deed, No 166 Bk F
	Old System Deed, No 173 Bk F
	Old System Deed, No 608 Bk 9
	N.1356.2111, Crown Plan
	1934 topographic map St Albans, 1:633360 series, Zone 8 Sh 409
OF A THE PERSON OF GROSTERS	CANON

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 1834 Settlers Road, St. Albans is of historical and aesthetic significance as a surviving mid to late 19th century timber framed barn forming part of an historic farm complex, picturesquely sited at the foot of the Womerah Range on the outskirts of the town of St. Albans. The barn is associated with Matthew George Thompson and the Thompson family, early settlers in the district and successful landholders, who owned the property from the mid 19th through to the 21st century. The barn is a representative example of the typical form of agricultural outbuilding found throughout the Hawkesbury City local government area.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 1834 Settlers Road, St Albans is of historical significance as a
HISTORICAL	mid to late 19th century timber framed agricultural building, that forms part of an
	historic farm complex.
	Meets the criterion on a Local level.
CRITERIA B)	Located on land associated with members of the Thompson family, early settlers
HISTORICAL	in the district and substantial landholders, the property was held by the Thompson
ASSOCIATION	family from the mid 19 th through to the 21 st century.
	Meets the criterion on a Local level.
CRITERIA C)	Located in the foothills of the Womerah Range just outside of the village of St
AESTHETIC/	Albans, the barn, within a complex of timber outbuildings is of aesthetic
TECHNICAL	significance for contributing to the historical character of the St Albans district.
	The building is potentially of some technical significance for demonstrating
	traditional mid to late 19 th century construction techniques for agricultural
	outbuildings.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns and outbuildings of the Hawkesbury district are appreciated by
SOCIAL/CULTURAL	the local community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions, artworks,
	historical tours, heritage studies and heritage listings associated with these
	building types.
	Meets the criterion on a Local level.
CRITERIA E)	Being constructed in the mid to late 19 th century, the barn has the potential to
RESEARCH	provide further information into farming practices and construction methods of
POTENTIAL	this period.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 1834 Settlers Road, St Albans is not considered to be rare within
	the context of the Hawkesbury City local government area.
	Does not meet the criterion.
CRITERIA G)	The barn at No. 1834 Settlers Road, St Albans is representative of the long

REPRESENTATIVE	history of agricultural development within the floodplains of the MacDonald River, which commenced in the early 19 th century and continues today. The building is a representative example of a typical timber framed agricultural
	outbuilding found throughout the Hawkesbury City local government area. Meets the criterion on a Local level.
INTEGRITY/ INTACTNESS	Unknown

IMAGES

Issue: March 2025




Caption: Barn at No. 1834 Settlers Road, St Albans Photographer: K. Denny Copyright Owner: Lucas Stapleton

Johnson & Partners Date: June 2023



Caption: Barn at No. 1834 Settlers Road, St Albans Photographer: K. Denny Copyright Owner: Lucas Stapleton

Johnson & Partners Date: June 2023

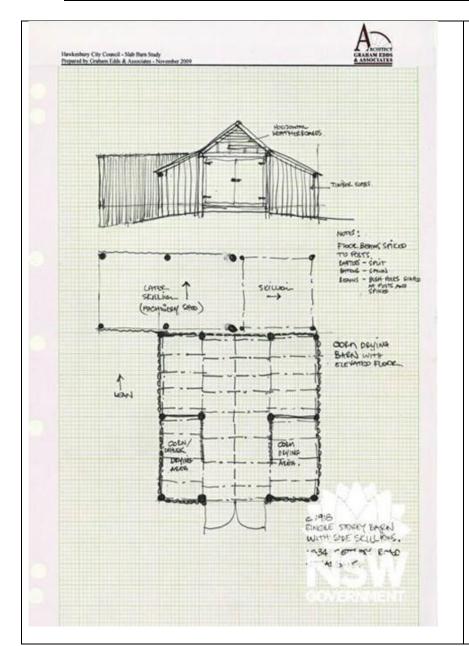

Caption: Measured drawing of barn at No. 1834 Settlers Road, St Albans Copyright Owner: Graham Edds & Associates Date: 2010

ITEM DETAILS		
NAME	Single Storey Barn with Loft- Demolished	
OTHER/FORMER NAMES	Price Morris Cottage	
ADDRESS	37 Upper Macdonald Road, St Albans	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Macdonald	
LOT/DP	Lot 26 DP 753793	
SHI No.	1743112 (also 5051285 – listing)	
EXISTING HERITAGE	Y – Local (I01444) and State (SHR 01444)	
ITEM?		
RECOMMENDED MANAGEMENT		
MANAGEMENT	Not recommended for State or local listing	
SUMMARY	Update inventory sheets.	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	19 th century	
MODIFICATION/DATES	?	
CURRENT USE	N/A	
FORMER USE	Barn	

2023: Barn has been demolished.

[2010 inventory sheet]

Issue: March 2025


A small single storey barn (formerly with loft) with a gabled roof at one end and hipped at the opposite end. The barn is located at the roadside on the southern bank of the Upper Macdonald River and is associated with the slab cottage further up the hillside.

The barn is in a stable but deteriorated state and remains as a skeletal frame with a roof. The rectangular shaped barn is constructed in 3 bays, 2 x 4 metres and 1 x 3 metres, each 4 metres wide (total length approx. 11 metres x 4 metres). The wall claddings are a combination of timber slabs and weatherboards and the roof is clad with corrugated metal. A White Cedar tree is located adjacent to the gable end wall.

A post and beam structure with simply supported roof frame fixed to the uppermost perimeter beam. A second level of beams supports the former loft floor joists. The beams are circular sawn and roughly square (approx. 150mm x 120mm), housed and bolted to the posts. The posts are approx. 200-250mm diam. The rafters are thin bush poles approx. 60-75mm diam and spaced at approx. 1200mm centres. A few remnant timber slabs are located along one side and end and are nail fixed at the top. The wall cladding to the loft, between the two wall beams is vertical timber boards.

INTEGRITY/INTACTNESS No barn

IMAGES

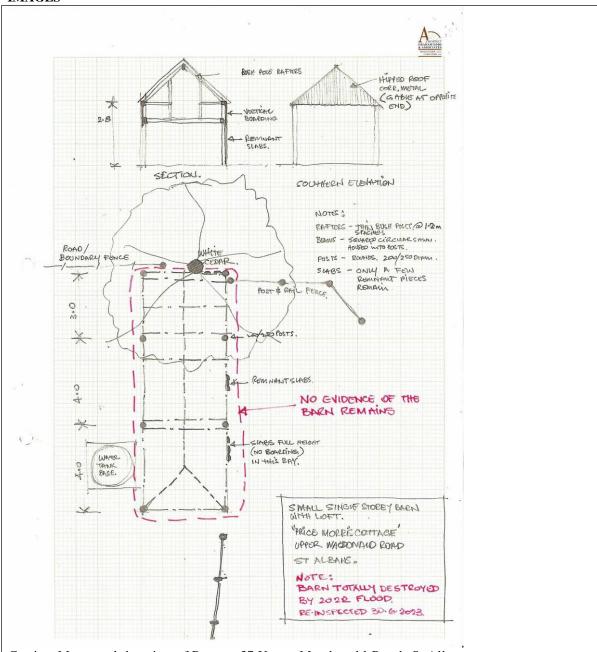

Caption: Measured drawing of Barn at 37 Upper Macdonald Road, St Albans Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS	
NAME	Complex of two slab barns
OTHER/FORMER NAMES	Jacks Dairy
ADDRESS	
	239 Upper Macdonald Road, St Albans
LOCAL GOVT AREA	Hawkesbury
PARISH	Macdonald
LOT/DP	Lot 14 DP 708324
SHI No.	1743113
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGE	EMENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local listing.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn & Milking shed
DESCRIPTION	
CIRCA	Y
PERIOD	Early 20th century
CURRENT USE	Machinery and feed store/animal shelter
FORMER USE	Milking shed and barn
LOCATION ON SITE:	A pair of barns on either side of the entrance driveway. One is 10m west of
LOCATION ON SITE.	the road, the other 25m. Access was not available but enough could be seen
	from the driveway.
DESCRIPTION BARN 1 – M	
MAIN BARN STRUCTURE	A single storey barn with its length orientated north-south with skillions on
	both sides. It measures approx. 14 x 5m on plan and is sited on sloping ground
	with the fall across the width of the barn. Round posts support round pole
	longitudinal beams which are flattened where they meet the top of the post
	which is halved and bolted through the beam. Round pole cross beams are in
	turn halved over the longitudinal beams.
	Condition: Good
NO. OF BAYS	Date: early 20 th century
	Four
ROOF STRUCTURE	Slender bush pole rafters meet at the ridge board and support sawn battens for
	iron. Thin bush poles are fixed diagonally for wind bracing. The roof has a
	pitch of approx. 30°.
	Condition: Date: early 20 th century
GYTY I TOY I	The eastern skillion is divided by rails into four stalls and has access to a
ICKILLIANI	THE EASTERN SKITHOLD IS CITYLEED BY TAILS THEO TOUT STAILS AND HAS ACCESS TO A
SKILLION 1	
SKILLION 1	continuous feeding trough along the eastern side of the main barn.
SKILLION 1	continuous feeding trough along the eastern side of the main barn. Condition: Good
	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century
SKILLION 1 SKILLION 2	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay.
	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle.
	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition:
SKILLION 2	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century
	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron.
SKILLION 2	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron. Condition: Moderate
SKILLION 2 ROOF CLADDING:	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron. Condition: Moderate Date: early 20 th century
SKILLION 2	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron. Condition: Moderate Date: early 20 th century Vertical timber slabs enclose the western skillion and southern end. Slabs are
SKILLION 2 ROOF CLADDING:	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron. Condition: Moderate Date: early 20 th century Vertical timber slabs enclose the western skillion and southern end. Slabs are of differing lengths and some have previous cut-outs and possibly have been
SKILLION 2 ROOF CLADDING:	continuous feeding trough along the eastern side of the main barn. Condition: Good Date: early 20 th century The western skillion is enclosed with timber slabs apart from one open bay. Roofing is supported on bush poles laid at a very flat angle. Condition: Date: early 20 th century Galvanised corrugated iron. Condition: Moderate Date: early 20 th century Vertical timber slabs enclose the western skillion and southern end. Slabs are

Appendices

	Date: early 20 th century	
OPENINGS	One open bay in western skillion, openings at each end of main barn, eastern skillion fully open.	
FLOORING (GROUND)	Timber boarding runs the length of the barn and is supported on logs laid across the barn on the ground.	
FLOORING (SKILLION)	Earth in eastern skillion and concrete slabs in western one.	
OTHER (Fixings?)	Bolted	
CURRENT USE	Machinery and feed store.	
DESCRIPTION BARN 2- Internal access was not available to this barn.		
MAIN BARN STRUCTURE	A single storey barn smaller than Barn 1 with its length orientated east-west with skillions on both sides. It measures approx. 8 x 5m on plan with 3m wide skillions. Round posts support round pole longitudinal beams. Round pole cross beams are in turn halved over the longitudinal beams. Condition: Good Date: early 20 th century	
NO. OF BAYS	Four	
ROOF STRUCTURE	Slender bush pole rafters support sawn battens for iron. Thin bush poles are fixed diagonally for wind bracing. The roof has a pitch of approx. 30°. Condition: Good Date: early 20 th century	
SKILLIONS	Both skillions are constructed of bush pole rafters on round posts but earlier square posts were identified outside the southern perimeter indicating that reconstruction work has occurred. Condition: Good Date: early 20 th century	
ROOF CLADDING:	Galvanised corrugated iron. Condition: Moderate Date: early 20 th century	
WALL CLADDING	Vertical timber slabs enclose half the length of the perimeter. Slabs are nailed to a bottom plate and to the eaves beam. Gables are clad in corrugated iron. Condition: Moderate. Date: early 20 th century	
OPENINGS	Half the perimeter bays are open and half enclosed with slabs.	
FLOORING (GROUND)	Remains of timber boarding was reported at the eastern end.	
FLOORING (SKILLIONS)	Earth	
OTHER (Fixings?)	Bolted	
CURRENT USE	Storage/ shelter	
HISTORY		

Issue: March 2025

The barn and milking shed at Jack's Dairy, No. 239 Upper Macdonald Road, St Albans are located on part of a 60 acre grant (Portion 33, Parish Macdonald) made to Sylvester Butler in 1823. Conditions of the grant included that he clear and cultivate 16 acres within five years.

The following year, Butler assigned his 60 acres to Mary Fernance for £30. The Fernance family was a notable family in the district, creating a network of land holdings along the river, including Portion 34 immediately to the north.

On 30 April 1857, John Fernance, Macdonald River, farmer and his wife Mary conveyed Butler's 60 acre grant to Aaron Walker, Macdonald River, farmer as trustee for the benefit of their son, Charles Fernance. Mary Fernance died on 9 July 1860 and John Fernance died on 10 October 1860. Many of the family left the district and settled at Ulmarra on the Clarence River, selling various parcels of land. Some was sold to Thomas Thompson including Portion 33.

The Thompson family later expanded their land holdings by obtaining the adjoining land Portion 28, an 80 acre grant originally applied for in 1908 by Frederick Thompson and granted via an Additional Condition Purchase, applied for in 1918 and granted on 6 July 1920.

The property was transferred to Henry Ernest Bailey, farmer, in 1935 and then passed to his son Charles John Bailey in 1967.

The Bailey and Thompson families inter-married and both families were early settlers in the St Albans area.

The property is known as Jack's Dairy after Charles John Bailey, known as Jack. Charles John Bailey was interviewed by Jill Gumbley for the *Australia 1938* oral history project (1982), held in the National Library of Australia.

Based on the physical evidence of the barns including low pitched roofs, bolted lapped joints, use of traditional timber slabs and bush poles, some earlier squared posts indicating extensive repair/ reconstruction, the barn appears to have been constructed in the early 20th century and seem likely to have been constructed by Thomas Thompson.

REFERENCES	Grants Vol 15 No 79
	Old System Deed, No 521 Bk E
	Old System Deed, No 930 Bk 48
	Old System Deed, No 682 Bk 317
	Certificate of Title Volume 3082 f 12

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn and milking shed at Jack's Dairy, No. 239 Upper Macdonald Road, St. Albans are of historical significance as surviving early 20th century timber framed agricultural buildings associated with former owners Thomas Thompson and Charles 'Jack' Bailey after whom the property is named, and for being located on land that is associated with members of the Fernance, Thompson and Bailey families, all of whom were early settlers in the St Albans area.

Located next to Upper Macdonald Road, the barn and milking shed are of aesthetic significance for contributing to the historical character of the St Albans district. The buildings are of some technical significance for their use of traditional construction methods for early 20th century agricultural buildings including low pitched roofs, bolted lapped joints, use of traditional timber slabs and bush poles. They are representative examples of the typical form of agricultural outbuilding found throughout the Hawkesbury City local government area.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn and milking shed at No. 239 Upper Macdonald Road, St Albans are
HISTORICAL	of historical significance as early 20 th century timber framed agricultural
	buildings.
	Meets the criterion on a Local level.
CRITERIA B)	Located on land associated with members of the Fernance, Thompson and
HISTORICAL	Bailey families, all of whom were early settlers of the St. Alban's area, the
ASSOCIATION	barn and milking shed appear to have been constructed by Charles 'Jack'
	Bailey, and the property is still known as Jack's Dairy today.
	Meets the criterion on a Local level.
CRITERIA C)	Located next to Upper Macdonald Road, the barn and milking shed are of
AESTHETIC/TECHNICAL	aesthetic significance for contributing to the historical character of the St
	Albans district.
	The buildings are of some technical significance for their use of traditional
	construction methods for early 20 th century agricultural buildings including
	low pitched roofs, bolted lapped joints, use of traditional timber slabs and
	bush poles.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns and outbuildings of the Hawkesbury district are appreciated
SOCIAL/CULTURAL	by the local community and others, being symbolic of the history of the
	agricultural development of the region, as evidenced by the numerous
	exhibitions, artworks, historical tours, heritage studies and heritage listings
	associated with these building types.
	Meets the criterion on a Local level.

CRITERIA E) RESEARCH POTENTIAL	Being constructed in the early 20 th century, the barn and milking shed have minor potential to provide further information into farming practices and construction methods of this period. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn and milking shed at No. 239 Upper Macdonald Road, St Albans are not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion.
CRITERIA G) REPRESENTATIVE	The barn and milking shed at No. 239 Upper Macdonald Road, St Albans are representative of the long history of agricultural development within the floodplains of the MacDonald River, which commenced in the early 19 th century and continues today. The buildings are representative examples of typical timber framed agricultural outbuildings found throughout the Hawkesbury City local government area. <i>Meets the criterion on a Local level</i> .
INTEGRITY/INTACTNESS	Moderate

IMAGES



Caption: Milking Shed at No. 239 Upper Macdonald Road, St Albans (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: June 2023



Issue: March 2025

Caption: Milking Shed at No. 239 Upper Macdonald Road, St Albans (interior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton


Johnson & Partners Date: June 2023



Caption: Detail of Milking Shed at No. 239 Upper Macdonald Road, St Albans (exterior)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: June 2023

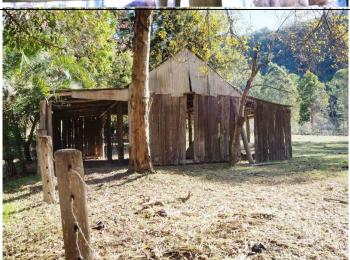

Issue: March 2025


Caption: Barn at No. 239 Upper Macdonald Road, St Albans

(exterior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton


Johnson & Partners Date: June 2023

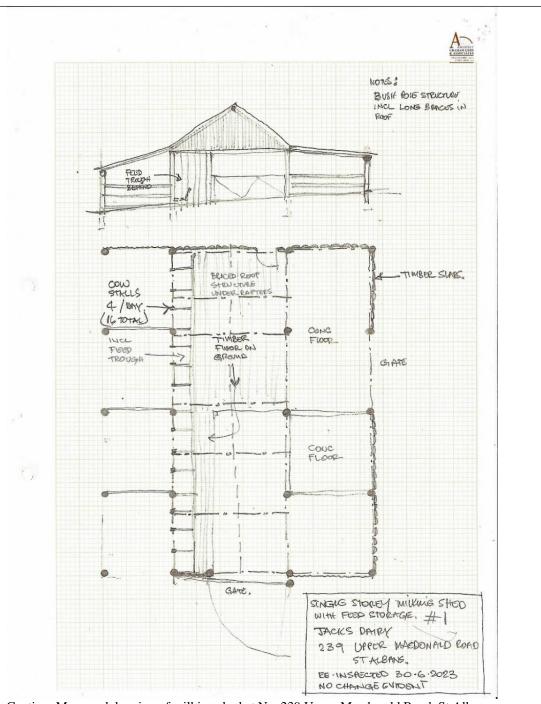

Caption: Measured drawing of milking shed at No. 239 Upper Macdonald Road, St Albans

Copyright Owner: Graham Edds & Associates

Date: June 2023

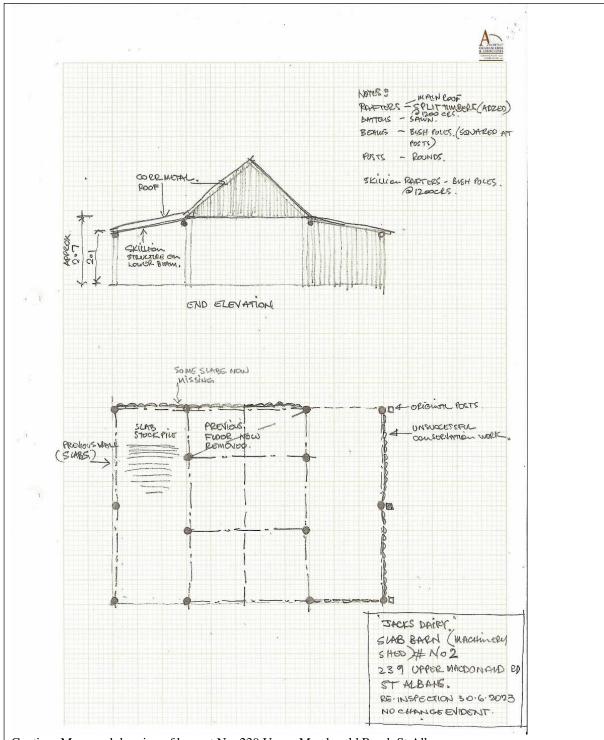

Caption: Measured drawing of barn at No. 239 Upper Macdonald Road, St Albans

Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS	
NAME	Single storey slab barn with side skillions
OTHER/FORMER NAMES	Pear Tree Cottage
ADDRESS	
	476 Upper Macdonald Road, St Albans
LOCAL GOVT AREA	Hawkesbury
PARISH	Macdonald App 1001052
LOT/DP	Lot 3 DP 1001852
SHI No.	1743116
EXISTING HERITAGE	No
ITEM? RECOMMENDED MANAGE	PMENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Not recommended for Local listing
ITEM CLASSIFICATION	Not recommended for Local listing
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	Daiii
CIRCA	Υ
PERIOD	Late 19 th century
CURRENT USE	Storage
FORMER USE	Barn
LOCATION ON SITE:	Next to a house approximately 50m west of the road.
MAIN BARN STRUCTURE	Barn is severely dilapidated, roof has partially collapsed and several bays have been removed. Round poles support adzed rectangular longitudinal beams and round cross beams. Condition: Poor Date: late 19 th century
NO. OF BAYS	Originally four, now only two left
ROOF STRUCTURE	Round pole rafters at approx. 30° support square ridge board set at 45°. Gable ends were framed for weatherboard cladding. Condition: Poor – partially collapsed Date: late 19 th century
LOFT	N/A
SKILLIONS	Skillion roofs have sawn rectangular rafters. North-western skillion was added to house milking bails, the south-eastern skillion was added in late 20th century. Condition: Moderate but partially removed. Date: late 19th century to late 20th century
ROOF CLADDING:	Corrugated iron Condition: Poor Date: late 19 th century?
WALL CLADDING	Remains of vertical timber slabs. Condition: not known Date: late 19 th century
CURRENT USE	Storage
CHANGES FROM 2010?	Partial collapse and removal of bays – probably flood damage
HISTORY	

The barn at No. 476 Upper Macdonald Road, St Albans is located on part of a 40 acre grant (Portion 36, Parish MacDonald) in the Township of Benton made to James Goddard on 30 June 1823.

Issue: March 2025

He later transferred his grant to Anthony Best. By a deed of Lease and Release dated 2 & 3 September 1834, Anthony Best sold the grant to Roger Sheehy for £140.

A road survey of 22 February 1865 by Licensed Surveyor George Matcham Pitt junior showed this land was in the hands of Mrs Delander. A revised road survey of 22 October 1892 by Licensed Surveyor Charles Robert Scrivener, showed the grant held by Mrs Delander, with a racecourse marked across the site.

Johanna Delander was the daughter of Roger Sheehy, who first married Richard Jurd and later John James Delander. In 1855, Richard Jurd purchased the Settler's Arms Inn, St Albans and his descendants held the licence for the following 80 years. For a period of time in the 1860s and 1870s, the hotel was known as Delander's Inn.

REFERENCES	Grants, Vol 17 No 77
	Old System Deed, No 342 Bk G
	R.478.1603, Crown plan
	R.478a.1603, Crown plan

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 476 Upper Macdonald Road, St. Albans is of historical significance as a partially surviving, late 19th century timber framed barn that is associated with members of the Sheehy, Jurd and Delander families, who owned the property throughout the 19th century. The Jurd and Delander families held the licence for the Settler's Arms Inn, St Albans during this same period.

Located next to Upper Macdonald Road, the barn is of aesthetic significance for contributing to the historical character of the St Albans district and has some technical significance for retaining evidence of its late 19th century construction, although its dilapidated state and lack of intactness somewhat diminishes its significance. The barn is a representative example of the typical form of agricultural outbuilding found throughout the Hawkesbury City local government area.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A) HISTORICAL	The barn at No. 476 Upper Macdonald Road, St Albans is of some historical significance as a surviving, late 19 th century timber framed barn, although as it is substantially dilapidated and no longer intact, its significance is somewhat diminished. Does not meet the criterion.
CRITERIA B) HISTORICAL ASSOCIATION	The barn appears to have historical associations with the Sheehy, Jurd and Delander families, early settlers in the St Albans area and who owned the property throughout the majority of the 19 th century, although no physical evidence of this association survives. The Jurd and Delander family were long term licence holders of the Settler's Arms Inn, St Albans, although not well known today. <i>Does not meet the criterion.</i>
CRITERIA C) AESTHETIC/TECHNICAL	Located next to Upper Macdonald Road and overlooking the floodplains of the MacDonald River, the barn is of aesthetic significance for contributing to the historical character of the St Albans district. The building is of some technical significance for retaining evidence of its late 19 th century construction including round poles supporting adzed rectangular longitudinal beams and round cross beams and the use timber slabs, although its dilapidated state somewhat diminishes its significance and better examples are located elsewhere in the district. Does not meet the criterion.
CRITERIA D) SOCIAL/CULTURAL	The historic barns and outbuildings of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	As the barn is substantially dilapidated, there is little potential for the building to provide further information that is not able to be gained elsewhere. Does not meet the criterion.
CRITERIA F) RARITY	The barn at No. 476 Upper Macdonald Road, St Albans is not considered to be rare within the context of the Hawkesbury City local government area. <i>Does not meet the criterion.</i>

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

CRITERIA G) REPRESENTATIVE	The barn at No. 476 Upper Macdonald Road, St Albans is representative of the long history of agricultural development within the floodplains of the
NET RESERVITITY E	MacDonald River and is a representative, though dilapidated, example of a typical timber framed agricultural outbuildings found throughout the
	Hawkesbury City local government area; however, numerous better
	examples are found elsewhere. Does not meet the criterion.
INTEGRITY/	Little
INTACTNESS	


IMAGES



Caption: Barn at No. 476 Upper Macdonald Road, St Albans (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson &

Partners

Date: June 2023

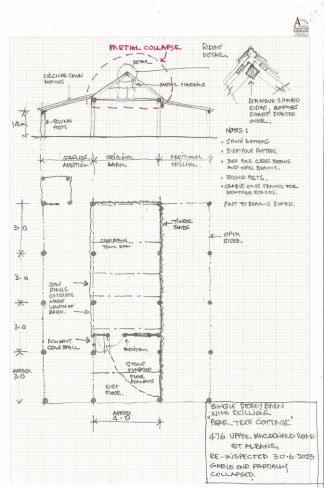

Issue: March 2025

Caption: Measured drawing of milking shed at No. 476 Upper Macdonald Road, St Albans

Copyright Owner: Graham Edds & Associates Date: June 2023

Complex of 6 slab bams	ITEM DETAILS	
ADDRESS 135A & B Wollombi Road, St. Albans		Complex of 6 slab barns
ADDRESS 135A & B Wollombi Road, St. Albans	5	
LOCAL GOVT AREA Hawkesbury PARISH St. Albans LOT/DP 135A - Lot 2 DP 707535/135B - Lot 4 DP 806902 SHI No. 1743117 EXISTING HERITAGE TITEM? RECOMMENDED MANAGEMENT MANAGEMENT SUMMARY Recommend for State listing- whole property worthy of listing as State heritage item. Retain as Local item Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. ITEM CLASSIFICATION ITEM TYPE Built TITEM GROUP Farming and Grazing ITEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th entury farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone bas for a carriage wheel blacksmithing are associated with the blacksmithing the occurred on the property. Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway, Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned a date range of a first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of mid to late 19th century. Barn 7 is of a different construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional and we have assi		
PARISH St. Albans		·
LOT/OP		
SHI No.		
EXISTING HERITAGE ITEM? RECOMMENDED MANAGEMENT MANAGEMENT MANAGEMENT SUMMARY Recommend for State listing- whole property worthy of listing as State heritage item. Retain as Local item Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. ITEM CLASSIFICATION ITEM TYPE Built ITEM GROUP Farming and Grazing ITEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing the occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a onif-traditional barn form and insubstantial construction hence the later date of late 19th ocentury. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th ocentury. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of		
RECOMMENDED MANAGEMENT		
RECOMMENDED MANAGEMENT Recommend for State listing- whole property worthy of listing as State heritage item. Retain as Local item Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended.		Y-1433 (SHI NO. 1/4311/)
Recommend for State listing- whole property worthy of listing as State heritage item.		 MENT
Retain as Local item Retain as Local item Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. TIEM CLASSIFICATION		
Retain as Local item Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. ITEM CLASSIFICATION ITEM TYPE Built ITEM GROUP Farming and Grazing ITEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE Barns LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing the occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barn 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later d		
Further research and investigation of the surviving assemblage of agricultural machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. TIEM CLASSIFICATION TIEM TYPE Built TIEM GROUP Farming and Grazing TIEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE Barns LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing the occurred on the property. Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date range of the sab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have	SOMME	
machinery, farming and blacksmithing artefacts and other historical archaeology is recommended. ITEM CLASSIFICATION ITEM TYPE Built ITEM GROUP Farming and Grazing ITEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE FORMER USE Barns LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barn 5 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date falte plate or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
TITEM CLASSIFICATION TITEM TYPE Built TITEM GROUP Farming and Grazing TITEM CATEGORY Barn DESCRIPTION PERIOD Early 19th to Early 20th century CURRENT USE FORMER USE Barns LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing aretafacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barn 5 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date range of mid to late 19th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of flate 19th or early 20th century but the materials might be earlier.		
TIEM CLASSIFICATION TIEM TYPE Built TIEM GROUP Farming and Grazing TIEM CATEGORY Barn		
TIEM GROUP Farming and Grazing	ITEM CLASSIFICATION	
DESCRIPTION Early 19th to Early 20th century	ITEM TYPE	
PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE Barns Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing the occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		Farming and Grazing
PERIOD Early 19th to Early 20th century CURRENT USE Storage FORMER USE Barns Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		Barn
CURRENT USE Barns Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
FORMER USE LOCATION ON SITE: Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing the occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date aflate 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		· · · · · · · · · · · · · · · · · · ·
Complex of timber slab farm buildings clustered around 1820s slab cottage and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 5 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		Storage
and 1830s house/ inn. There are other slab buildings on this extraordinary site that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		Barns
that are not described below as they are not barns e.g. original cottage, kitchen, small outbuilding. OTHER: Along with the full complement of buildings and associated landscape features and plantings associated with a 19 th century farming complex, there i also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.	LOCATION ON SITE:	
Nother: Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there is also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
Along with the full complement of buildings and associated landscape features and plantings associated with a 19th century farming complex, there is also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
features and plantings associated with a 19th century farming complex, there is also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
also a large assemblage of surviving agricultural machinery and farming and blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.	OTHER:	Along with the full complement of buildings and associated landscape
blacksmithing artefacts of varying ages. There also survives a sandstone base for a carriage wheel blacksmithing area associated with the blacksmithing that occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
for a carriage wheel blacksmithing area associated with the blacksmithing tha occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
occurred on the property. SUMMARY OF DATING Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19th century, so we have given it a later date range of mid to late 19th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19th or early 20th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19th or early 20th century but the materials might be earlier.		
Barns are numbered in accordance with Graham Edds & Associates 2010 record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
record of the site. Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.	SUMMARY OF DATING	1 1 V
Barns 4, 6 & 8 are of a similar size and positioning relative to the entrance driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
driveway. Based on its form and construction, Barn 4 appears to be the oldest outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
outbuilding and we have assigned this to the first period of occupation i.e. early 19 th century. Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		driveway. Based on its form and construction, Barn 4 appears to be the oldest
Barns 6 & 8 could be contemporary with Barn 4 or later, so we have assigned a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		outbuilding and we have assigned this to the first period of occupation i.e.
a date range of early to mid-19 th century. Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
Barn 7 is of a different construction to Barns 4, 6 & 8 but its raised earthen floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
floor and wall construction appear to belong to the 19 th century, so we have given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
given it a later date range of mid to late 19 th century. Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
Barn 5 is of a non-traditional barn form and insubstantial construction hence the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
the later date of late 19 th or early 20 th century. Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
Barn 9 is the largest of the slab buildings on this site and is robustly built using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
using traditional round posts and adzed or axed squared beams and slabs. The way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
way the posts and beams are put together is non-traditional, so we have assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
assigned a later date range of late 19 th or early 20 th century but the materials might be earlier.		
might be earlier.		
DESCRIPTION DADN 4 intermal agests limited due to condition and contents		might be earlier.
DESCRIFTION DAKIN 4 – Internal access limited due to condition and contents	DESCRIPTION BARN 4 – inte	ernal access limited due to condition and contents
MAIN BARN STRUCTURE Single storey barn with a loft in each end bay and full height in the middle	MAIN BARN STRUCTURE	
bay. In plan it measures 9.5 x 3.5m and 3.2m high at the eaves. Round posts		

	. 10 1. 11 1.1 (10.01 1.1 1.1
	extend from ground to eaves and have round pole beams at loft floor level and
	eaves level. The upper beam is fixed to the top of the posts, the floor beam is
	bolted to the outside face.
	Condition: Poor Date: Early 19 th century
NO. OF BAYS	Three
ROOF STRUCTURE	Slender bush pole rafters and battens. Some recent strengthening work (collar
	ties & wind bracing). Condition: Poor
	Date: Early 19 th century
LOFT	· · · · · · · · · · · · · · · · · · ·
LOFI	Severely decayed floor boarding is supported on pole joists spanning the
	width of the barn. Condition: Poor
	Date: Early 19 th century
ROOF CLADDING:	Corrugated iron
ROOF CLADDING.	Condition: Poor
	Date: Mid-20 th century?
WALL CLADDING	Vertical slabs, remains of weatherboards in gables and above slabs in central
WILL CLADDING	bay, horizontal bush poles with ventilation gaps to loft side walls.
	Condition: Poor
	Date: Early 19 th century
OPENINGS	Central bay open to east.
FLOORING (GROUND)	Earth
FLOORING (LOFT)	Boarding
OTHER (Fixings?)	Spikes and bolts.
CURRENT USE	Storage
CHANGES FROM 2010?	Further deterioration.
DESCRIPTION BARN 5	1 while deterioration
MAIN BARN STRUCTURE	A small shed approximately 4.6m square on plan with a side skillion. Squared
WITH BIRT STREETERE	posts at the front corners are halved at the top to support a round pole cross
	beam and round pole longitudinal beams.
	Condition: Moderate
	Date: Late 19 th or early 20 th century
NO. OF BAYS	Two
ROOF STRUCTURE	Light bush pole rafters with rudimentary trusses in each gable plus one cross
110 01 21110 01 011	beam all made of slender bush poles. Roof pitch approx. 30° with battens for
	corrugated iron roofing.
	Condition: Moderate
	Date: Late 19 th or early 20 th century
SKILLION 1	Ground level rises towards the western side skillion which consequently has a
	low headroom of about 1.2m inside. Skillion is of similar construction the
	main barn with remnant slab wall cladding.
	Condition: Poor
	Date: Late 19 th or early 20 th century
ROOF CLADDING:	Corrugated iron hot dip galvanized
	Condition: Moderate
	Date: Late-19 th century
WALL CLADDING	Vertical timber slabs on three sides with corrugated iron in western gable.
	Condition: Moderate
	Date: Late 19 th or early 20 th century
OPENINGS	Eastern end is open
FLOORING (GROUND)	Earth
FLOORING (SKILLION)	Earth
CURRENT USE	Machinery store
CHANGES FROM 2010?	Dilapidation
DESCRIPTION BARN 6	
MAIN BARN STRUCTURE	This barn is in line with Barn 4 and of a similar size on plan (8.4 x 3.4). It is
	supported on sturdy round posts with large round longitudinal beams flattened

	at summents. It has one areas been where there is an internal slab marrition
	at supports. It has one cross beam where there is an internal slab partition
	leaving the northern end as a milking/ feeding area with head stall. Condition: Poor
	Date: Early or mid-19 th century
NO. OF BAYS	Three bays on west side, four bays on east.
ROOF STRUCTURE	·
ROOF STRUCTURE	Bush pole rafters at approximately 30° pitch with battens suitable for
	corrugated iron. Condition: Poor
	Date: Early or mid-19 th century
ROOF CLADDING:	Corrugated iron hot dipped galvanised
ROOF CLADDING:	Condition: Poor
	Date:
WALL CLADDING	Vertical timber slabs shaped at top end and fixed to bottom plate 500mm
WALL CLADDING	above ground.
	Condition: Moderate
	Date: Early or mid-19 th century
OPENINGS	North end is open for milking/ feeding shed, central opening in southern
OUTHINGS	section.
FLOORING (GROUND)	None
CURRENT USE	Storage
CHANGES FROM 2010?	Dilapidation and flood damage
DESCRIPTION BARN 7	Diapidation and mood damage
MAIN BARN STRUCTURE	Squared timber posts resting on bottom plate which in turn is supported by
	timber stumps with sandstone infilling. Condition: Moderate
	Date: Mid – late 19 th century
NO. OF BAYS	Four
ROOF STRUCTURE	
ROOF STRUCTURE	Replaced with light sawn timber framing including eaves beam. Condition: Good
	Date: Late 20 th century
ROOF CLADDING:	· · · · · · · · · · · · · · · · · · ·
ROOF CLADDING:	Red Colorbond corrugated steel Condition: Good
	Date: Late 20 th century
WALL CLADDING	Vertical timber slabs and weatherboard gables
WALL CLADDING	Condition: Moderate
	Date: Mid – late 19 th century
OPENINGS	North end open and one window on east side.
FLOORING (GROUND)	Earthen
CURRENT USE	Machinery store
CHANGES FROM 2010?	None
DESCRIPTION BARN 8	None
MAIN BARN STRUCTURE	This have is af a similar size to Dame 4 % ((0 - 2 (m) but it different from
MAIN DAKN SIKUCIUKE	This barn is of a similar size to Barns 4 & 6 (9 x 3.6m) but it differs from
	those by having a suspended timber floor and skillion additions. The main
	round posts extend down into the ground as per usual but the vertical slabs
	finish at floor level and the floor is supported on sandstone piers. There are also round pole longitudinal and cross beams.
	Condition: Moderate
	Date: Early or mid-19 th century
NO. OF BAYS	Three
ROOF STRUCTURE	Bush pole rafters at a pitch of approx. 40°
ROOF SIRUCIURE	Condition: Moderate
	Date: Early or mid-19 th century
SKILLION 1	
SKILLION I	End skillion is supported on sawn rafters and is termite-damaged. Condition: Poor
	Date: Early or mid-19 th century
ROOF CLADDING:	Corrugated iron
ROUF CLADDING:	Condition: Moderate
	Date: Mid-19 th century
	Date. Mid-19" century

WALL CLADDING	Vertical timber slabs, weatherboard gables.
	Condition: Moderate
	Date: Early or mid-19 th century
OPENINGS	Central opening to north-eastern side.
FLOORING (GROUND)	Suspended timber boarding
FLOORING (SKILLION)	Suspended timber boarding
CHANGES FROM 2010?	Deterioration
DESCRIPTION BARN 9	
MAIN BARN STRUCTURE	Barn is 9.75 x 6.75 on plan and is supported on round posts around the
	perimeter and at the third spans. Longitudinal eaves beams are roughly
	squared and sit on top of posts.
	Condition:
	Date: Late 19 th or early 20 th century?
NO. OF BAYS	Three
ROOF STRUCTURE	Round pole rafters with cross tie beams over bay divisions. Roof framing
	partly replaced. Wind bracing added.
	Condition: Good
	Date: Rebuilt in late 20 th century partly using old materials
SKILLION 1	Light pole framing
	Condition: Poor
	Date: Late 19 th or early 20 th century
ROOF CLADDING:	Colorbond corrugated roofing
	Condition: Good
	Date: Late 20 th century
WALL CLADDING	Vertical timber slabs, weatherboard gables.
	Condition: Moderate
	Date: Late 19 th or early 20 th century
OPENINGS	Double doors at northern end.
FLOORING (GROUND)	Suspended timber flooring
FLOORING (SKILLION)	Earth
OTHER (Fixings?)	Bolted.
CURRENT USE	Workshop and store
CHANGES FROM 2010?	None
HISTORY	

Nos. 135A and B Wollombi Road together form a grant of 50 acres (Portion 50, Parish St Albans), in the Township of Howick, made to Aaron Walters on 30 June 1823. Walters was a seaman armourer aboard the convict ship Broxbornebury which arrived in the colony in July 1814. Walters jumped ship.

Walters married Susannah Laellemont/Lilbemont (who was a convict on the same ship) at Saint Phillips Church, Sydney on 23 January 1815. The children included Aaron, born 2 February 1826 and Moses born 2 August 1828.

In 1834 Walters was granted a licence to keep a public house known as "the Industrious Settler Inn". It was the earliest inn at St Albans, although it closed shortly after, and Walters never renewed the license. Both Walter Snr. and his son Aaron also worked as blacksmiths as well as farming the land.

In 1837 the Reverend Richard Taylor visited Mrs Walters and dined on tea and eggs and drew a picture of the Walters' house which is in New Zealand (current owners have a copy of the pencil sketch).

On 10 October 1854 Aaron Walters senior of Macdonald River, farmer signed his will leaving his property including this 50 acre grant to his son, Aaron Walters Jnr. Aaron Walters Snr. died on 2 July 1866.

The land was partitioned on 6 May 1899 between Aaron Walters Jnr. of West Wallsend, storekeeper, and Moses Walters, St Albans, of Macdonald River, farmer.

Both halves of the original 50 acre grant appear to have been held by the descendants of the Walters family well into the mid 20^{th} century.

Located directly opposite the property on Wollombi Road is the St Albans General Cemetery, where eleven members of the Walters family are buried in the Methodist section.

REFERENCES	Hawkesbury Pioneer Register, 1994 edition, p 199 Grants, Vol 17 No 75
	Old System Deed, No 151 Bk 644
	Primary Application 58316

The Industrious Settler Inn, St Albans NSW (Matt Kenny, Director HHA) https://www.hha.net.au/our-work

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barns at No. 135A & B Wollombi Road, St Albans are of historical significance as surviving early 19th century to early 20th century timber framed barns that form part of a rare, historic property comprising a complex of farm buildings, an 1830s house, 1820s slab cottage, landscape features, plantings, associated farmlands and an assemblage of agricultural machinery and farming artefacts, still located on their original 50 acre grant established in 1823 and owned by the family of the original grantee Aaron Walters until the mid 20th century. The property operated for a short period in the 1830s as the first inn to be established in the locality, known as the Industrious Settler.

Picturesquely sited in the floodplains of the Macdonald River, with the river wrapping around the grant lands and the 1830s house located on a knoll, the property, including the notable collection of slab outbuildings, slab cottage, timber fence lines and remnant orchards as well as the assemblage of machinery and artefacts relating to the long term use of the place, is of aesthetic significance and presents as an open air museum. Visible from Wollombi Road, the place makes a strong contribution to the historical character of the St Albans locality.

The earliest surviving slab barns at the property are rare and of technical significance for retaining evidence of their early and mid 19th century construction. Forming part of a group of slab agricultural outbuildings within an historic farm complex, the whole of the place has high research potential and is of technical significance for demonstrating the historical development of the property from the 1820s through to date and is rare for containing the highest known concentration of slab outbuildings, including the barns, within the Hawkesbury City local government area.

As a surviving farm complex containing a full complement of buildings, including the original slab cottage and later stone house/inn, as well as landscape features, plantings and a collection of agricultural machinery and farming and blacksmithing artefacts, that remains on its original grant lands, and owned by the same family for over 100 years, the former Industrious Settler's Inn property, No. 135A & B Wollombi Road, St Albans is rare within the state of NSW.

ASSESSED SIGNIFICANCE	State
TYPE	
CRITERIA A) HISTORICAL	The barns at No. 135 Wollombi Road, St Albans are of historical significance as surviving early 19 th to early 20 th century barns that form part of an historic property comprising a complex of farm buildings, an 1830s house, 1820s slab cottage, plantings, fencing, associated farmlands and an assemblage of agricultural machinery and farming artefacts, still located on their original 50 acre grant lands, established in 1823. The property operated for a short period in the 1830s as the first inn to be established in the locality, known as the Industrious Settler. Meets the criterion on a State level.
CRITERIA B) HISTORICAL ASSOCIATION	The barns have historical associations with Aaron Walters, free-settler, and his sons Aaron and Moses. The Walters family obtained the 50 acre grant in 1823, built the barns, house, slab cottage and other outbuildings, established the Industrious Settler Inn and ran the farm until the mid 20 th century. <i>Meets the criterion on a Local level.</i>
CRITERIA C) AESTHETIC/TECHNICAL	Picturesquely sited in the floodplains of the Macdonald River, with the river wrapping around the grant lands and the 1830s house located on a knoll, the property including the notable collection of slab outbuildings, slab cottage, timber fence lines and remnant orchards, is of aesthetic significance for its rural landscape setting. Visible from Wollombi Road and the St. Albans Cemetery opposite, the place makes a strong contribution to the historical character of the St Albans locality. The earliest surviving slab barns at the property are of technical significance for retaining evidence of their early and mid 19 th century construction. Forming part of a group of slab agricultural outbuildings within an historic farm complex, the whole of the place, including all buildings, landscape features, plantings and surviving artefacts, is of technical significance for demonstrating the historical development of the property from the 1820s through to date and presents as an open air museum. Meets the criterion on a State level.

CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural
SOCIAL/CULTURAL	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated with
	these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The forms of the barns, with skillions and lofts and retaining evidence of their
POTENTIAL	19 th century construction techniques, have the potential to provide further
	information into 19 th century farming methods. The whole of the property, including all buildings, landscape features and surviving artefacts, also has
	high potential to provide further information into the historical development
	of the place, the St Albans locality, early inns and 19 th century farming
	practices.
	Meets the criterion on a State level.
CRITERIA F) RARITY	The surviving early to mid 19 th century barns of the Industrious Settler
	complex are rare within the context of the Hawkesbury City local government
	area. The property is also rare for containing the highest known concentration
	of slab outbuildings, including the barns, within the Hawkesbury City local
	government area. As a surviving farm complex containing a full complement of buildings, including the original slab cottage and later stone house/inn,
	landscape features, plantings and an assemblage of agricultural machinery and
	farming and blacksmithing artefacts, located on its original grant lands,
	owned by the same family for over 100 years, the former Industrious Settler's
	Inn property, No. 135A & B Wollombi Road, St Albans is rare within the
	state of NSW.
	Meets the criterion on a State level.
CRITERIA G)	The barns at No. 135A & B Wollombi Road, St Albans are representative of
REPRESENTATIVE	the long history of agricultural development within the floodplains of the
	MacDonald River, which commenced in the early 19 th century and continues today.
	The basic form of the barns with gabled roof, skillions and lofts is
	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	High to Moderate to Little

IMAGES



Issue: March 2025

Caption: Barn 4 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd



Caption: Barn 4 at 135A & B Wollombi Road (interior underside of loft) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: June 2023



Caption: Barn 5 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: June 2023



Issue: March 2025

Caption: Barn 5 at 135A & B Wollombi Road (interior) Photographer: LSJ

Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd



Caption: Barn 6 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: June 2023



Caption: Barn 6 at 135A & B Wollombi Road (interior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd Date: June 2023



Issue: March 2025

Caption: Barn 7 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: Barn 8 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners


Pty Ltd Date: June 2023



Caption: Barn 9 at 135A & B Wollombi Road (exterior) Photographer: LSJ Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: June 2023

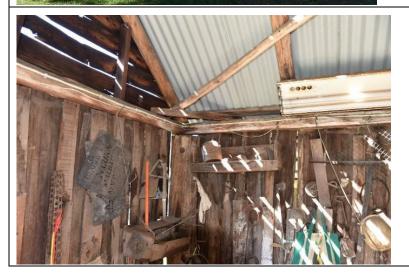


Issue: March 2025

Caption: Barn 9 at 135A & B Wollombi Road (interior joint) Photographer: LSJ

Copyright Owner: Lucas Stapleton Johnson & Partners


Pty Ltd

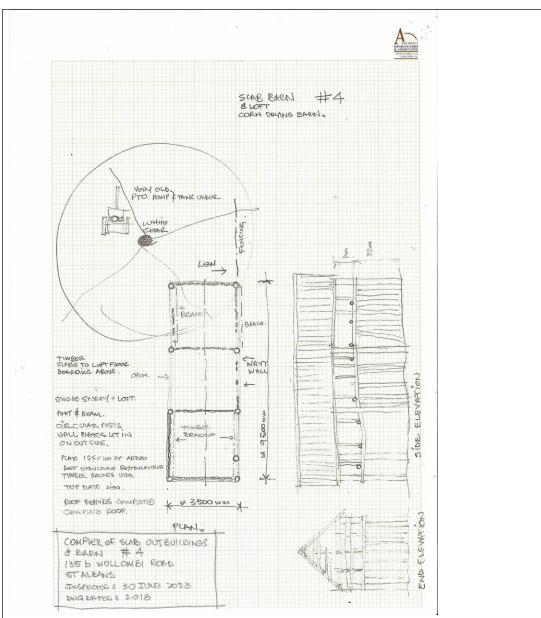

Caption: Measured drawing of Barn 4 at 135 A & B Wollombi Road, St Albans

Copyright Owner: Graham Edds & Associates


Date: June 2023

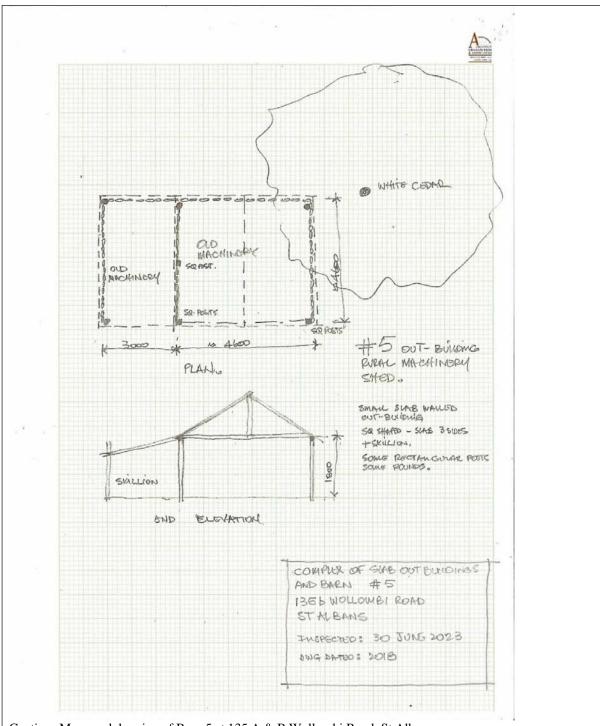

Caption: Measured drawing of Barn 5 at 135 A & B Wollombi Road, St Albans

Copyright Owner: Graham Edds & Associates


Date: June 2023

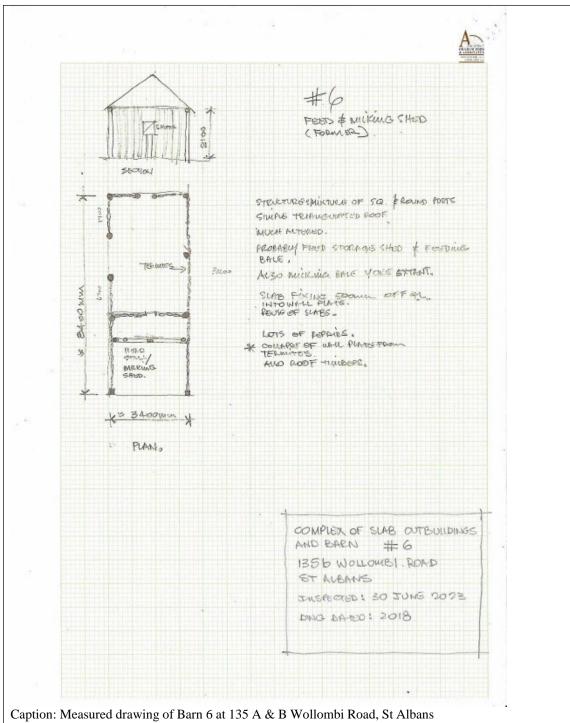

Copyright Owner: Graham Edds & Associates

Date: June 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

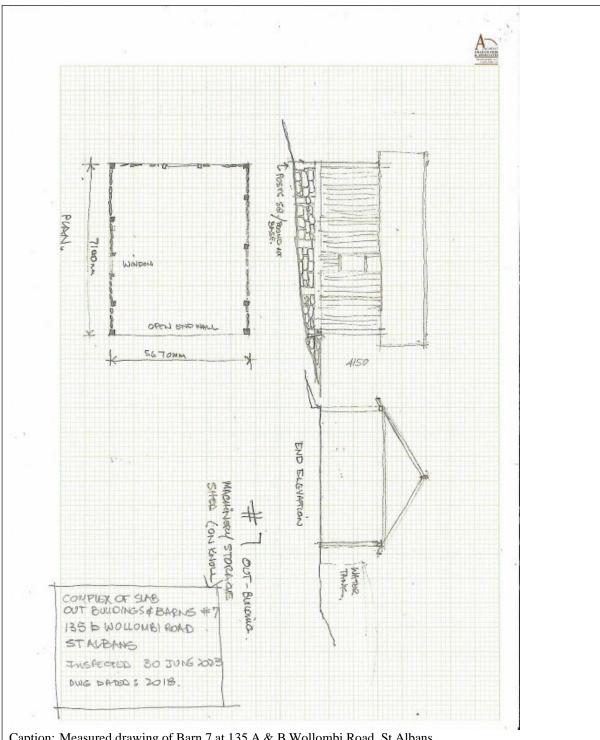


Caption: Measured drawing of Barn 7 at 135 A & B Wollombi Road, St Albans

Copyright Owner: Graham Edds & Associates

Date: June 2023


Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

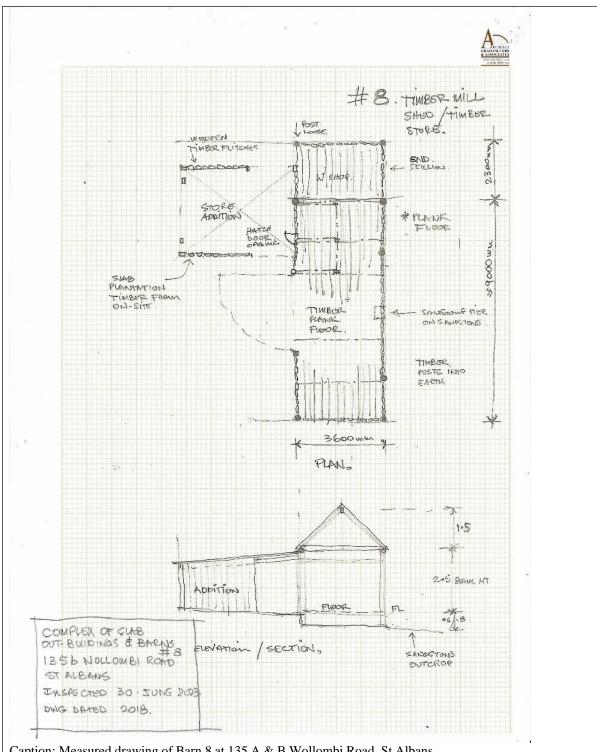

Caption: Measured drawing of Barn 8 at 135 A & B Wollombi Road, St Albans

Copyright Owner: Graham Edds & Associates

Issue: March 2025

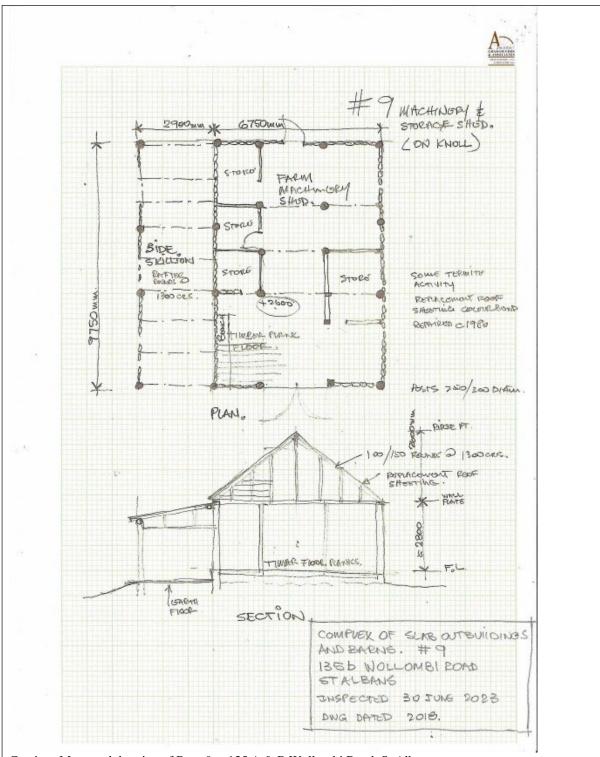

Caption: Measured drawing of Barn 9 at 135 A & B Wollombi Road, St Albans

Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS	
NAME	Slaughterhouse
OTHER/FORMER NAMES	Griffin Manor
ADDRESS	
	33 Griffins Road, Tennyson
LOCAL GOVT AREA	Hawkesbury
PARISH	Currency
LOT/DP	Lot 7 DP 249442
SHI No.	1743111
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGE	
MANAGEMENT	Not recommended for State listing.
SUMMARY	Recommended for Local listing. Site inspection required to clarify condition
	and integrity
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Slaughterhouse
DESCRIPTION	
CIRCA	Y
PERIOD	Late 19 th century
MODIFICATION/DATES	?
CURRENT USE	Vacant
FORMER USE	Slaughterhouse
LOCATION ON SITE:	This small timber slab building is near the middle of a large block
	approximately 220m east of the Tennyson Road. A small brick cottage is
	located nearby.
	The structure was not accessed but was photographed from the road.
	This description is based on the view from the road and the previous
	description by Graham Edds & Associates, 2010.
MAIN BARN STRUCTURE	This small slaughterhouse structure is 4.5 x 3m on plan and 3.6m to the eaves.
	Its length runs north-south. It is supported on round posts and bush pole
	beams and rafters.
	Condition: Poor
	Date: Late 19 th century
NO. OF BAYS	Two
ROOF STRUCTURE	Roof has a pitch of approximately 30°. The ridge board is supported by
	central posts at each end which also support an animal hanging rail.
	Condition: ?
	Date: Late 19 th century
LOFT	N/A
DOOF OF A DDING	Commented in a
ROOF CLADDING:	Corrugated iron
	Condition: Poor Date: ?
WALL CLADDING	Vertical slabs up to 2.4 and corrugated iron above (originally weatherboard).
	Condition: Not known
	Date: Late 19 th century
OPENINGS	There are two doorways opposite each other at the southern end framed by
	main posts.
FLOORING (GROUND)	Not known
CURRENT USE	Disused
CHANGES FROM 2010?	The roof has partially been blown off leaving the structure vulnerable to rapid
	deterioration.

HISTORY

The slaughterhouse at 33 Griffins Road, Tennyson is located on part of a grant of 100 acres (Portion 33, Parish Currency) in the District of Kurrajong made to Benjamin Cussley (var. Cusley) on 30 June 1823. Cussley arrived in New South Wales in 1788 as a Private in the Royal Marines. Cussley was also granted 200 acres in the Parish of Wilberforce, adjacent to Bushnell's Lagoon.

In 1878, the land was jointly held by Margaret Fleming and Ann Hall. On 4 November 1878, George Fleming of Macdonald River, farmer, and his wife, Margaret, and Ann Hall of Dartbrook, widow sold the 100 acres to John Thomas Gosper, Windsor, farmer for £90, who held the property for many years.

John Thomas Gosper Jnr (1832–1910) was the son of John Thomas Gosper, an early settler in the Upper Colo region. Gosper Jnr. was an Alderman of Windsor Municipal Council, committee member of the Hawkesbury District Agricultural society and director and part owner of the Hawkesbury Steam Navigation Company. He was also a well-known breeder of draught stock. Gosper held numerous parcels of land throughout the Hawkesbury, and it is assumed this property was tenanted.

On 10 August 1906, Gosper signed his will leaving the property to trustees. He died on 17 January 1910 and the land was auctioned, along with many other parcels owned by Gosper on 6 April 1910. The grant to Cussley was described as 'Substantially fenced and has valuable timber on it.'

The trustees of his estate, Alfred Gosper of Seven Hills, railway guard and John Jackson Paine of Windsor solicitor sold the 100 acres on 17 December 1910 to John James McMahon, of North Richmond, former brickmaker, now orchardist, for £220. McMahon conveyed 40 acres bounded on the east by the road from Richmond to Bull Ridge for £120 on 24 October 1914 to James Lavender, former bullock driver, now orchardist.

During the late 20th century, the 100 acre grant was subdivided into a series of smaller agricultural and residential allotments and the main house at No. 33 Griffins Road is a late 20th century dwelling. Based on the history of the property and what is known of the physical evidence, the slaughterhouse was potentially constructed during the Gosper period of ownership, although it is assumed that the land was leased or tenanted.

REFERENCES	Grants Vol 18 No 103
	Old System Deed, No 790 Bk 186
	Old System Deed, No 566 Bk 923
	Old System Deed, No 408 Bk 1044
	Windsor and Richmond Gazette, 2 April 1910, p 8
	Windsor & Richmond Gazette, 22 January 1910, p 4

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The slaughterhouse at No. 33 Griffins Road, Tennyson is of historical significance as a surviving late 19th century timber framed agricultural outbuilding located on land that was initially granted to mariner Benjamin Cussley in 1823 and appears to have been in continuous agricultural use since the early 19th century. The property also has historical associations with former land owner John Thomas Gosper Jnr, former Alderman of Windsor Municipal Council, who held the property from the 1870s through to the early 20th century. Although disused and in poor condition, the slab and corrugated iron clad slaughterhouse, sited in a paddock with small brick cottage adjacent, makes a strong contribution to the historical character of the agricultural lands throughout Tennyson. In its overall form and configuration, it is a representative example of an historic timber framed agricultural outbuilding found throughout the Hawkesbury City local government area. The building is potentially of technical significance for retaining evidence of its late 19th to early 20th century construction including round posts, bush pole beams and rafters and timber slabs, and has the potential to provide further information into 19th century farming methods.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The slaughterhouse at No. 33 Griffins Road, Tennyson is of historical
HISTORICAL	significance as evidence of the long-term agricultural use of the land since
	1823 when 100 acres was granted to mariner Benjamin Cussley. The
	property appears to have been in agricultural use since this time.
	Meets the criterion on a Local level.
CRITERIA B)	The land has historical associations with the original grantee Benjamin
HISTORICAL	Cussley and later owner John Thomas Gosper Jnr, former Alderman of
ASSOCIATION	Windsor Council and a notable figure in the Windsor area in the late 19 th and
	early 20 th century. Built in the late 19 th century, the slaughterhouse is

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

	T
	assumed to have been built by or is associated with J. T. Gosper.
	Meets the criterion on a Local level.
CRITERIA C)	The small timber framed, slab and corrugated iron slaughterhouse sited within
AESTHETIC/TECHNICAL	a paddock with adjacent brick cottage makes a strong contribution to the
	historical character of the agricultural lands throughout Tennyson.
	Although disused and in poor condition, the building is potentially of some
	technical significance for retaining evidence of its late 19 th century to early
	20 th century construction including round posts, bush pole beams and rafters
	and timber slabs.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns and agricultural outbuildings of the Hawkesbury district
SOCIAL/CULTURAL	are appreciated by the local community and others, being symbolic of the
	history of the agricultural development of the region, as evidenced by the
	numerous exhibitions, artworks, historical tours, heritage studies and heritage
	listings associated with these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The form and fabric of the slaughterhouse has the potential to provide further
POTENTIAL	information into late 19 th century farming and construction methods for
	agricultural buildings of the period.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The slaughterhouse at No. 33 Griffins Road, Tennyson, being a late 19 th or
·	early 20 th century agricultural outbuilding, is not considered to be rare within
	the context of the Hawkesbury City local government area.
	Does not meet the criterion.
CRITERIA G)	The barn at 191 Wilberforce Road, Wilberforce is representative of the long
REPRESENTATIVE	history of agricultural development within the floodplains of the Hawkesbury
	River, which commenced in the late 18 th century and continues today.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Unknown

IMAGES

Issue: March 2025



Caption: Barn at No. 33 Griffins Rd, Tennyson Photographer: G. Edds

Copyright Owner: Graham Edds

& Associates Date: June 2023


<u>Appendices</u> LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: Barn at No. 33 Griffins Rd, Tennyson Photographer: G. Edds

Copyright Owner: Graham Edds

& Associates Date: June 2023

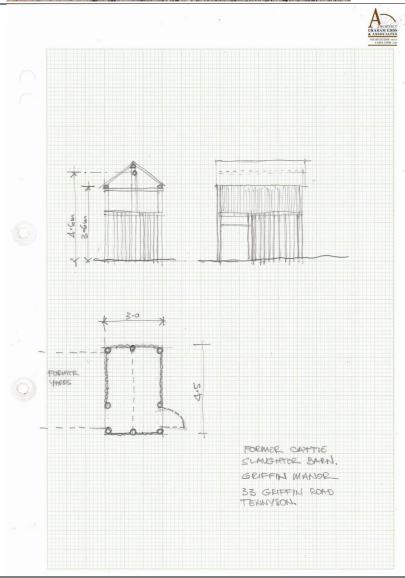

Issue: March 2025

Caption: Measured drawing of Barn at 33 Griffins Road, Tennyson

Copyright Owner: Graham Edds

& Associates Date: June 2023

ITEM DETAILS	ITEM DETAILS	
NAME	Single Storey Plank Barn with Skillions	
ADDRESS	753 Upper Colo Road, Central Colo	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Colo	
LOT/DP	Lot 3 DP 751632	
SHI No.	1743086	
EXISTING HERITAGE	N	
ITEM?		
RECOMMENDED MANAGE	CMENT	
MANAGEMENT	Not recommended for State listing.	
SUMMARY	Recommend for Local listing. Site inspection required into condition and	
	integrity.	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	Late 19 th century	
MODIFICATION/DATES	Roof frame (at least in part) and roof cladding replaced	
CURRENT USE	Car port and storage	
FORMER USE	Barn	
LOCATION ON SITE:	Approximately 50m south-west of the road behind the house.	

2023: The site was accessed but inspection of the barn was not allowed.

The following description is from the previous report by G Edds & Associates, 2009 with minor additions:

The property contains a single storey barn and former loft within a medium pitched gable roof and a skillion along each side. The primary barn is rectangular in shape (approx 13m x 5m) of four bays and its suspended floor is integral with the barn structure covering the entire primary barn footprint.

The former loft also covered the entire footprint, evidence by the close spacing of the loft floor joists @ approx. 900mm spacings and by the opening within the gable for a door.

The corner posts are hewn square from logs leaving the base as the circular posts to provide a shelf for the bearing of the floor beams.

The intermediate posts are generally smaller and of bush pole appearance.

The wall perimeter beam is hewn square (adzed) and fully housed into the corner posts and the side of the round intermediate posts scarfed and bolted.

The walls have been clad with hand hewn timber planks, possibly pit sawn then adzed.

The differing wall claddings are nailed to the top and bottom beams.

Issue: March 2025

Part of the primary barn walls are clad with spaced battens to provide drying for produce stored. Similarly the same parts of the barn floor are also clad with spaced flooring slats. The remainder of the barn is clad with timber planks up to approx.. 300/350mm wide x 40/45mm thick. Large areas of the walls are unclad and a large number of the existing have deteriorated.

The rafters are pit sawn to a rectangular shape and are nail fixed at the base to the perimeter horizontal planks above the loft floor joists and to a ridge timber.

The floor joists of the loft are nearly all bush poles and with only a couple being pit sawn.

The timber species used has a very cranky grain, possibly local ironbark or similar red coloured timber.

The side skillions are constructed of bush poles at spacings that differ each side and to the primary barn. These are clearly later additions. The outer line of posts support a beam which in turn supports the bush

pole rafters. The opposite end of the rafters bear onto the perimeter planks of the primary barn

The entire roof areas are clad with corrugated metal (recently reclad as of 2023).

It is thought that the structure has been extensively repaired/maintained and that the pit sawn joists are remnants of the original.

The owner advised that there is the archaeology of a pit saw further up the gully and has been told that the timbers for both the plank barn and cottage were hewn from the property.

HISTORY

The barn at 753 Upper Colo Road, is situated on a grant of 30 acres (Portion 3, Parish Colo, County of Cook) in the District of Kurrajong to Robert Evans of 30 June 1823.

By the late 1830s, the grant had come into the hands of the Ridge family, as along with numerous other adjacent parcels of land, the property was mortgaged on 20 February 1839 by James Bligh Ridge to John Betts and John Panton for £100. Subsequently, on 9 September 1847, James Bligh Ridge, of Colo, landholder, and his wife Sophia conveyed Evans's 30 acres to Richard Cox, of Colo, landholder for £100.

It remained in Cox's hands until 21 October 1874 when Richard Cox, of Pitt Town, farmer conveyed it to George Middleton of Kurrajong, Church of England clergyman, along with the adjoining grant of 60 acres (Portion 2, Parish Colo) originally made to Richard Cavanagh for £400.

Reverend George Middleton, then living at Emu (now Emu Plains), conveyed both grants to George Boyter, of Colo, farmer for £480 on 5 September 1879. Boyter held it until his death on 15 June 1913 intestate. The Supreme Court ordered that his property be sold by public auction. It was auctioned by J B Johnston and Co at the Royal Hotel, Windsor and described in The Daily Telegraph as being a "highly improved property, consisting of 190 acres, and has frontage to the Colo River". Boyter also owned the adjoining land (Portions 50 and 63, Parish Colo).

His widow Maria Boyter of Upper Colo and son George Henry Boyter of Upper Colo, farmer conveyed all four grants to Thomas Bentley Jones, of Upper Colo, farmer on 1 October 1913 for £700. The allotment boundaries of these four grants remain in place today.

Based on the history of the property and available information regarding the physical evidence, it appears the barn relates to the Boyter period of ownership.

REFERENCES	Grants, Vol 15 No 54
	Old System Deed, No 412 Bk O
	Old System Deed, No 407 Bk 13
	Old System Deed, No 43 Bk 149
	Old System Deed, No 44 Bk 149
	Old System Deed, No 141 Bk 196
	Old System Deed, No 543 Bk 1014
	Windsor and Richmond Gazette 23 Aug 1913 p 12
	The Daily Telegraph, Saturday 30 th August 1913, p. 17

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 753 Upper Colo Road, Central Colo is of historical significance as a surviving late 19th century timber framed barn located on land that was initially granted in 1823 to Robert Evans and has been in continuous agricultural since that time.

Although altered and partially rebuilt, the large barn with two side skillions sited on the high ground above the floodplains of the Colo River, continues to contribute to the historical character of the area. In its overall form and configuration (albeit altered), it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area and may have some technical significance for retaining evidence of its late 19th century construction.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 753 Upper Colo Road is of historical significance as
HISTORICAL	evidence of the long-term agricultural use of the land since the 1820s when
	30 acres was granted to Robert Evans. The property appears to have been
	in continuous agricultural use since that time.
	Meets the criterion on a Local level.
CRITERIA B)	The barn appears to be associated with George Boyter, of Colo, farmer and
HISTORICAL	his descendants who held the property from 1879 to 1913, although the


ASSOCIATION	family is not well known today.
	Does not meet the criterion.
CRITERIA C)	The timber framed barn with skillions, located on the high ground above the
AESTHETIC/TECHNICAL	Colo River floodplains, contributes to the historical character of the
	agricultural lands along Upper Colo Road.
	The barn potentially has some technical significance for its unusual
	construction methods.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The form of the barn, with side skillions, remnants of a loft and retaining
POTENTIAL	evidence of late 19 th century construction techniques, has the potential to
	provide further information into 19 th century farming and construction
	methods for agricultural buildings of the period.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at 753 Upper Colo Road is potentially rare due to its unusual
	construction including spared posts hewn from larger logs, pit sawn and
	adzed hand hewn timber plank wall cladding, and the bush pole
	construction of side skillions.
	Potentially meets the criterion on a Local level.
CRITERIA G)	The barn at 753 Upper Colo Road, Central Colo is representative of the
REPRESENTATIVE	long history of agricultural development within the floodplains of the Colo
	River, which commenced in the late 18 th century and continues today.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Unknown but appears to be moderate.

IMAGES

Issue: March 2025



Caption: Barn at No. 753 Upper Colo Road, Upper Colo (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

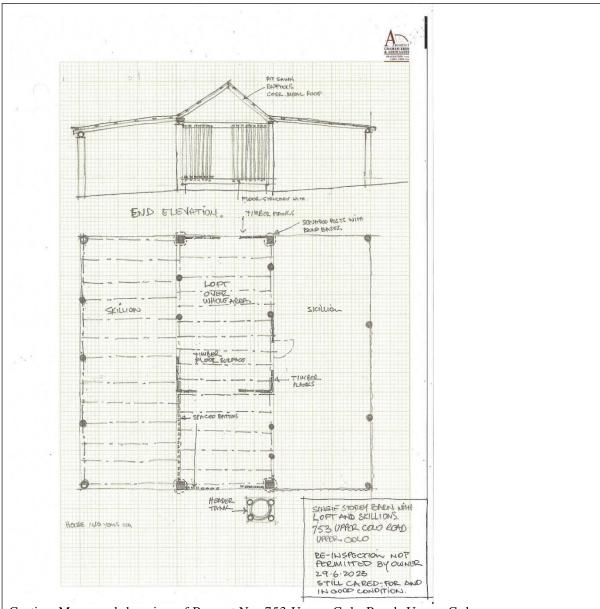

Caption: Measured drawing of Barn at No. 753 Upper Colo Road, Upper Colo.

Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS	
NAME	Two Storey Slab Barn with Side and End Skillions
ADDRESS	
	995 Upper Colo Road, Upper Colo
LOCAL GOVT AREA	Hawkesbury
PARISH	Colo
LOT/DP	Lot 1 DP 563874
SHI No.	1743087
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAC	
MANAGEMENT	Recommend for State listing
SUMMARY	Recommend for Local listing
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Late 19 th century
CURRENT USE	Disused
FORMER USE	Barn
LOCATION ON SITE:	Alongside the entrance driveway 110m from the road.
MAIN BARN	A tall two-storey barn measuring approximately 7 x 4m on plan and 5m high
STRUCTURE	to the eaves. It has skillions on the south-eastern side and south-western end,
	hipped at the corner. In addition to the usual round pole supports around the
	perimeter, it has central posts supporting the ridge board at each end and in
	mid-span. The first floor, skillions and roof are constructed of bush poles.
	Internally there are slab partitions presumably for stables.
	Condition: Poor – structure has a pronounced lean to the south-east due to
	recent flood.
	Date: late 19 th century
NO. OF BAYS	Four
ROOF STRUCTURE	Slender bush pole rafters with collar ties and sawn boards used as battens for
	iron. Roof pitch approximately 30°. There are round pole cross beams at each
	end and at mid-span.
	Condition: Moderate
LOPE	Date: late 19 th century
LOFT	Walls are clad with remains of horizontal plank boarding, now covered over
	with corrugated iron.
	Condition: Poor Date: late 19 th century
SKILLIONS	Light weight bush pole structures clad with vertical timber slabs. Side skillion
SKILLIONS	has cattle race built through it.
	Condition: Poor
	Date: late 19 th century
ROOF CLADDING:	Corrugated iron
noor ombbing.	Condition: Moderate
	Date: Mid-20 th century?
WALL CLADDING	Vertical timber slabs up to loft level, corrugated iron above.
	Condition: Moderate to poor
	Date: Mid-20 th century?
OPENINGS	Remains of doors to stables on driveway side of main barn.
FLOORING (GROUND)	Earthen
FLOORING (LOFT)	Timber boarding
FLOORING (SKILLION)	Earthen
OTHER (Fixings?)	Bolted connections
(*	

Appendices

CHANGES FROM 2010? Flood damage causing structure to lean. HISTORY

The barn at No. 995 Upper Colo Road, Upper Colo is located on part of a 40 acre conditional purchase on the Colo River selected by John Thomas Gosper of Colo River under the 13th section of the Crown Lands Alienation Act of 1861 on 11 February 1862. It was granted to him on 10 February 1866 and he held the land until his death.

John Thomas Gosper Jnr (1832-1910) was the son of John Thomas Gosper (after whom Gosper's Lagoon is named), an early settler in the Upper Colo region. Gosper Jnr. was an Alderman of Windsor Municipal Council, committee member of the Hawkesbury District Agricultural society and director and part owner of the Hawkesbury Steam Navigation Company. He was also a well-known breeder of draught stock. Gosper held numerous parcels of land throughout the Hawkesbury and it is assumed this property was tenanted.

This parcel of land was probably occupied by a member of his family or by tenants.

On 13 April 1910, the property passed by transmission to John Thomas Gosper's son Alfred Gosper of Seven Hills, railway guard and John Jackson Paine of Windsor solicitor. They transferred it on 18 October 1910 to Wilfred Arthur Gosper of Upper Colo, farmer, nephew of Alfred Gosper. The land was next transferred on 24 February 1919 to David George Simmons of Upper Colo, farmer.

REFERENCES	Certificate of title Vol 28 folio 21
	"Obituary", Windsor and Richmond Gazette, Saturday 22nd January 1910, p. 4
	Biography - John Thomas Gosper - People Australia (anu.edu.au)

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 995 Upper Colo Road, Upper Colo is of historical significance as a late 19th century timber framed agricultural building that survives on its original land grant made in 1866, that is associated with John Thomas Gosper Jnr. and his descendants. Gosper was a notable person in the Hawkesbury region, being an Alderman on Windsor Municipal Council and committee member of the Hawkesbury District Agricultural

Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and has aesthetic significance for contributing to the historical character of the Upper Colo district. Although in poor condition (structurally failing), it is relatively intact and of technical significance for

retaining evidence of its late 19th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole

rafters with collar ties and sawn boards used as battens for iron.

CRITERIA A) HISTORICAL CRITERIA B) HISTORICAL ASSOCIATION CRITERIA B) CRITERIA B) HISTORICAL ASSOCIATION CRITERIA C) AGRICAL ASSOCIATION CRITERIA C) AESTHETIC/ TECHNICAL CRITERIA C) AESTHETIC/ TECHNICAL The barn at No. 995 Upper Colo Road, Upper Colo is of historical significance as a late 19 th century timber framed agricultural building that survives relatively intact, on its original land grant made in 1866. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district.		vii boards used as batteris for from.
The barn at No. 995 Upper Colo Road, Upper Colo is of historical significance as a late 19th century timber framed agricultural building that survives relatively intact, on its original land grant made in 1866. Meets the criterion on a Local level. CRITERIA B) HISTORICAL ASSOCIATION Located on land originally granted to John Thomas Gosper Jnr. and held by the Gosper family from the mid 19th century through to the early 20th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	ASSESSED	State
ASSOCIATION as a late 19 th century timber framed agricultural building that survives relatively intact, on its original land grant made in 1866. Meets the criterion on a Local level. Located on land originally granted to John Thomas Gosper Jnr. and held by the Gosper family from the mid 19 th century through to the early 20 th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	SIGNIFICANCE TYPE	
relatively intact, on its original land grant made in 1866. Meets the criterion on a Local level. CRITERIA B) HISTORICAL ASSOCIATION Located on land originally granted to John Thomas Gosper Jnr. and held by the Gosper family from the mid 19 th century through to the early 20 th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	CRITERIA A)	The barn at No. 995 Upper Colo Road, Upper Colo is of historical significance
CRITERIA B) HISTORICAL ASSOCIATION Located on land originally granted to John Thomas Gosper Jnr. and held by the Gosper family from the mid 19 th century through to the early 20 th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	HISTORICAL	as a late 19 th century timber framed agricultural building that survives
CRITERIA B) HISTORICAL ASSOCIATION Located on land originally granted to John Thomas Gosper Jnr. and held by the Gosper family from the mid 19 th century through to the early 20 th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		relatively intact, on its original land grant made in 1866.
the Gosper family from the mid 19 th century through to the early 20 th century. John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		Meets the criterion on a Local level.
ASSOCIATION John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	CRITERIA B)	
successful farmer and horse breeder, large land holder, an Alderman on Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	HISTORICAL	the Gosper family from the mid 19 th century through to the early 20 th century.
Windsor Municipal Council and committee member of the Hawkesbury Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	ASSOCIATION	John Thomas Gosper Jnr. was a notable person in the Hawkesbury region, a
Agricultural Society. Meets the criterion on a Local level. CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		successful farmer and horse breeder, large land holder, an Alderman on
CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		Windsor Municipal Council and committee member of the Hawkesbury
CRITERIA C) AESTHETIC/ TECHNICAL Clearly visible from Upper Colo Road, the tall two storey barn is a visual landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		Agricultural Society.
AESTHETIC/ TECHNICAL landmark in the area and of aesthetic significance for contributing to the historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		Meets the criterion on a Local level.
historical character of the Upper Colo district. The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	CRITERIA C)	Clearly visible from Upper Colo Road, the tall two storey barn is a visual
The barn is of some technical significance for retaining evidence of its late 19 th century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	AESTHETIC/	landmark in the area and of aesthetic significance for contributing to the
century construction including first floor, skillions and roof constructed of bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn	TECHNICAL	historical character of the Upper Colo district.
bush poles with slab and plank cladding and internal slab partitions presumably for stables, slender bush pole rafters with collar ties and sawn		The barn is of some technical significance for retaining evidence of its late 19 th
presumably for stables, slender bush pole rafters with collar ties and sawn		century construction including first floor, skillions and roof constructed of
		bush poles with slab and plank cladding and internal slab partitions
boards used as battens for iron.		presumably for stables, slender bush pole rafters with collar ties and sawn
		boards used as battens for iron.
Meets the criterion on a State level.		Meets the criterion on a State level.
CRITERIA D) The historic barns and outbuildings of the Hawkesbury district are appreciated	CRITERIA D)	The historic barns and outbuildings of the Hawkesbury district are appreciated
SOCIAL/CULTURAL by the local community and others, being symbolic of the history of the	SOCIAL/CULTURAL	by the local community and others, being symbolic of the history of the

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

CRITERIA E) RESEARCH POTENTIAL	agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. Being constructed in the late 19 th century, the barn has some potential to provide further information into farming practices and construction methods of this period. Being of two storey construction makes this barn unusual. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 995 Upper Colo Road, Upper Colo, being a two storey barn, is considered to be rare within the context of the Hawkesbury City local government area. Meets the criterion on a State level.
CRITERIA G) REPRESENTATIVE	The barn at No. 995 Upper Colo Road, Upper Colo is representative of the long history of agricultural development within the floodplains of the Colo River, which commenced in the early 19 th century and continues today. The building is a notable, yet representative example of typical timber framed agricultural outbuildings found throughout the Hawkesbury City local government area. Meets the criterion on a Local level.
INTEGRITY/ INTACTNESS	Moderate

IMAGES



Caption: Barn at No. 995 Upper Colo Road, Upper Colo (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Date: June 2023



Issue: March 2025

Caption: Interior detail of barn at No. 995 Upper Colo Road, Upper Colo Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners


Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: Barn at No. 995 Upper Colo Road, Upper Colo (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson &

Partners

Date: June 2023

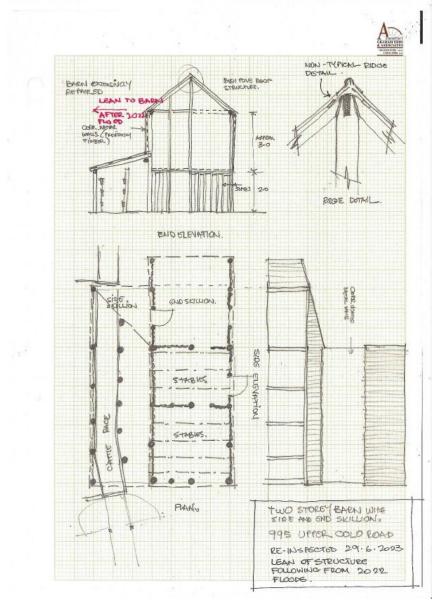

Issue: March 2025

Caption: Measured drawing of barn at No. 995 Upper Colo Road, Upper

Colo

Copyright Owner: Graham Edds & Associates Date: June 2023

ITEM DETAILS		
NAME	Single Storey Slab Barn with Loft and Skillion- Demolished	
OTHER/FORMER NAMES	-	
ADDRESS	1483 Upper Colo Road, Upper Colo	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Colo	
LOT/DP	Lot 142 DP826135	
SHI No.	1743088	
EXISTING HERITAGE ITEM?	N	
RECOMMENDED MANAGEMENT		
MANAGEMENT SUMMARY	Not recommended for State or local listing	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	19 th century	
MODIFICATION/DATES	?	
CURRENT USE	?	
FORMER USE	Barn	
INTEGRITY/INTACTNESS	Unknown. Possibly demolished.	

2023: Site access denied. Based on available views from Upper Colo Road, it appears the barn has been demolished or has substantially collapsed.

The following description is from the 2010 Hawkesbury Slab Barn Study, Graham Edds & Associates.

Description: A single storey slab barn with loft and lean-to at one side, located on higher ground on the side of a knoll overlooking the Colo River.

The barn was not inspected in detail as the owner refused permission owing to previous unsatisfactory experiences with those that studied Gospers Lagoon, also within his property. However the barn is valued by the property owner and it can be viewed from the road in association with a small timber slab Victorian Georgian style cottage located further up the knoll.

Structure: As viewed from the road and whilst leaving documentation of the slab barn study it was noted that the barn is rectangular in shape, of post and beam construction, in three bays and with one end bay elevated with a timber floor, the remainder on ground as a machinery shed. The roof is gabled and is simply supported. The barn has a sideways lean at the higher northern end.

HISTORY

Issue: March 2025

In June 1823, a 60 acre grant of land (Portion 14, Parish Colo, County Cook) was made to John Gosport (Gosper) in the district of Kurrajong, bounded on the north side by the 2nd branch and on the west side by Joseph Gosport's (Gosper) Farm. Joseph and John were brothers, and Gosper's Lagoon, named after the Gosper family is located to the south of the property.

REFERENCES Grant Register Serial 15 pg. 47

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

IMAGES

Issue: March 2025



Caption: No. 1483 Upper Colo Road, Upper Color. The barn is

not visible.

Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: June 2023

ITEM DETAILS		
NAME	Single Storey Elevated Slab Barn with Lofts	
OTHER/FORMER NAMES	Brawdy Farm	
ADDRESS	1665 Upper Colo Road, Upper Colo	
LOCAL GOVT AREA	Hawkesbury	
PARISH	Colo	
LOT/DP	Lot 1 DP 1050501	
SHI No.	1743089	
EXISTING HERITAGE	N	
ITEM?		
RECOMMENDED MANAGE	MENT	
MANAGEMENT	Site inspection required to clarify condition and integrity. Not able to	
SUMMARY	determine significance level without an inspection.	
	Not recommended for State or Local listing.	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	Late 19 th century	
MODIFICATION/DATES	?	
CURRENT USE	?	
FORMER USE	Barn	
INTEGRITY/INTACTNESS	Unknown- Significant termite damage in 2010	

2023: Site access not available. No inspection undertaken. Since 2010, location of the barn is obscured by regrowth forest and is no longer visible from the road. Aerial photographs suggest that the barn still survives.

The following description is from the 2010 Hawkesbury Slab Barn Study, Graham Edds & Associates.

Located on the side of the hillside out of reach of the Colo River flood waters the barn has a setting with white cedar trees, kurrajong trees, native vegetation on the rise and a grassed paddock in the foreground.

An unusually constructed barn with lofts, rectangular in shape approx 12.5m long x 6 metres wide with a gabled roof and a raised timber floor for 2/3rds of its length (western end), 1/3rd with loft above, and the remaining 1/3 of the barn area containing a second storey (eastern end). The upper floors are each structured differently and at differing heights.

Structure:

Issue: March 2025

Similar to other barns in the Hawkesbury, it is structured with posts set into the ground at approx 2.5metre spacings, but differs in that the ridge beam is supported by three posts placed centrally along the axis of the barn. The ridge timber is also interesting as it is hewn from one length of bush timber (approx120mm diam x 12.5 metres long) and two sides shaped with the broadaxe or adzed to a unified thickness of approx 60mm. The rafters are shaped to fit flush and nail fixed.

The barn is also structured with 5 bays, the perimeter posts supporting the perimeter rectangular adzed beams and these support the cross beams that form triangulation to the roof frame. The perimeter and cross beams are halved jointed and the perimeter beams unusually cantilever at the gable ends beyond the posts/wall frame. The roof is framed with rafters nail fixed to the perimeter beams and the timber ridge beam. The bush pole rafters and pit sawn/adzed battens are spaced for corrugated metal roof cladding.

The eastern two storey end is structured with a dividing wall and the first floor structure is integral with the barn post structure. The floor is clad with split timber slabs laid horizontally over the joist frame. The balustrade of the first floor is also clad with split slabs shaped at the ends for nail fixing. Access to the first floor level is unclear from the remaining evidence however the remnant timbers in the eastern gable end suggest that access could have been through an external door. The cladding of the gable was pit sawn small bush poles to provide open battening potentially for drying.

The opposite end (western end) has an independent raised floor structure to the main barn structure. The floor consists of a mix of split slabs and pit sawn thick flooring (orientated at opposite axis), the slabs supported on large diameter floor beams (250/300mm diam) @1200mm spacings housed over large diameter stumps (approx

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

450/500mm diam) @ 2.5 metre spacings; and the pit sawn floor supported additionally on round timber floor joists (approx 150 diam) @ 700mm spacings.

Approx half of this area (western extremity) has a loft structured of bush poles and beams and the total floor clad with thin bush poles (approx 80/100mm diam). The additional post structure for this loft continues to the top perimeter wall beam to provide support a timber rail.

The whole of the exterior is clad with split timber slabs either full height (approx 3.6 m) or in two lifts of approx 1.8 metres at the eastern end. The smaller height slabs are nail fixed at the ends to beams, but the full height slabs are fixed at approx 2/3rds height, the remainder unfixed and terminating to the underside of the perimeter beams. The base of the slabs are set into the ground in the traditional manner.

HISTORY

The barn at 1665 Upper Colo Road, Upper Colo is located on land that was granted on 30 June 1823 to Joseph Gosport [sic] as 60 acres in the County Northumberland District of Kurrajong and was described as bounded on the north by Cribb's farm and the second branch, on the west and south by mountains, and on the east by John Gosport's farm. It later became part of parish Colo, County Cook (Portion 16).

On 15 March 1880, Joseph Gosper, of Colo, farmer conveyed the entire 60 acres as described in the grant to his son Jonathan Gosper of Colo, farmer, subject to an annual rent charge of £20 per annum paid to Joseph Gosper. Jonathan Gosper mortgaged the land on 22 November 1880 for £100 and again on 7 April 1890 all the same sum. Title was re-conveyed to Jonathan Gosper on 24 November 1898. The Gosper family are notable in the Hawkesbury region, with extensive land holdings by various members of the family. Gosper's Lagoon is named for John Thomas Gosper, the brother of Joseph.

DET	TITLE .	TORIA	OTTO:
REF	I H.K	HIN	H.5

Issue: March 2025

Grants, Vol 15 No 46 Old System Deed, No 22 Bk 208 Old System Deed, No 608 Bk 216 Old System Deed, No 353 Bk 632

IMAGES



Caption: Slab barn at No. 1665 Upper Colo Road, Upper Colo. Photographer: C. Edds

Copyright Owner: Graham Edds &

Associates Date: 2010



Caption: Slab barn at No. 1665 Upper Colo Road, Upper Colo.

Photographer: C. Edds

Copyright Owner: Graham Edds &

Associates Date: 2010

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: Slab barn at No. 1665 Upper Colo Road, Upper Colo.

Photographer: C. Edds

Copyright Owner: Graham Edds &


Associates Date: 2010



Issue: March 2025

Caption: Slab barn at No. 1665 Upper Colo Road, Upper Colo. Photographer: C. Edds Copyright Owner: Graham Edds &

Associates Date: 2010

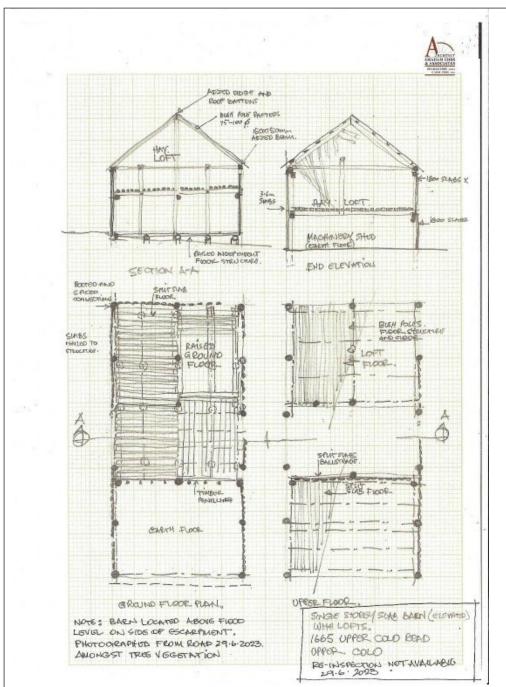

Caption: Measured drawing of Barn at 1665 Upper Colo Road, Upper Colo

Copyright Owner: Graham Edds & Associates

Date: June 2023

ITEM DETAILS	
NAME	Single Storey Slab Barn/Milking Shed with Skillion
ADDRESS	
	1764 Upper Macdonald Road, Upper Macdonald
LOCAL GOVT AREA PARISH	Hawkesbury Auburn
LOT/DP	Lot 37 DP 755206
SHI No.	SHI 1743114
EXISTING HERITAGE	N N
ITEM?	
RECOMMENDED MANAGE	EMENT
MANAGEMENT	Not recommended for State listing
SUMMARY	
	Recommend for Local listing.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn/Milking shed
DESCRIPTION CIRCA	Y
PERIOD	Late 19 th century
CURRENT USE	Storage in main barn, skillion disused.
FORMER USE	Barn and Milking shed
LOCATION ON SITE:	Close alongside the north side of the road overlooking the river.
MAIN BARN STRUCTURE	A long milking shed/ barn 15 x 4m on plan with a 3m wide dilapidated skillion along the northern side containing the milking bails. Round posts support round longitudinal beams which are flattened at joints. Posts are halved around the outside face of the beams, chamfered at the top and nailed. Round pole cross beams are halved over the longitudinal beams. Condition: Poor Date: Late 19 th century
NO. OF BAYS	Five
ROOF STRUCTURE	Alternate pairs of bush pole rafters are triangulated by round pole cross beams. Roof pitch is approximately 30°. Battens are suitable for iron roofing. Condition: Poor Date: Late 19 th century
SKILLION 1	Lightly framed structure to accommodate 19 milking bails.
	Condition: Poor - collapsed
	Date: Late 19 th century
ROOF CLADDING:	Corrugated iron. Condition: Poor Date: Late 19 th century?
WALL CLADDING	Vertical timber slabs Condition: Moderate Date: Late 19 th century
OPENINGS	One doorway only on southern side but eastern and northern sides are open.
FLOORING (GROUND)	Earthen but raised timber floor alongside trough assumed to remain.
FLOORING (SKILLION)	Earthen
OTHER (Fixings?)	Feed trough made of bush poles remains intact but contents stored in barn obscure the raised floor behind the trough. Machinery room enclosed with slabs on south side.
CHANGES FROM 2010?	Floor damage.

HISTORY

William Pearson Thompson, of Dauphigny, McDonald River was granted 60 acres (Portion 37, Parish Auburn) beginning at the south-east corner of Joseph Fernance's 60 acres to be known as Dauphigny on 8 February 1840. The land had been promised to Thompson before 26 November 1829 and he had been authorised to take possession on the 11 November 1830. The land was located directly to the south of his father's land, Matthew Pearson Thompson, ex-convict, after whom Thompson Creek is named.

On 23 March 1843, he signed a legal Release with the following parties, 1st James Martin, 2nd William Pearson Thompson, and wife, Elizabeth 3rd William Hopkins (purchaser) for the 60 acres as granted. A sum of £180 was paid by Thompson to Martin and £255 was paid by Hopkins to Thompson.

William Hopkins of Windsor, miller conveyed the grant to William Sternbeck of McDonald River, farmer and his brother George Sternbeck of McDonald River, farmer on 1 July 1851 for £300. The Sternbecks already held numerous portions of land along the Macdonald River.

William Sternbeck was born at Macdonald River, son of Christian William Sternbeck, ex-convict who had settled in the Windsor area by 1815.

A road survey of May 1865 showed a dwelling and barn on this grant. Another road survey of October 1892 showed the house, whilst a shed was shown on the site occupied by the barn in the 1865 survey. Both plans showed William Sternbeck as the current landowner. He died on 15 June 1906.

Members of the Sternbeck family continue to own the property today.

REFERENCES	Grants, Vol 59 No 203
	Old System Deed, No 767 Bk 3
	Old System Deed, No 159 Bk 21
	R.478.1603, Crown plan
	R.478a.1603, Crown plan

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn with skillion at No. 1764 Upper Macdonald Road, Higher Macdonald is of historical significance as a surviving late 19th century timber framed barn that has been in the ownership and use by members of the Sternbeck family, early settlers along the Macdonald River, since its original construction. The property is also of historical significance for its associations with the Thompson family, the first landowners, and after whom the nearby Thompson Creek is named.

Although in an isolated location, the long single storey barn with skillion, makes a strong contribution to the historical character of the agricultural lands along the Macdonald River floodplains. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

The long barn with side skillion containing 19 milking bails, remains of a bush pole feed trough, round posts supporting round longitudinal beams flattened at joints, round pole cross beams and bush pole rafters is of technical significance for demonstrating late 19th century construction methods for agricultural buildings. The building is considered rare within the context of the Hawkesbury City local government area for the surviving milking bails and feed trough and for its long and continuing association with the Sternbeck family.

ASSESSED SIGNIFICANCE	Local
TYPE	
CRITERIA A) HISTORICAL	The barn with milking shed at No. 1764 Upper Macdonald Road, Higher
	Macdonald is of historical significance as evidence of the long-term
	agricultural use of the land from at least the 1830s. Dating from the late 19 th
	century, the barn appears to be associated with William Sternbeck and the
	Sternbeck family who have owned the property since 1851 and members of
	the Sternbeck family continue to own and farm the land today.
	Meets the criterion on a Local level.
CRITERIA B) HISTORICAL	The barn and milking shed have historical associations with the Sternbeck
ASSOCIATION	family, early settlers of the Macdonald River locality, who have owned the
	property continuously since the 1850s, however the family is not well
	known today. The property is also associated with the Thompson family,
	after whom Thompson Creek nearby is named.
	Does not meet the criterion.

CRITERIA C) AESTHETIC/TECHNICAL	Although in an isolated location alongside the Macdonald River, the long barn with milking shed, forming part of a small farming complex, makes a strong contribution to the historical character of the agricultural lands within the Macdonald River floodplains. The building is of technical significance for demonstrating late 19 th century
	construction methods for agricultural buildings including round posts supporting round longitudinal beams flattened at joints, round pole cross beams and bush pole rafters, the 19 milking bails within the skillion, and the remains of a bush pole feed trough. Meets the criterion on a Local level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The form of the barn with loft and side skillion containing milking bails and bush pole feed trough, and retaining evidence of late 19 th century construction techniques, has the potential to provide further information into 19 th century farming methods. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at 1764 Upper Macdonald Road, Higher Macdonald is considered to be rare within the context of the Hawkesbury City local government area, for its skillion containing 19 milking bails and remains of a bush pole feed trough. The property is also considered to be rare for being in owned and used by members of the Sternbeck family continuously since the mid 19 th century. Meets the criterion on a Local level.
CRITERIA G) REPRESENTATIVE	The barn at 1764 Upper Macdonald Road, Higher Macdonald is representative of the long history of agricultural development within the floodplains of the Macdonald River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof, loft and skillion, is representative of the typical form of barn found throughout the district. <i>Meets the criterion on a Local level</i> .
INTEGRITY/INTACTNESS	Moderate/Poor condition

IMAGES

Issue: March 2025



Caption: Barn at 1764
Upper Macdonald Road,
Higher Macdonald
(exterior)
Photographer: S. Johnson
Copyright Owner: Lucas
Stapleton Johnson & Partners
Pty Ltd

Date: June 2023



Caption: Barn at 1764 Upper Macdonald Road, Higher Macdonald (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd Date: June 2023




Caption: Barn at 1764
Upper Macdonald Road,
Higher Macdonald
(interior)
Photographer: S. Johnson
Copyright Owner: Lucas
Stapleton Johnson & Partners
Pty Ltd
Date: June 2023



Issue: March 2025

Caption: Detail of post/beam junction in barn at 1764 Upper Macdonald Road, Higher Macdonald Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023

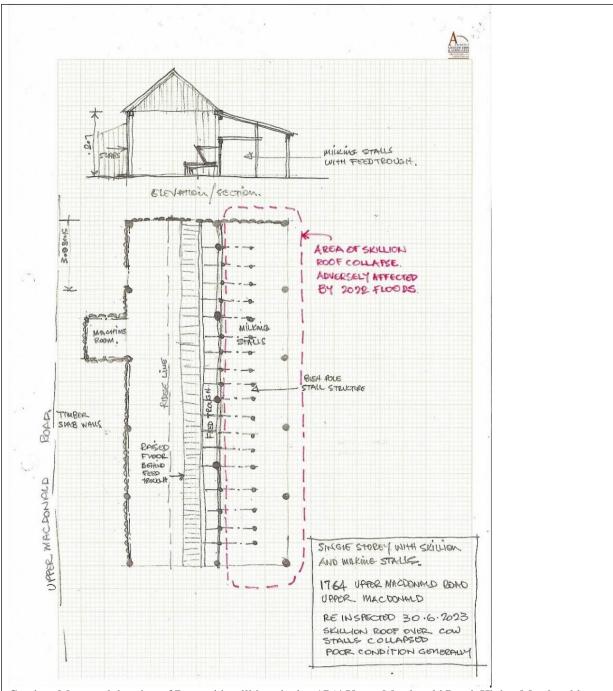

Caption: Measured drawing of Barn with milking shed at 1764 Upper Macdonald Road, Higher Macdonald Copyright Owner: Graham Edds & Associates

Date: June2023

ITEM DETAILS	
NAME	Slab Barn
ADDRESS	8 Burdekin Road, Wilberforce
	(Alternative address 228 Sackville Road)
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 2 DP 541505
SHI No.	Potential
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGE	·
MANAGEMENT	Not recommended for State listing.
SUMMARY	Recommend for Local listing -To be confirmed by site inspection to
	clarify construction and integrity
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
CURRENT USE	Unknown
FORMER USE	Barn
DESCRIPTION	
GENERAL	2023: The barn was not accessible. This description is based on viewing
	from the road and aerial photographs.
	A single storey barn approximately 6 x 4m on plan with skillions at the
	north-west end and north-east side and hipped at the corner. Another later
	skillion has been added to the south-east. The walls are clad in a mixture of
	flat and corrugated steel. The roof pitch is approximately 30° and is clad
	corrugated iron with battens suitable for iron. It has a marked sag in the roof
	and appears to be in poor condition.
HISTORY	

The barn at 8 Burdekin Road, Wilberforce is located on a grant of 4 acres 30 perches (Portion 302, Parish Wilberforce) purchased by Charlotte Fleming, widow of Wilberforce for £6/5/8 dated 16 February 1897. It was transferred to Reuben Greentree, farmer of Wilberforce on 6 June 1900, who then transferred it to Sarah Matilda Daley, widow of Wilberforce on 14 June 1900.

Sarah Matilda Daley died on 12 July 1930. Born as Sarah Matilda Turnbull, she married Patrick Daley in 1871. After moving around the colony to various locations, they returned to Wilberforce, where her husband set up a butchering business, which continued for many years. When her husband died in 1898, she took over the business which then passed to her sons about 1903. The land was transferred by her devisees to Arthur Patrick Daley, gentlemen of Wilberforce on 10 December 1930, at which time the butchering business ceased. The property remained in the hands of the Daley Family until the late 1960s.

Based on the history of the property, it appears the barn was constructed by the Daley family in the late 19/early 20th century in association with their butchering business.

REFERENCES	Certificate of Title Vol 1215 f 247
	Windsor and Richmond Gazette, 18 July 1930, p 3
CONTRACTOR OF CLOSURE CANCE	

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 8 Burdekin Road, Wilberforce is of historical significance as a surviving early 20th century timber framed barn that provides evidence of the long and continuing history of agriculture in the Wilberforce district and is associated with the Daley family who operated a butchering business at the property from 1900 to c1930.

Located in a paddock, the corrugated metal clad, timber framed barn with side skillions, makes a strong contribution to the historical character of the agricultural lands in the Wilberforce locality and in its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

5	6
ASSESSED SIGNIFICANCE	Local- potential
TYPE	

CRITERIA A) HISTORICAL	The barn at No. 8 Burdekin Road, Wilberforce is of historical significance as a surviving early 20 th century barn that provides evidence of the long and continuing history of agriculture in the Wilberforce district. <i>Meets the criterion on a Local level</i> .
CRITERIA B) HISTORICAL ASSOCIATION	The barn has historical associations with Patrick and Sarah Daley and the Daley family who owned the land and operated their butchering business from the property for a period of at least 30 years, although they are not well known today. Does not meet the criterion.
CRITERIA C) AESTHETIC/TECHNICAL	Located in paddock, the corrugated metal clad timber framed barn with side skillions, makes a strong contribution to the historical character of the agricultural lands in the Wilberforce locality and is potentially of technical significance for demonstrating early 20 th century construction methods for agricultural buildings. Meets the criterion on a Local level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The form of the barn has the potential to provide further information into early 20 th century farming methods. Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 8 Burdekin Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. <i>Does not meet the criterion.</i>
CRITERIA G) REPRESENTATIVE	The barn at N o. 8 Burdekin Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Unknown

IMAGES

Issue: March 2025



Caption: Barn at 8 Burdekin Road, Wilberforce (exterior) Photographer: K. Denny Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: July 2023



Caption: Aerial view of barn at 8 Burdekin Road, Wilberforce (exterior)

Copyright Owner: Goggle Maps/Airbus CNES Date: November 2023

ITEM DETAILS	
NAME	Two storey slab barn with side skillions
ADDRESS	
	331 Grono Farm Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 2 DP 1087156
SHI No.	Potential
EXISTING HERITAGE	N
ITEM? RECOMMENDED MANAGI	EMENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local listing
SCHIMA	Site inspection required to confirm condition and integrity.
ITEM CLASSIFICATION	Site inspection required to commit contains and integrity.
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid-19 th century
MODIFICATION/DATES	Restored and modified 21st century
CURRENT USE	?
FORMER USE	Barn
LOCATION ON SITE:	To south of house and 50m east of the road. 2023: Access was denied.
	This description is based on viewing from the road and the previous
	inspection and photographs by G. Edds, undertaken in 2015.
MAIN BARN STRUCTURE	A small two-storey barn with side skillions, a two-storey addition to the
	northern end and a further skillion addition to the east. Original barn is
	approx. 7.6 x 4.5m on plan and 2.5m high at the eaves and is supported on
	squared posts. Longitudinal and cross beams floor are adzed square. Date: Mid-19 th century? (original barn)
NO. OF BAYS	Four to original barn.
ROOF STRUCTURE	Roof structure has an assortment of rafters with modern wind bracing, roof
	pitch of approx. 30°.
	Date: 20 th century replacement?
LOFT	Not inspected
CIZIL L LONG	Date: Mid-19 th century? (original barn)
SKILLIONS	Skillions are supported on round posts and Date: Late 19 th & early 20 th century?
ROOF CLADDING:	Corrugated steel in striped colour scheme.
ROOF CLADDING:	Date: Late 20 th century
WALL OF ADDING	
WALL CLADDING	Vertical slabs have been reused around part of the perimeter of the skillions.
	Short vertical slabs cladding to loft. Date: Mid-19 th century?
OPENINGS	Not known
FLOORING (GROUND)	Not known
FLOORING (LOFT)	Timber planks
FLOORING (SKILLION)	Not known
OTHER (Fixings?)	Internal stair was added
CURRENT USE	Not known
CONDITION	Unknown

CHANGES FROM 2010?	Garage door added to end of main barn.
DATING RATIONALE	Squared posts and beams and the small scale of original barn indicate an early date. 2015 description notes that the barn has undergone many alterations and additions.
HISTORY	

The barn at No. 331 Grono Farm Road, Wilberforce, stands on a grant of 52 acres, District of Mulgrave Place of 31 March 1802 to James Sherrard, to be known as Sherrard Farm bounded on the south east by Seaton Farm. James Sherrard, convict, had arrived on the *Active* in 1791 and died in 1822.

By a conveyance dated 30 September 1811 recorded on a later title schedule for this land, John Merritt transferred the land to David Brown. No copy of this transaction was registered.

John Merritt (also Marrott) was a convict who arrived as part of the First Fleet and he received a 50 acre grant of land at Prospect Hill in January 1794. By mid 1800 he shared land held by purchase with James Sherrard at Mulgrave Place. Two years later they held 110 acres which probably included Merritt's original 50 acres at Prospect Hill. By 1806 Marrott held 105 acres known as Sherrard's Farms at Caddi (Cattai). His partnership with Sherrard seems to have been dissolved by this time.

No deeds or other transactions have been located between the conveyance to David Brown and will of Thomas Burdekin.

On 24 April 1837, Thomas Burdekin, an extremely wealthy colonist, ironmonger and extensive landholder, signed his will vesting his property in trustees for members of his family including the 52 acres as described in the grant. Thomas Burdekin died on 18 August 1844. The property passed down through various trustees for the benefit of members of the family. The property came into the hands of Marshall Burdekin, who died on 10 November 1886. Marshall Burdekin was a Member of the Legislative Assembly for the Liverpool Plains and it is unlikely that he resided at Wilberforce, although he did take an interest in the area according to newspaper articles.

An auction of 60 acres of land about 1 mile east of the town of Wilberforce with the frontage to the Hawkesbury River, the property of Marshall Burdekin was advertised for 19 May 1900. It was then occupied by Mr Bragg who would permit inspection of the property. William Bragg and wife Margorie were late comers to the Hawkesbury region, relocating from Sydney in the 1850s.

By a conveyance dated 10 October 1900, Clement Cheese, solicitor of 9 The Strand, London, the surviving trustee of the will of Marshall Burdekin sold this grant to Mary Ann Bragg, Hominy Point, Wilberforce, farmer (daughter of William Bragg). It was described as 52 acres being John Sherrard's grant for £225. The property remained in the hands of the Bragg Family until the 1960s. A survey of the newspaper press showed that the Bragg family had lived in the Wilberforce area since their arrival in the Hawkesbury, but there is no definite information regarding their place of residence. It is unclear when they took up occupation of this land as tenants of the Burdekin family, but it is possible that they were responsible for erecting any buildings on the property.

REFERENCES	Grants, Vol 3, No 98 (1)
	Sydney Gazette, 1 June 1803, p 3
	Old System Deed, No 588 Bk 79
	Old System Deed, No 125 Bk 677
	Old System Deed, No 447 Bk 2581
	Deposited Deeds Receipt No 25522
	Hawkesbury Advocate 11 May 1900 p 6
	Baxter, Carol J, Musters and Lists, New South Wales and Norfolk Island
	1800-1802, ABGR, Sydney, 1988, AA355 & AA356
	Jan Barkley-Jack, Hawkesbury Settlement Revealed, pp 178, 182, 184, 344,
	440
	'Marrott, John (c. 1751–1812)', People Australia, National Centre of
	Biography, Australian National University
OF LETT CENTER OF GLOSTERIO	ANCE

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 331 Grono Farm Road, Wilberforce is of historical significance as a surviving mid 19th century timber framed barn that appears to be associated with the Bragg family who may have tenanted the property before purchasing it in 1900 and held the land until the 1960s. The Bragg/Burdekin family are not well known today.

The small two storey barn with skillions, although modified, makes a strong contribution to the historical character of the agricultural lands along Grono Farm Road. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

Having undergone numerous alterations and additions, little evidence survives of its mid 19th century construction date other than the use of squared posts and adzed square longitudinal and cross beams. Regardless, the barn is of some technical significance for demonstrating mid 19th century construction methods for agricultural buildings and has the potential to provide further information into 19th century farming methods.

ASSESSED SIGNIFICANCE TYPE CRITERIA A) HISTORICAL The barn at No. 331 Grono Farm Road, Wilberforce is of historical significance as evidence of the long-term agricultural use of the land from 1802 when first granted to James Sherrard, through to present day. Meets the criterion on a Local level. CRITERIA B) HISTORICAL ASSOCIATION The barn has historical associations with William Bragg and his daughter Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL CRITERIA D) CRITERIA F) RESEARCH POTENTIAL CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion on a Local level. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the logality. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	ramming methods.	
The barn at No. 331 Grono Farm Road, Wilberforce is of historical significance as evidence of the long-term agricultural use of the land from 1802 when first granted to James Sherrard, through to present day. Meets the criterion on a Local level. The barn has historical associations with William Bragg and his daughter MISTORICAL ASSOCIATION The barn has historical associations with William Bragg and his daughter mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL CRITERIA D) CRITERIA D) SOCIAL/CULTURAL CRITERIA D) CRITERIA F) RESEARCH POTENTIAL The finistoric barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof an		Local
### significance as evidence of the long-term agricultural use of the land from 1802 when first granted to James Sherrard, through to present day. ### Meets the criterion on a Local level. CRITERIA B The barn has historical associations with William Bragg and his daughter Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. ### Does not meet the criterion. CRITERIA C Located to the rear of a large modern residence with adjacent early 20th century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. ### Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. ### Meets the criterion on a Local level. **CRITERIA D The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. ##### Meets the criterion on a Local level. **CRITERIA E) RESEARCH The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. ##### Meets the criterion on a Local level. **CRITERIA E) RARITY** The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. **Does not meet the criterion.** The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodpl		
CRITERIA B) The barn has historical associations with William Bragg and his daughter Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL AESTHETIC/TECHNICAL CRITERIA D) CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA B) HISTORICAL ASSOCIATION The barn has historical associations with William Bragg and his daughter Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL CRITERIA C) AESTHETIC/TECHNICAL CRITERIA C) AESTHETIC/TECHNICAL CRITERIA D) CRITERIA D) CRITERIA D) CRITERIA D) CRITERIA D) CRITERIA D CRITERIA D CRITERIA D CRITERIA D CRITERIA D CRITERIA C) CRITERIA D CRITERIA D CRITERIA C The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA G REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The bars is criterion on a Local level. Meets the criterion on a Local level.	HISTORICAL	
The barn has historical associations with William Bragg and his daughter Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. **Does not meet the criterion.** **CRITERIA C**) **AESTHETIC/TECHNICAL** **CRITERIA D** **CR		1802 when first granted to James Sherrard, through to present day.
Mary Ann Bragg, farmers, who appear to have constructed the barn in the mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL Cocated to the rear of a large modern residence with adjacent early 20th century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		Meets the criterion on a Local level.
mid 19th century and held the land until the 1960s, although they are not well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL Century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL CRITERIA E) RESEARCH POTENTIAL CRITERIA E) RESEARCH POTENTIAL CRITERIA F) RARITY The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA G) CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	CRITERIA B)	The barn has historical associations with William Bragg and his daughter
well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL Located to the rear of a large modern residence with adjacent early 20th century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of barn found throughout the district. Meets the criterion on a Local level.	HISTORICAL	Mary Ann Bragg, farmers, who appear to have constructed the barn in the
well known today. Does not meet the criterion. CRITERIA C) AESTHETIC/TECHNICAL Located to the rear of a large modern residence with adjacent early 20th century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of barn found throughout the district. Meets the criterion on a Local level.	ASSOCIATION	mid 19th century and held the land until the 1960s, although they are not
CRITERIA C) AESTHETIC/TECHNICAL Located to the rear of a large modern residence with adjacent early 20th century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
century fibro house and weatherboard house, the barn painted in red with a striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	CRITERIA C)	
striped roof, is clearly visible from the road and makes a strong contribution to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
to the historical character of the locality. Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
Although modified, the barn is of some technical significance for retaining evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
evidence of its mid-19th century construction including squared posts and adzed square longitudinal and cross beams. Meets the criterion on a Local level. The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA D) SOCIAL/CULTURAL The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	CDITEDIA D)	
development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level. The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	SOCIAL/CULTURAL	
CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA E) RESEARCH POTENTIAL The form of the barn, although modified, with skillions and retaining some evidence of mid 19 th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19 th century farming methods. Meets the criterion on a Local level. CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
POTENTIAL evidence of mid 19th century construction techniques, the barn at 3331 Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	CDITEDIA E\ DECEADOII	
Grono Farm Road, Wilberforce has the potential to provide further information into 19th century farming methods. Meets the criterion on a Local level. The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
information into 19th century farming methods. Meets the criterion on a Local level. The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	POTENTIAL	
CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
CRITERIA F) RARITY The barn at 331 Grono Farm Road, Wilberforce is not considered to be rare within the context of the Hawkesbury City local government area. Does not meet the criterion. The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
within the context of the Hawkesbury City local government area. **Does not meet the criterion.** **CRITERIA G)** **REPRESENTATIVE** The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. **Meets the criterion on a Local level.**	CDIMEDIA E) DADIME	
CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	CRITERIA F) RARITY	
CRITERIA G) REPRESENTATIVE The barn at 331 Grono Farm Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
REPRESENTATIVE history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
continues today. The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.	REPRESENTATIVE	
The basic form of the barn with gabled roof and skillions is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
of the typical form of barn found throughout the district. Meets the criterion on a Local level.		
Meets the criterion on a Local level.		
TO THE CONTROL OF THE		Meets the criterion on a Local level.
INTEGRITY/INTACTNESS Unknown	INTEGRITY/INTACTNESS	Unknown

IMAGES




Caption: Barn at No. 331 Grono Farm

Road, Wilberforce Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson &

Partners

Date: July 2023

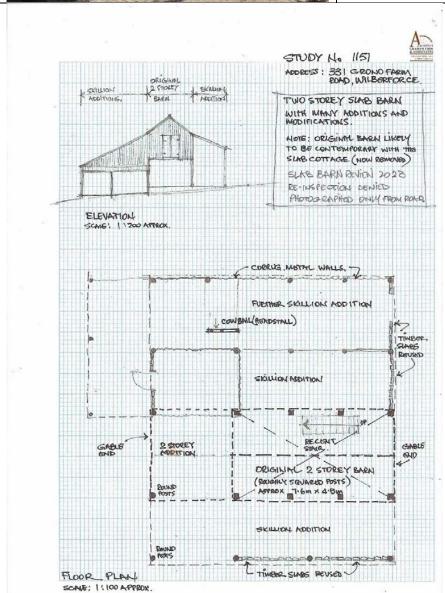

Caption: Measured drawing of Barn at 331 Grono Farm Road, Wilberforce

Copyright Owner: Graham Edds & Associates

Date: July 2023

ITEM DETAILS	
NAME	Single storey slab barn with silo
ADDRESS	86 King Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 471 DP 1111956
SHI No.	1743067
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGI	
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local listing-
	Site inspection is required to clarify age, construction methods and
	integrity.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn / Silo
DESCRIPTION	
CIRCA	Y
PERIOD	Late 19 th century (assumed)
CURRENT USE	Unknown
LOCATION ON SITE:	Located on the southern edge of the town of Wilberforce, the barn is set
	well back behind the house, approximately 70m south of the road and
	immediately behind a silo. NB Access was not available to inspect the barn.
	The following description is based on what can be seen from the road.
MAIN BARN STRUCTURE	A medium to small sized barn with a skillion on the eastern side which hips
NO. OF BAYS	around each end to become end skillions.
NO. OF BAYS	Not known
ROOF STRUCTURE	Roof pitch of approx. 30°. Vent in apex of gable.
LOFT	There is probably a loft but this was not confirmed. The loft level was clad
	in weatherboard but this has been covered with corrugated iron.
SKILLIONS	The northern skillion is twice the depth of the eastern and southern ones.
ROOF CLADDING:	Corrugated iron in short sheets.
WALL CLADDING	Vertical timber slabs can be seen on the western side of the barn but the rest
	is clad in corrugated iron. It is not known how much timber slab cladding
	remains.
OPENINGS	Not known
FORMER USE	Barn
HISTORY	

The barn and silo at 86 King Road, Wilberforce are located on part of a 70 acre grant (Portion 47, Parish Wilberforce) made to ex-convict John Howith (Howarth) in 1803. Howith had already been granted Portion 48, also 70 acres, located directly to the south fronting the Hawkesbury River in 1798.

By 1829, the land was owned by Samuel Terry who by deed of lease and release transferred the property to John Cobcroft.

Although subdivided and now amounting to about 6 acres, the property continues to be held by members of the Cobcroft family.

John Cobcroft was transported to NSW for life, arriving in 1790. Cobcroft received a conditional pardon in 1794 and the following year he received a 30 acre grant of land (Portion 56, parish Wilberforce) on the Hawkesbury River. Cobcroft received a further 40 acres adjoining his first grant and over the subsequent years he slowly amassed land throughout Wilberforce and was one of the Hawkesbury's most successful farmers. By 1828 he held 485 acres, cultivating 130 of them, including the land that now holds the

Australiana Pioneer Village where an early 19th century barn associated with the Cobcroft family still stands. Cobcroft married another ex-convict Sarah Smith and together they raised a family of 10 and established a dynasty of many thousands of descendants, some of whom continue to reside in the Wilberforce locality.

,
Primary Application 21148
Grant register Serial 3 No. 120
Old System Deed, Bk 2310 No. 259
Old System Deed, Bk C No. 221
Jan Barkley-Jack, Hawkesbury Settlement Revealed, p. 151-153

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 86 King Road, Wilberforce is of historical significance as a late 19th century timber framed barn (assumed) that is associated with the Cobcroft family who first obtained the land in 1829 and continue to own the property today. The historical associations with ex-convict John Frederick Cobcroft, one of the most successful farmers in the Hawkesbury in the early colonial era, and the continued ownership of the land by his descendants makes the place of historical significance and rare within the context of the Hawkesbury City local government area.

Located within a semi-rural agricultural setting behind an historic cottage on the street frontage, the barn and adjacent silo make a strong contribution to the historical character of the Wilberforce locality. In its overall form the barn is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

ASSESSED	Local
CRITERIA A) HISTORICAL	The barn at No. 86 King Road, Wilberforce is of historical significance as evidence of the long-term agricultural use of the land by the Cobcroft family, a notable family in the Wilberforce district and held by the Cobcrofts since 1829. Meets the criterion on a Local level.
CRITERIA B) HISTORICAL ASSOCIATION	The barn has historical associations with the John Frederick Cobcroft, who purchased the land in 1829 and was one of the most successful colonial farmers in the Hawkesbury region. His descendants still reside in the Wilberforce area including at the subject property. Meets the criterion on a Local level.
CRITERIA C) AESTHETIC/TECHNICAL	Still located in a semi-rural setting with historic cottage on the street frontage, the barn and associated silo are of aesthetic significance for contributing to the historical character of the Wilberforce locality. Meets the criterion on a Local level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The barn appears to date from the late 19 th century and may have the potential to provide further information into 19 th century farming methods. <i>Potentially meets the criterion on a Local level.</i>
CRITERIA F) RARITY	The barn at 86 King Road, Wilberforce is considered to be rare within the context of the Hawkesbury City local government area for being owned by the Cobcroft family from the 1820s to date. Meets the criterion on a Local level.
CRITERIA G) REPRESENTATIVE	The barn at 86 King Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the late 18th century and continues today. The basic form of the barn is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Unknown

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

IMAGES

Issue: March 2025



Caption: Barn and silo at 86 King Road, Wilberforce Road, Freemans

Reach (exterior)

Photographer: S. Johnson
Copyright Owner: Lucas Stapleton Johnson
& Partners Pty Ltd

Date: June 2023

ITEM DETAILS	
NAME	Single Storey Town Barn with End Skillion
ADDRESS	87 King Road, Wilberforce
LOCAL GOVT AREA PARISH	Hawkesbury Wilberforce
	Lot 4 DP 714768
LOT/DP SHI No.	1743066
EXISTING HERITAGE	N
ITEM? RECOMMENDED MANAGE	MENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local listing
SUMMAKI	Whole property including cottage is worthy of listing.
ITEM CLASSIFICATION	whole property including cottage is worthly of listing.
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid to late 19 th century
MODIFICATION/DATES	7
CURRENT USE	Storage and workshop
FORMER USE	Barn
LOCATION ON SITE:	The barn is located directly behind a slab cottage which in turn is behind
Eccition on site.	and attached to a weatherboard and brick cottage facing the street.
MAIN BARN STRUCTURE	A small town barn approximately 5 x 3.6m on plan with an end skillion
	facing the back of the slab cottage. It is set very low, the eaves are 2.1m
	high and the skillion even lower. The posts are left in the round and
	support round longitudinal beams and cross beams some of which are
	roughly squared or faceted.
	Condition: Moderate
NO. OF BAYS	Four
ROOF STRUCTURE	Bush pole rafters pitched at approximately 45°.
	Condition: Moderate
	Date: Mid-19 th century
LOFT	Cross beams are used to support storage in the roof space.
SKILLION 1	Slender bush poles and shingle battens.
	Condition: Moderate
DOOD CLAPPING	Date: Mid-19 th century
ROOF CLADDING:	Corrugated iron
	Condition: Moderate
	Date: Late 19 th century?
WALL CLADDING	Vertical timber slabs to walls and gables.
	Condition: Moderate
	Date: Mid-19 th century
OPENINGS	The south end is open to the skillion and there are windows on both sides,
	the eastern window opening (no glass) has a shutter on gudgeon hinges,
	the western windows have thick sills set into the sides of the posts.
FLOORING (GROUND)	Earth
FLOORING (SKILLION)	Earth
OTHER (Fixings?)	Iron spikes at post/ beam junctions.
CURRENT USE	Storage/ workshop

HISTORY

The barn at 87 King Road, Wilberforce is located on part of Portion 310 of the Wilberforce Town Plan.

Much of Wilberforce was occupied on the basis of a promise from Governor Lachlan Macquarie which seems to have been basis of occupation for many years. However, many lots were not officially granted until the 1890s.

Surveyor Felton Mathews' plan of Wilberforce from 1833 showed this land as vacant. The land was shown as held by Cobcroft on a survey plan of 1851, with the footprints of various buildings, though none in the location of the buildings currently on the allotment. The Cobcroft family first established themselves in the Wilberforce area in 1795 when John Cobcroft received a 30 acre grant of land to the south of No. 87 King Road. By the 1820s, he held 485 acres including the land that now holds the Australian Pioneer Village where an early 19th century barn associated with the Cobcroft family still stands. John Cobcroft was one of the Hawkesbury's most successful farmers and established a dynasty of many thousands of descendants, some of whom continue to reside in the Wilberforce locality.

A single dwelling at 87 King Road was shown on the 1894 plan prepared for auction sale.

The property was auctioned by the Crown at Windsor 20 January 1897 as Portion 310 with existing improvements valued at £103. The local press reported the sale of 'Homesteads at Wilberforce' that attracted a large crowd stating that, 'Most of the lots were bought in by existing occupiers at the upset price.' Portion 310 was bought by William Henry Buttsworth, farmer of Wilberforce, for £3. Being located on the southern edge of the town of Wilberforce, the allotment was 1 acre and 26 perches in area.

William Henry Buttsworth was the grandson of Henry Buttsworth, an early settler in the Kurrajong region and after whom Buttsworth Swamp is named. The Buttsworth family married into the Cobcroft, Rose and Turnbull families and owned various land in the Wilberforce locality, including the Buttsworth Mill at Wilberforce established by William's father Henry Buttsworth Jnr, and after whom Buttsworth Creek is named. The Buttsworth family's associations with the district continues today, with Alderman H.R. Buttsworth of Windsor Council in the 1920s and the business Buttsworth Engineering still trading in South Windsor.

After William's death in 1909, the land passed to his widow and other devisees. This land with buildings upon it was valued at only £60 after his death and was described as 'house and sheds Where Testator resided the same is in a very bad state of repair'.

Based on historic aerial photographs of the property in the mid to late 20^{th} century, a larger barn was located further to the north on the same allotment.

In c1985, Portion 310 was subdivided into four allotments and the adjacent lots were developed for residences.

Based on the physical evidence of the barn (and cottages) and the available historical documentary evidence, the barn was constructed either in the mid 19th century during the Cobcroft period or the late 19th century by William Buttsworth.

REFERENCES	W.829 Crown Plan
	W.1.840 Crown Plan
	W.1610.1507 Crown Plan
	New South Wales Government Gazette, 14 November 1896, p 8162
	Windsor & Richmond Gazette, 16 Jan 1897
	Certificate of Title Volume 1222 f 101
	Deceased estate file, W H Buttsworth, B156371, State Archives of New South
	Wales 20/6559

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 87 King Road, Wilberforce is of historical significance as a surviving mid to late 19th century timber framed barn that is potentially associated with the Cobcroft family who held the property in the mid 19th century or with William Henry Buttsworth who owned the property in the late 19th century. Both the Cobcrofts and Buttsworths are notable historical families who made substantial contributions to the development of the Wilberforce locality and whose descendants continue to reside in the Hawkesbury region.

As a town barn, the building would have been used in association with farm lands located outside of the town of Wilberforce, emphasising the continued importance of agriculture in the district well into the 20^{th} century. In its overall form and configuration, it is a representative example of an historic timber framed

barn type found throughout the Hawkesbury City local government area.

The single storey barn is of technical significance for retaining evidence of its mid to late 19th century construction date including posts left in the round supporting round beams and roughly squared or faceted cross beams, bush pole rafters and iron spikes at post/beam junctions. The barn continues to have the potential to provide further information into late 19th century farming methods, the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21st century.

the 21st century.	T
ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A) HISTORICAL	The barn at No. 87 King Road, Wilberforce is of historical significance as a surviving mid to late 19 th century town barn associated with a mid to late
	19 th century weatherboard and slab cottage, that provides evidence of the long-term agricultural use of the land from the early 19 th century through to the late 20 th century.
	As a town barn, the building would have been used in association with farmlands located outside of the town of Windsor, emphasising the
	continued importance of agriculture in the district well into the 20 th century. <i>Meets the criterion on a Local level.</i>
CRITERIA B)	The town barn at No. 87 King Road, Wilberforce is potentially associated
HISTORICAL ASSOCIATION	with the Cobcroft family who held the property in the mid 19 th century or with William Henry Buttsworth who owned the property in the late 19 th
	century. Both the Cobcrofts and Buttsworths are notable historical
	families who made substantial contributions to the development of the
	Wilberforce locality and whose descendants continue to reside in the
	Hawkesbury region. Meets the criterion on a Local level.
CDITEDIA C	Located at the rear of the property the barn is not visible from the street,
CRITERIA C) AESTHETIC/TECHNICAL	although the whole of the property together with the mid to late 19 th
AESTHETIC/TECHNICAL	century weatherboard cottage and slab cottage, makes a strong
	contribution to the historical character of King Road,
	The single storey barn is of technical significance for retaining evidence of
	its mid to late 19 th century construction date including posts left in the
	round supporting round beams and roughly squared or faceted cross
	beams, bush pol rafters and iron spikes at post/beam junctions. Meets the criterion on a Local level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The barn No. 87 King Road, Wilberforce, has the potential to provide further information into mid to late 19 th century farming methods and the relationship between the town barn and other agricultural lands, as well as
	the continuity of use of historic agricultural buildings into the 21 st century. <i>Meets the criterion on a Local level.</i>
CRITERIA F) RARITY	The barn at No. 87 King Road, Wilberforce is potentially rare within the
	context of the Hawkesbury City local government area, as a surviving mid
	to late 19 th century town barn that remains relatively intact. <i>Meets the criterion on a Local level.</i>
CRITERIA G)	The barn at No. 87 King Road, Wilberforce is representative of the long
REPRESENTATIVE	history of agricultural development within the Hawkesbury area, which
	commenced in the late 18 th century and continues today.
	The basic form of the barn with gabled roof, skillion and vertical timber
	slab wall cladding is representative of the typical form of barn found
	throughout the district.
	Meets the criterion on a Local level.

INTEGRITY/
INTACTNESS

Moderate

IMAGES



Caption: Barn at No. 87 King Road, Wilberforce (exterior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: July 2023



Caption: Barn at No. 87 King Road, Wilberforce (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: July 2023




Issue: March 2025

Caption: Barn at No. 87 King Road, Wilberforce (interior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: July 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

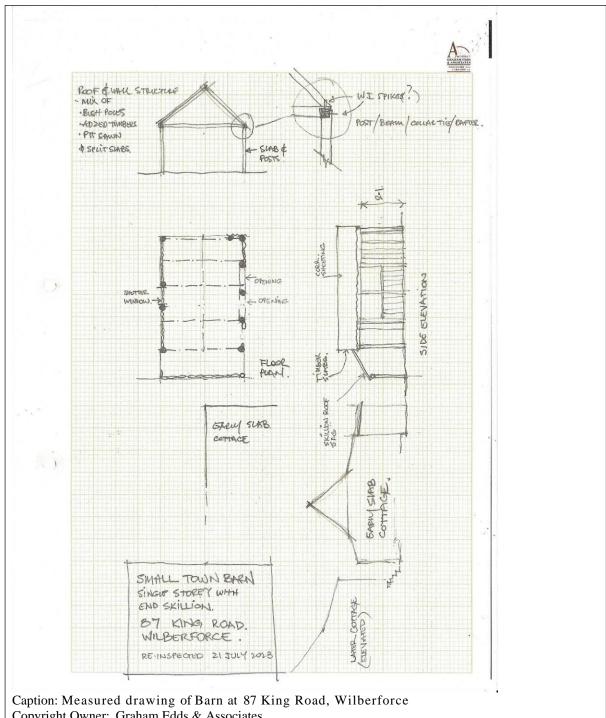

Copyright Owner: Graham Edds & Associates

Date: July 2023

ITEM DETAILS	
NAME	Two Storey Slab Barn with Skillion
OTHER/FORMER NAMES	Sundown, House and Barn
ADDRESS	55 McKinnons Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 408 DP 751665
SHI No.	1743069 (and 1740161)
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGEN	MENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local listing- Site inspection required to clarify
	condition and integrity.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Late 19 th – early 20 th century
CURRENT USE	?
FORMER USE	Barn
LOCATION ON SITE:	The barn with later attached metal clad silo, is in the middle of a paddock approximately 125m south of McKinnons Road. Associated with an early 20 th century weatherboard cottage.
MAIN BARN STRUCTURE	A small barn with loft and side skillion. The body of the barn is approximately 9 x 4m on plan. Condition: Poor
NO. OF BAYS	Three (assumed)
ROOF STRUCTURE	The roof is pitched at approximately 30° and has battens suitable for corrugated iron roofing. Condition: Poor
LOFT	Not inspected.
SKILLION	The skillion is approximately 3m wide and located along the southern side of the barn. It was not inspected. Condition: Not known
ROOF CLADDING:	Corrugated iron Condition: Poor
WALL CLADDING	Two lifts of vertical timber slabs with corrugated iron to gable end. Condition: Poor.
OPENINGS	Appears to have an opening in the central bay.
OTHER	Corrugated metal clad silo
HISTORY	

The barn and silo at 55 McKinnons Road, Wilberforce are located on Portion 408, Parish Wilberforce, a 43 acre allotment which was taken up as a Homestead Selection by Charles L. Rhodes on 5 November 1908. The allotment boundaries of the original selection remain in place today.

A Homestead Selection (under the *Crown Lands Act* of 1895) allowed for land to be held and occupied under a perpetual lease arrangement. Most of the Homestead Selections established on the Wilberforce Common averaged around 40 acres, designed to support one family carrying out orcharding and mixed farming. The selector was required to commence residency on the land within three months and erect a dwelling within eighteen months. In 1917, legislation allowed for the land to be converted to freehold. The Wilberforce

settlement was originally known as Copeland Village, named for the Minister of Lands, Hon. H. Copeland.

Charles Rhodes emigrated to Australia in the late 19th century from England and worked as a plumber until c1912 when he became a commission agent and salesman for the Bathurst Street Fruit Exchange, Sydney. He was also appointed a member of the Board of Control for the Wilberforce Settlement in 1893, indicating that Rhodes was one of the earliest settlers of the Wilberforce Settlement.

Rhodes appears to have erected a cottage within the next few years, as one of the conditions of his Homestead Selection and based on an historic photograph held in the collection of Arthur Cooper and published in the Hawkesbury Gazette, this early dwelling consisted of a complex of timber slab buildings that no longer survive. In 1914, Charles Rhodes died leaving behind a wife and twelve children.

In June 1924, the Homestead Selection was converted into a Conditional Purchase. On 30 December 1927, the land was granted to son Stephen Ernest Rhodes, of Wilberforce, for £53/15/-.

Based on the history of the property and the known physical evidence, the barn appears to have been constructed by Charles Rhodes in the late 19th or early 20th century.

REFERENCES	Certificate of Title V 4097 f 127
	Parish Maps, Wilberforce, 1906, 1925
	"Obituary", Windsor and Richmond Gazette, Friday 11th December 1914,
	p. 4
	Windsor and Richmond Gazette, Saturday 23 rd March 1912, p. 3
	https://www.hawkesbury.org/name/homestead-grants-nsw-1895.html
	https://www.hawkesburygazette.com.au/story/3803460/glossodias-older-
	currency/

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 55 McKinnons Road, Wilberforce is of historical significance and potentially rare as a surviving late 19th/early 20th century timber framed barn, that is evidence of the former Copeland Village, a Homestead Selection settlement established on the Wilberforce Common in c1893. The 43 acre allotment was taken up by Charles Rhodes, member of the Board of the Control of the Wilberforce Settlement, whose family held the property until the late 1920s. The original allotment boundaries of the selection remain in place today.

The small barn with side skillion and adjacent later silo located in the centre of a paddock makes a strong contribution to the historical character of the agricultural lands in the Wilberforce locality. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

ASSESSED SIGNIFICANCE	Local
TYPE	
CRITERIA A) HISTORICAL	The barn at No. 55 McKinnons Road, Wilberforce is of historical
·	significance as evidence of the former Copeland Village, a Homestead
	Selection settlement established in c1893. The 43 acre allotment was
	taken up by Charles Rhodes in the 1890s and the family held the
	property until the late 1920s and it is assumed built the barn.
	Meets the criterion on a Local level.
CRITERIA B) HISTORICAL	The barn has historical associations with Charles Rhodes, an early
ASSOCIATION	settler of the Wilberforce Settlement (Copeland Village) and former
	member of the Board of Control for the Wilberforce Settlement,
	although he is no longer well known today.
	Meets the criterion on a Local level.
CRITERIA C)	Located in the middle of a large paddock and associated with an early
AESTHETIC/TECHNICAL	20 th century weatherboard cottage, the barn (with later attached silo)
	makes a strong contribution to the historical character of the agricultural
	lands in the Wilberforce locality.
	The small barn with loft and side skillion, two lifts of vertical timber
	slabs with corrugated iron to gable ends is potentially of technical
	significance for demonstrating late 19 th /early 20 th century construction
	methods for agricultural buildings.
	Meets the criterion on a Local level.

CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the
SOCIAL/CULTURAL	local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The form of the barn, with loft and skillion has the potential to provide
POTENTIAL	further information into 19 th and 20 th century farming methods, as well
	as further information into the history of the Wilberforce Settlement.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 55 McKinnons Road, Wilberforce is potentially rare
	within the context of the Hawkesbury City local government area, as
	surviving evidence of the Homestead Selection settlement at
	Wilberforce established in c1893.
	Meets the criterion on a Local level.
CRITERIA G)	The barn at No. 55 McKinnons Road, Wilberforce is representative of
REPRESENTATIVE	the long history of agricultural development within the floodplains of
	the Hawkesbury River, which commenced in the early 19 th century and continues today.
	The basic form of the barn with gabled roof, skillion and loft is
	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Unknown

IMAGES

Issue: March 2025



Caption: Barn at No. 55 McKinnons Road, Wilberforce. Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: July 2023

ITEM DETAILS	
NAME	Complex of Single Storey Slab Barn with Loft and Corn Shed- Demolished
OTHER/FORMER NAMES	Harmony Farm
ADDRESS	108 Pitt Town Ferry Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 1 DP 588784
SHI No.	1743068 (also 1740082)
EXISTING HERITAGE	Y – Local (I388)
ITEM?	
RECOMMENDED MANAGEMENT	
MANAGEMENT	Not recommended for State or local listing
SUMMARY	
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Early-mid 19 th century
CURRENT USE	N/A- Demolished
FORMER USE	Barn
INTEGRITY/INTACTNESS	Barn demolished

2023: Barn and Corn Shed have been demolished.

[2010 inventory sheet]

A complex containing the rural homestead and two out buildings located beside the farmhouse some distance away and closer to the road boundary. A twentieth century stables building is located behind the farmhouse.

The principal structure is a single storey barn (approx 1m x 5.2m) formerly with a loft and a

skillion at one end. The loft structure is missing and along with other deterioration and missing posts may well be the reason for its poor condition with dramatic lean at one end. An independent floor structure is throughout the ground floor area (not including the skillion). The roof has a high pitch, typical of a 19th century barn. The upper wall areas have remnant splayed weather boarding and the lower walls also contain remnants of timber slabs on two sides. Other timber slabs presumably from the barn are stockpiled at the rear. One central bay of the structure is located double stable doors with hand made hinges.

The second outbuilding is a corn croft (corn drying shed) rectangular in shape (approx 4m x

5m) with a gabled roof and walls of thin bush poles crossed at the corners resulting in spaces for free flow ventilation. The walls and floor structure appear to be independent of the roof structure. The roof and wall structure has been severely weakened by termite attack and the roof structure has collapsed in the last couple of years. Against one wall of this corn shed is a huge eucalyptus tree that may have also contributed to the demise of the structure.

Structure:

Issue: March 2025

The principal barn is post and beam structure with posts (250-300mm diam) continuous to the loft roof wall beam (approx 4.2 m long above ground) with an end skillion integrally constructed. The roof is structured with closely spaced bush pole rafters suggesting that the original cladding was timber shingles. The existing batten spacings are now for a lighter corrugated metal cladding. The rafters are spiked to perimeter beams (adzed or broad axed to roughly rectangular) and these are housed into the post tops. Unusually the beam corners are triangulated in the horizontal plane with a timber brace. The structure is in poor condition but with a little bracing the structure could be stabilised.

The corn shed as described above has an independent post and beam structure that surrounds the ventilating walls. The four perimeter beams halved and spiked at the corners provide the base structure for the roof rafters. These are supported by four posts set into the ground along two sides of the walls, the beams cantilevering to cover the full extent of the wall structure. The entire structure has been framed with bush poles of varying diameters but because of extensive termite damage the entire structure has collapsed.

HISTORY

Ex-soldier John Atkins was granted 85 acres named Atkins Farm on the banks of the River Hawkesbury in the district of Mulgrave Place on 1 May 1797. The large area may have been to provide for a wife and family. On 14 September 1804, the sale of 20 acres of land 'part of a Farm called Atkins's farm' from David Brown to David Dunstan Snr. for £170 was recorded. It is possible that this was this parcel of land. The land passed to Dunstan Snr's son, also David Dunstan.

After his death in August 1881 aged 86, the land passed to his son Benjamin, measuring 30 acres. Benjamin Dunstan had occupied the land, and after his death on 16 November 1910, it was devised to his three children, David, Charles Dunstan, Maria, Martha Dunstan and Angelina Miriam Dunstan in equal shares. The house on the land was occupied by Benjamin Dunstan.

When Edwin Grantley Dunstan, farmer of Wilberforce, applied to convert the land to Torrens Title in 1972, the LTO found that there was a large break in the title in the mid nineteenth century.

REFERENCES

Grants, Volume 2 No 151


Old Register, Book 1 page 91 no 477, Land Registry Services, New South Wales

Old System Deed, No 834 Bk 947

Jan Barkley-Jack, Hawkesbury Settlement Revealed, pp 66-67

Real Property Application 49077, Land Registry Services, New South Wales

IMAGES

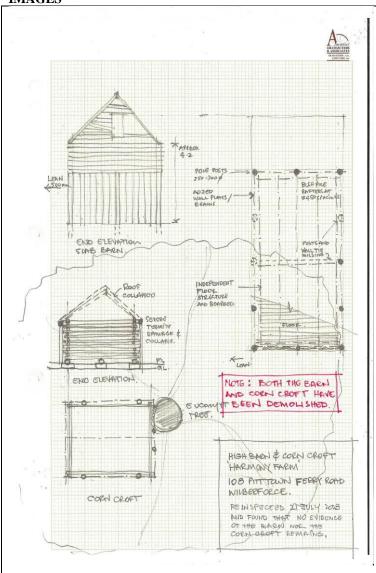

Issue: March 2025

Caption: Measured drawing of Barn at 108 Pitt Town Ferry Road, Wilberforce Copyright Owner: Graham Edds & Associates Date: July 2023

ITEM DETAILS	
NAME	Slab barn
ADDRESS	63 Wilberforce Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Pt 1 DP 520343
SHI No	1740131
EXISTING HERITAGE	No
ITEM	
RECOMMENDED MANAGE	MENT
MANAGEMENT	Not recommended for State listing.
SUMMARY	Recommended for local listing.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Early 20 th century
CURRENT USE	Machinery store
FORMER USE	Barn
LOCATION ON SITE	Alongside (to the west of) Federation period weatherboard bungalow
MAIN BARN STRUCTURE	Single-storey barn with partial loft and lower-level mezzanine, round timber
	posts, sawn rectangular longitudinal beams and cross beams. End bays have
	diagonal bracing in plane of eaves.
	Date: Early 20 th century
	Condition: Good
NO. OF BAYS	Five (2 small 3 large).
ROOF STRUCTURE	Sawn rafters, some collar ties, sawn battens at wide centres for sheeting.
	Date: Early 20th century
	Condition: Good
LOFT	Loft structure only in middle bay and cantilevered over half of one additional
	bay. Boarded sides with gaps for ventilation.
SVII I ION 1	Date: Early 20 th century Single-storey skillion to the western side. End skillion to northern end.
SKILLION 1	Date: Early 20 th century
ROOF CLADDING:	Corrugated steel.
WALL CLADDING	Corrugated steel.
WALL CLADDING	Timber slat ventilated walls to northern end & around raised timber floor.
	Weatherboards to northern gable end.
	Date: Early 20 th century
FLOORING (GROUND)	Concrete (raised timber slatted floor in northern two bays)
FLOORING (LOFT)	Timber narrow t&g boarding
FLOORING	Drying floor with slatted boards and sides over 2 end bays
(MEZZANINE)	y 6 - 1.1
FLOORING (SKILLION)	Concrete
INTERNAL STRUCTURE	Round timber poles and rectangular sawn beams supporting mezzanine and
	loft.
HISTORY	

The barn at No. 63 Wilberforce Road, Wilberforce is located on part of a grant of 30 acres (Portion 67, Parish Wilberforce) on the River Hawkesbury in the district of Mulgrave Place made to Thomas Gosper on 19 November 1794, to be named Gosper Farm, bounded on the north east by land granted to James Richards and on the south west by land granted to William Cuckow.

Gosper was sentenced to seven years' transportation and arrived in Sydney aboard the *Surprize* in June 1790. On 19 February 1827, Gosper conveyed the 30 acres to Richard Dunstan for £340. Richard Dunstan was later

a churchwarden for Saint Matthew's Church, Windsor, and also operated as an undertaker in Windsor.

The property remained in the Dunston family until the early 20th century.

By his will of 7 May 1873, Richard Dunstan left this land to William Dunston. Richard Dunstan died on 12 August 1879. A road survey plan of 1881 recorded William Dunstan as owner and occupier of this land. A house was shown on the southern side of the road on this part of the grant but no barn was shown on the plan.

William Dunston died on 28 June 1896, leaving his property to his two sons, William Richard Dunston and Arthur Ernest Dunston as trustees. At an auction of this land on 12 August 1896, the property was purchased by William Dunston snr's brother Robert Charles Dunston and another son Frederick John Dunston. The auction advertisement for the sale mentioned household furniture, livestock and agricultural equipment but gave no details of buildings.

By a formal conveyance dated 27 October 1896, William Richard Dunston of Windsor, labourer and Arthur Ernest Dunston of Wilberforce Road, tailor (trustees of the will of William Dunston) conveyed the land to Robert Charles Dunston of Leichhardt, baker and Frederick John Dunstan of Wilberforce Road, farmer for £1,691/11/6. Gosper's grant was then recorded more accurately as measuring 36 acres 1 rood 14 perches.

On 6 March 1900, the grant was subdivided between Robert Charles Dunston of Leichhardt, baker and Frederick John Dunstan of Wilberforce Road, farmer. Frederick John Dunstan received the western part of Portion 67 measuring 18 acres 1 rood 23 perches. The same day he mortgaged that half to John Johnston of Pitt Town, farmer and David Hall of Scone, grazier for £600. Shortly afterwards on 3 July 1900, Frederick John Dunstan of Windsor, farmer, conveyed his remaining interest or equity in the property to John Johnston of Pitt Town, farmer and David Hall of Scone, grazier for an additional £600.

On 31 July 1911, David Hall conveyed the property to Abraham Charles Johnston (John Johnston's nephew) of Cornwallis, Windsor, farmer, for £1,000.

The Johnston family first arrived in the Hawkesbury area as free-settlers in 1802, settling in Windsor and they were the founders of the Ebenezer Presbyterian Church, Ebenezer, the oldest Presbyterian Church in Australia.

Abraham Charles Johnston died on 20 July 1958. His will stated that he gave one half of the property situated at Wilberforce Road (to be divided by a line from the river to the back boundary) containing the house and sheds and being the nearest half to Windsor to his son, George Thomas Johnston. Abraham Johnston's wife Emmeline Bridget Johnston, was given a life estate to live in the house, subject to the payment by their son George of one half of the net proceeds of the farm to Emmeline during her lifetime.

REFERENCES	Grants, Vol 1 p 127 (1)	
	Old Register, Bk 6 p 333 no 140	
	Old System Deed, No 664 Bk C	
	Old System Deed, No 935 Bk 588	
	Old System Deed, No 466 Bk 660	
	Old System Deed, No 468 Bk 660	
	Old System Deed, No 856 Bk 668	
	Old System Deed, No 520 Bk 944	
	Windsor and Richmond Gazette, 1 Aug 1896 p 8	
CTATEMENT OF CICNIFIC	STATEMENT OF SIGNIFICANCE	

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 63 Wilberforce Road, Wilberforce is of some historical significance as forming part of the long history of agricultural use of the land from 1794 to date, and for its associations with later members of the Johnston family, a pioneer Hawkesbury family, who owned the property from the early 20th century and were probably responsible for the construction of the barn.

Sited above the Hawkesbury River, adjacent to an early 20^{th} century weatherboard house, the barn makes a strong contribution to the historical character of the agricultural lands along Wilberforce Road. The overall form and configuration of the barn, with corrugated metal cladding, timber slat ventilated walls, loft and skillions, is a good representative example of an early 20^{th} century timber framed barn found throughout the Hawkesbury City local government area.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 63 Wilberforce Road, Wilberforce is of some historical
HISTORICAL	significance as forming part of the long-term history of agricultural use of the
	land from 1794 to date. The property was initially established when granted
	to ex-convict Thomas Gosper in 1794 and by the 1820s was in the ownership

	of the Dunstan family until the 20 th century. The barn appears to date from
	the early 20 th century during the period of ownership of the property by the
	Johnston family, a notable pioneer family of the Hawkesbury district.
	Meets criterion on a Local level.
CDITEDIA D	The barn has historical associations with later members of the Johnson
CRITERIA B)	
HISTORICAL	family, who arrived in the Hawkesbury district in the early 19 th century as
ASSOCIATION	free-settlers and were responsible for the construction of the Ebenezer
	Presbyterian Church.
	Meets criterion on a Local level.
CRITERIA C)	Located next to an early 20 th century weatherboard house, sited above the
AESTHETIC/TECHNICAL	Hawkesbury River, the large timber framed barn partially clad in corrugated
	iron, with timber slat ventilated walls to its northern end, loft and mezzanine
	makes a strong contribution to the historical character of the agricultural
	landscape along Wilberforce Road.
	Meets criterion on a Local level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets criterion on a Local level.
CRITERIA E) RESEARCH	The form and configuration of the barn, with skillions and loft, has the
POTENTIAL	potential to provide further information into early 20 th century farming
	methods and construction techniques for agricultural buildings of the period.
	Meets criterion on a Local level.
CRITERIA F) RARITY	The barn at 63 Wilberforce Road, Wilberforce is not considered to be rare
	within the context of the Hawkesbury City local government area.
	Does not meet the criterion.
CRITERIA G)	The barn at 63 Wilberforce Road, Wilberforce is a good representative
REPRESENTATIVE	example of an early 20 th century timber framed barn that remains in
	agricultural use and is representative of the long history of agricultural
	development within the floodplains of the Hawkesbury River, which
	commenced in the early 19th century and continues today. The basic form of
	the barn with gabled roofs, skillions and loft is representative of the typical
	form of barn found throughout the district.
	Meets criterion on a Local level.
INTEGRITY/INTACTNESS	High integrity/Moderate intactness

IMAGES

Issue: March 2025



Caption: Barn at 63 Wilberforce Road, Wilberforce (exterior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson

& Partners
Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD




Caption: Barn at 63 Wilberforce Road, Wilberforce (interior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson

& Partners

Date: May 2023

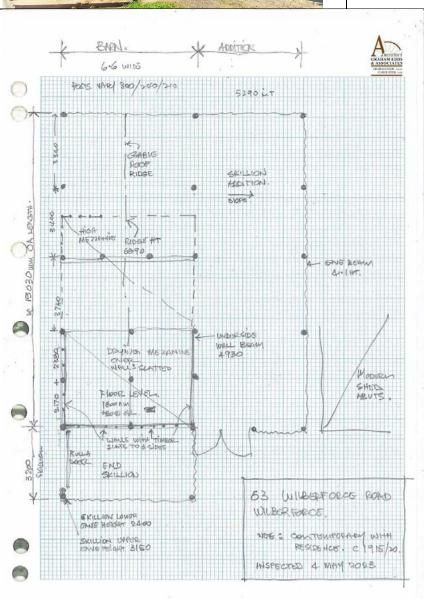

Caption: Measured drawing of barn at 63 Wilberforce Road, Wilberforce

Copyright Owner: Graham Edds & Associates

Date: May 2023

TTEM DETAILS	
ITEM DETAILS	
NAME	Two Storey Slab Barn with Skillion- Demolished
ADDRESS	76 Wilberforce Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 2 DP 520343
SHI No.	1743063
EXISTING HERITAGE	N
ITEM?	
RECOMMENDED MANAGEMENT	
MANAGEMENT	Not recommended for State or local listing
SUMMARY	
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Late 18 th to early 19 th century
MODIFICATION/DATES	?
CURRENT USE	N/A
FORMER USE	Barn
2022 P. 1 1 1 1 1 1 1 1	

2023: Barn has been demolished

[2010 inventory sheet]

Access to this barn was denied by the adjacent property occupant, so the description and photograph has been observed from the Wilberforce Road.

Description:

A high two storey slab barn located on the western bank of the Hawkesbury River and close to the Windsor bridge. Long rectangular primary barn approx 4-5m wide x at least 20m long with a skillion on one side (facing the river). The barn is clad with timber slabs at ground level and horizontal boarding to the upper storey and gable ends. The roof has a high pitch and is clad with corrugated metal. The curtilage to the building is overgrown with vision both from the road and the river being obscured.

The Hawkesbury Heritage Inventory further describes the barn as containing horse troughs of hollowed timber logs and outside is a sandstone grinding wheel once mechanically driven by a belt drive. This grinding wheel is covered by a small skillion addition at the side of the barn. Refer to SHI NO 1740131 Structure:

A post and beam structure with posts continuous into the full height of the upper storey. The posts are regularly spaced with door openings hinging from these posts. The upper side and end walls are obscured from view but likely to be framed vertically for the nail fixing of the weather boarding. The structure appears to be maintained and appears vertical and reasonably straight.

HISTORY

Issue: March 2025

Thomas Gosper was granted 30 acres on the River Hawkesbury to be known as Gosper Farm between the farms of James Richards and William Cuckow on 19 November 1794. The 1800 Stock Muster showed that Thomas Gosper held 30 acres with 16 acres cleared and 13 [sic] acres planted in wheat and 5 [sic] acres planted in maize. He placed notices in the press in February 1804 warning trespassers against cutting timber on this grant between Richards and Cuckow. Gosper acquired other parcels of land at Wilberforce.

By a deed of conveyance of 19 February 1827, Thomas Gosper sold the grant to Richard Dunstan (also spelt as Dunston) for £340 in dollars at five shillings each. The property remained in the hands of the Dunston family for the rest of the century. By his will of 7 May 1873, Richard Dunston left the property to William Dunston. Richard Dunston died on 12 August 1879.

William Dunston signed his will on 23 June 1892 appointing his sons, William Richard Dunston and Albert Ernest Dunston as trustees to sell the land by auction. William Dunston died on 28 June 1896. The land was auctioned on 12 August 1896. Press advertisements for the sale provided no details of buildings on the land. By a deed of conveyance dated 27 October 1896, William Richard Dunston of Windsor, labourer and Arthur Ernest Dunston of Wilberforce Road, tailor (executors and trustees of the will of William Dunston) conveyed

the land to Robert Charles Dunston of Leichhardt, baker and Frederick John Dunston of Wilberforce Road, farmer for £1,691/11/6. They agreed to divide the land between them. On 6 March 1900, the land was partitioned. Robert Charles Dunston received the eastern part measuring 18 acres 1 rood 23 perches.

REFERENCES Grants, Vol 1 p 127 (1)

C J Baxter, Musters and Lists New South Wales: and Norfolk Island

1800-1802, ABGR, Sydney, 1988, AG237

Sydney Gazette, 26 Feb 1804, p 4 Old System Deed, No 664 Bk C Old System Deed, No 935 Bk 588 Old System Deed, No 465 Bk 660

Windsor and Richmond Gazette, 8 Aug 1896 p 8

STATEMENT OF SIGNIFICANCE

Issue: March 2025

[2010 inventory sheet]

A very rare Hawkesbury barn overlooking the Hawkesbury River near Windsor with early structural characteristics. This barn has not been sufficiently inspected to discuss further its cultural significance. Associated with ex-convict, Thomas Gosper's land grant promised in 1794.

INTEGRITY/INTACTNESS Demolished.

ITEM DETAILS	
NAME	Single Storey Slab Barn with Loft and Skillions
ADDRESS	87 Wilberforce Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 616 DP 863291
SHI No	1740203
EXISTING HERITAGE	Yes- I275
ITEM	
RECOMMENDED MANAGE	
MANAGEMENT	Not recommended for State heritage listing.
SUMMARY	Retain as local heritage item
ITEM CLASSIFICATION ITEM TYPE	D!I4
ITEM GROUP	Built Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	Duit
CIRCA	Y
PERIOD	Late 19th or Early 20th century
MODIFICATION/DATES	Mid 20 th century
FORMER USE	Barn including corn drying
CURRENT USE	Vacant
LOCATION ON SITE	On a shallow block of land between road and river, the barn is opposite a
	brick chimney which is all that remains of the house.
MAIN BARN STRUCTURE	Single-storey barn with lofts at each end and skillions on three sides. Round
	timber posts, sawn rectangular longitudinal beams and cross beams.
	Date: Late 19 th or early 20 th century
	Condition: Moderate
NO. OF BAYS	Five
ROOF STRUCTURE	Roof pitch 30°. Sawn rafters, sawn battens at wide centres for sheeting.
	Date: Late 19th or early 20th century
	Condition: Moderate
LOFT	Not accessed
SKILLION 1	Northern end skillion is the earliest with remains of slab wall cladding and a
SKILLION	very lightweight pole roof structure.
	Date: Late 19 th or early 20 th century
	Condition: Poor
SKILLION 2	Western skillion has a low pitched roof with sawn rafters and battens and
	corrugated iron cladding. Remains of timber floor at north end, stepped
	concrete floor at south end.
	Date: Early 20 th century
	Condition: Poor
SKILLION 3	Eastern skillion has a flattish roof with sawn rafters and battens and
	corrugated iron cladding.
	Date: Mid 20 th century?
	Condition: Poor
POOE CLAPPING	
ROOF CLADDING:	Corrugated iron, short sheets.
	Condition: Poor
WALL CLADDING	Remains of vertical timber slabs on western side of both slatted drying

	enclosures at each end of main barn, remains of weatherboard cladding to upper level of central bay of barn, elsewhere corrugated iron. Condition: Poor
ODENINGS	
OPENINGS	Doorways in skillions, one side of main barn completely open to skillion.
FLOORING (GROUND)	Earthen
FLOORING (LOFT)	Timber boarding
	Condition: Moderate
FLOORING (SKILLION)	Earthen
INTERNAL STRUCTURE	Slatted drying enclosures at each end of barn. The southern enclosure has a raised ventilated floor of round poles. The northern one has no raised floor but a loft.
	Condition: Moderate

HISTORY

Issue: March 2025

No. 87 Wilberforce Road, Wilberforce forms part of a grant of 30 acres of 19 November 1794 to James Richards to be known as Richards Farm (Portion 66, Parish Wilberforce) on the River Hawkesbury in the district of Mulgrave Place bounded on the north-east by Henry Hyams land and on the south west by Thomas Gosper.

James Richards had been sentenced 7 years' transportation and arrived in NSW on the *Scarborough* as part of the First Fleet.

On 2 June 1809, James Richards of Hawkesbury, dealer transferred 30 acres known as Richards farm and 15 acres part of Hyams Farm to John Norman, Hawkesbury for £400. John Norman of Windsor mortgaged both parcels of land to Samuel Terry, merchant of Sydney on 20 December 1815. On 24 March 1817, Norman transferred his interest in two farms mortgaged to Samuel Terry and Edward Eagar to Dennis Conway, containing all the farms, 'a Farm House, Houses, Land & premises'. Conway never appears to have confirmed his interest to this land.

John Norman died shortly afterwards. Edward Eagar to whom Norman had mortgaged the land on 1 January 1817, successfully brought an action for debt against Norman's estate. An auction notice announced that the estate of John Norman deceased would be auctioned on 2 July, including 54 acres being Richards' farm and part of Hyam's farm. No details of buildings on the two grants were included in the notice. Both Richards' farm and 15 acres, half of Hyam Farm were purchased at the auction by Edward Eagar.

By some means, which does not appear to have been recorded, the land came into the hands of Samuel Terry, ex-convict and successful merchant landowner. Samuel Terry gave his son John Terry the estate of Box Hill plus other land on 12 May 1831. On 7 and 8 September 1835, this land was settled on trustees for the benefit of John Terry and his children.

On 1 January 1836, Richards' farm was leased for five years from Eleanor Terry to John Hogan. On 1 March 1854, Eleanor Terry leased 30 acres at Wilberforce for five years to John Barret. By a deed of release dated 17 February 1862 with the following parties, 1st John Hosking and John Richard Rouse 2nd Richard Rouse Terry 3rd Edward Terry 4th Samuel Henry Terry, various parcels of land including Richards' farm were conveyed to Samuel Henry Terry.

On 19 February 1862, Samuel Henry Terry, of Cooks River, esquire conveyed Richards' farm to John Barrett, of Wilberforce, farmer for £1,100. John Barrett of Wilberforce Road was one of the people identified as being forced to leave their homes by the recent flood in July 1867.

John Barrett's will of 14 July 1879 appointed trustees to hold his farm land at Wilberforce, purchased from Terry for the benefit of his wife, Catherine until his youngest child was 21 years old, also creating a life interest for his son Michael Barrett. John Barrett died on 29 September 1880.

A road survey plan of February 1881 showed John Barratt as owner and occupier of this land, but the ownership details were altered to 'Mrs Barratt'. No buildings were shown on that survey. Catherine Barrett, widow of John Barrett, died on 29 May 1886. Michael Barrett had long been occupying the farm. On 10 April 1889, Michael Barrett, of Sydney, farmer assigned his life insurance policy to Brinsley Hall, of Windsor, gentleman for £430. Not only did Barrett assign his life insurance policy worth £400 but he also transferred his interest in Richards' farm.

Brinsley Hall was a one time president of the Hawkesbury District Agricultural Society; secretary of the

Hawkesbury Race committee and in 1901 he was elected to the New South Wales Legislative Assembly as the member for Hawkesbury. Born in St. Albans, Brinsley's father George Smith Hall owned the property known as Lilburndale, Sackville. Brinsley Hall retained Richards' farm until his death on 8 May 1940 and the property was passed on to members of his family.

Based on the physical evidence, it appears likely that the barn at No. 87 Wilberforce Road, Wilberforce is associated with Brinsley Hall's period of ownership of the land.

REFERENCES	Grants, Vol 1 p 123 (2)
	Old Register, Bk 5 p 50 no 519
	Old Register, Bk 6 p 244 no 1
	Old Register, Bk 6 p 249 no 9
	Old Register, Bk 8 p 56 No 67
	Old System Deed, No 750 Bk 77
	Old System Deed, No 490 Bk 411
	R.2305.1603, Crown plan
	Sydney Morning Herald, 2 July 1867, p 3

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 87 Wilberforce Road, Wilberforce is of historical significance as a surviving late 19th /early 20th century timber framed barn that may be associated with notable Hawkesbury person Brinsley Hall MLA, former president of the Hawkesbury District Agricultural Society, secretary of the Hawkesbury Race committee and member for the Hawkesbury, who owned the property from 1889 to 1940.

The large single storey barn (now clad in corrugated metal) with skillions, makes a strong contribution to the historical character of the agricultural lands along Wilberforce Road and the Hawkesbury River floodplains. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

Containing lofts at each end and skillions on three sides with round timber posts, sawn rectangular longitudinal beams and cross beams, vertical timber slabs and weatherboard wall cladding and slatted drying enclosures at each end of main barn, the barn is of some technical significance for demonstrating late 19th/early 20th century construction methods for agricultural buildings and has the potential to provide further information into late 19th century farming methods.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 87 Wilberforce Road, Wilberforce is of historical
HISTORICAL	significance as evidence of the long-term agricultural use of the land, first
	established in 1794 by ex-convict James Richards and in continuous
	agricultural use since that time. Dating from the late 19 th or early 20 th
	century, the barn appears to be associated with Brinsley Hall, who owned
	the property from 1889 until his death in 1940, and then passed on to
	members of his family.
	Meets the criterion on a Local level.
CRITERIA B)	The barn has historical associations with Brinsley Hall, a prominent
HISTORICAL	member of the Hawkesbury community, being a one-time president of the
ASSOCIATION	Hawkesbury District Agricultural Society, secretary of the Hawkesbury
	Race committee and Member of the Legislative Assembly as the member
	for Hawkesbury.
	Meets the criterion on a Local level.
CRITERIA C)	Located adjacent to the remains of a dwelling, the large, corrugated metal
AESTHETIC/TECHNICAL	clad timber framed barn with side and rear skillions, makes a strong
	contribution to the historical character of the agricultural lands along
	Wilberforce Road and the Hawkesbury River floodplains.
	The single storey barn contains lofts at each end and skillions on three sides
	with round timber posts, sawn rectangular longitudinal beams and cross
	beams, vertical timber slabs and weatherboard wall cladding and slatted
	drying enclosures at each end of main barn and is of some technical
	significance for demonstrating late 19 th /early 20 th century construction
	methods for agricultural buildings.
	Meets the criterion on a Local level.

CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH	The form of the barn, with skillions and lofts and retaining evidence of late
POTENTIAL	19 th /early 20 th century construction techniques, the barn at 87 Wilberforce Road, Wilberforce has the potential to provide further information into 19 th
	and 20 th century farming methods.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at 87 Wilberforce Road, Wilberforce is not considered to be rare
	within the context of the Hawkesbury City local government area.
	Meets the criterion on a Local level.
CRITERIA G)	The barn at 87 Wilberforce Road, Wilberforce is representative of the long
REPRESENTATIVE	history of agricultural development within the floodplains of the
	Hawkesbury River, which commenced in the early 19 th century and
	continues today.
	The basic form of the barn with gabled roof, skillions and lofts is
	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level.
INTEGRITY/	Moderate to high integrity/intactness. The extent of perimeter skillion
INTACTNESS	accretions lessen the overall appearance and aesthetics of the barn.

IMAGES



Caption: Barn at 87 Wilberforce Road,

Wilberforce (exterior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson

& Partners Pty Ltd Date: May 2023



Issue: March 2025

Caption: Barn at 87 Wilberforce Road,

Wilberforce (interior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson

& Partners Pty Ltd Date: May 2023




Caption: Barn at 87 Wilberforce Road,

Wilberforce (interior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson

& Partners Pty Ltd Date: May 2023

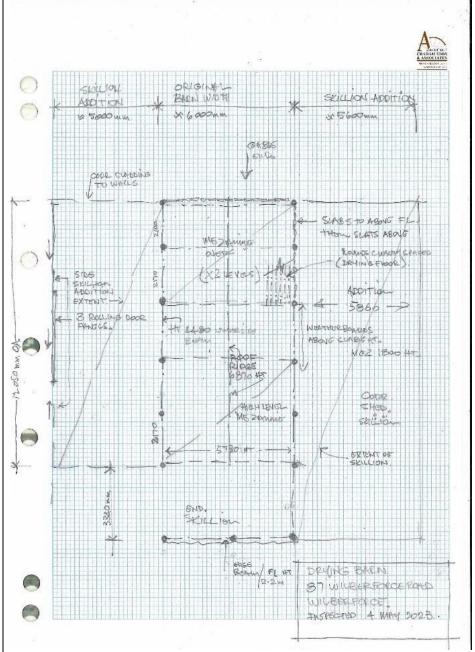

Caption: Measured drawing of Barn at 87 Wilberforce Road, Wilberforce

Copyright Owner: Graham Edds & Associates

Date: May 2023

ITEM DETAILS	
NAME	Two Storey Slab Barn with Skillion
OTHER/FORMER NAMES	Ryans Farm
ADDRESS	191 Wilberforce Road Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 620 DP 1012728
SHI No.	1743064
EXISTING HERITAGE	No
ITEM	
RECOMMENDED MANAGEM	MENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Recommend for Local heritage listing.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	l v
CIRCA	Y
PERIOD	Mid – late 19 th century?
MODIFICATION/DATES	Late 20 th century
CURRENT USE	Machinery store
FORMER USE	Barn
LOCATION ON SITE	Close to the western bank of the Hawkesbury River and next to a derelict
	single-storey weatherboard house which is surrounded by a group of established trees.
MAIN BARN STRUCTURE	Two-storey barn with timber mezzanine floors at each end. Round timber
MAIN BARN STRUCTURE	posts, large squared longitudinal beams and round cross beams supporting
	loft floor. Unfortunately, not intact due to removal of roof and (possibly
	loft) structure, replaced with flat roof. Main posts extend past loft floor
	beams.
	Date: Mid – late 19 th century?
	Condition: Moderate
NO. OF BAYS	Six (skillion has seven by dividing larger bay in 2)
ROOF STRUCTURE	N/A original roof removed and replaced with flat roof.
LOFT	N/A roof and loft removed.
SKILLION 1	Steep 45° skillion along whole eastern side of barn. Pole rafters and sawn
	battens for corrugated iron.
	Date: Mid – late 19 th century?
ROOF CLADDING:	Condition: Moderate Corrugated iron sheets laid flat on loft floor.
ROOF CLADDING:	Condition: Moderate
WALL CLADDING	Remains of vertical timber slabs on southern end of main barn and an
	upper level of vertical slabs in central bay. Remains of weatherboard
	cladding to skillion gables, elsewhere corrugated iron.
	Date: Mid – late 19 th century?
OPENINGS	Main doorway in centre of front wall. Skillion open at ends.
FLOORING (GROUND)	Earthen (cement screed at one end)
FLOORING (LOFT)	Timber boarding
	Date: Mid – late 19 th century?
FLOORING (SKILLION)	Concrete
INTERNAL STRUCTURE	Large, round, closely spaced beams to mezzanine and loft floors.
	Date: Mid – late 19 th century?
OTHER (Fixings?)	Iron bolts and straps used to join beams to posts. Early ladder to loft
	southern end of barn.
	Large Camphor laurel tree against southern end of barn. Mid- late 19th C?

HISTORY

John Ryan was granted 30 acres on 14 March 1795 on the Hawkesbury River (portion 62, Parish Wilberforce), bounded on the north west by David Lankey and on the south east by John Davison. The property was to be known as Ryan Farm.

John Ryan was sentenced to 7 years transportation and arrived in Sydney on the *Friendship* as part of the First Fleet.

Problems exist in locating the correct chain of title for Ryan Farm, Wilberforce, since another John Ryan (who arrived via the *Neptune* as part of the Second Fleet) was also granted land at Richmond Hill.

By 15 March 1883, the land was owned by Alfred Robinson, of Wilberforce, farmer who mortgaged it to Elizabeth Dunston, Windsor, widow, for £800. Subsequently, Alfred Robinson, of Wilberforce, farmer sold Ryan Farm to Archibald Walmsley, Camperdown, carter on 16 September 1884 for £2,000.

On 3 April 1886, Archibald Walmsley, then described as being a farmer of Wilberforce, conveyed it to Roger Ryan, Pitt Town, farmer for £1,600. Roger Ryan died on 23 June 1911 leaving Ryan Farm to Edward Ryan. Edward Ryan, of Glebe, carrier conveyed the property to Lesley Franklin, of Sydney, builder on 22 March 1922 for £2,935.

REFERENCES	Grants, Vol 1A p 153 (6)
	Old System Deed, No 933 Bk 264
	Old System Deed, No 103 Bk 298
	Old System Deed, No 693 Bk 335
	Old System Deed, No 544 Bk 1255
	https://peopleaustralia.anu.edu.au/biography/ryan-john-30857
	https://convictrecords.com.au/convicts/ryan

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 191 Wilberforce Road, Wilberforce is of historical significance as a surviving mid to late 19th century timber framed barn located on land that was initially granted to ex-convict John Ryan in 1794. Originally known as Ryan Farm, the property has been in continuous agricultural use since the late 18th century.

Although much altered, including the removal of its gabled roof and loft, the large barn (now clad in corrugated metal) makes a strong contribution to the historical character of the agricultural lands along Wilberforce Road and the Hawkesbury River floodplains, which is reinforced by the large, mature *Camphor laurel* immediately adjacent. In its overall form and configuration (albeit altered), it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

Retaining evidence of its mid to late 19th century construction including iron bolts and straps used to join beams to posts, remains of vertical slab wall cladding, remains of weatherboard cladding to skillion gables, and pole rafters and sawn battens for corrugated iron to skillion roof, the barn is of some technical significance for demonstrating mid to late 19th century construction methods for agricultural buildings and has the potential to provide further information into 19th century farming methods.

ASSESSED SIGNIFICANCE	Local
TYPE	
CRITERIA A) HISTORICAL	The barn at No. 191 Wilberforce Road, Wilberforce is of historical
	significance as evidence of the long-term agricultural use of the land since
	1794 when 30 acres (Portion 62, Parish Wilberforce) was granted to ex-
	convict John Ryan. Originally known as Ryan Farm, the property has
	been in continuous agricultural use since that time
	Meets the criterion on a Local level
CRITERIA B) HISTORICAL	The barn does not have any known associations with persons of historical
ASSOCIATION	note.
	Does not meet the criterion
CRITERIA C)	The large, corrugated metal clad, timber framed barn with skillion makes
AESTHETIC/TECHNICAL	a strong contribution to the historical character of the agricultural lands
	along Wilberforce Road and the Hawkesbury River floodplains, which is
	reinforced by the large, mature Camphor laurel tree immediately
	adjacent. The barn forms part of a group of historic barns located on the

	,
	banks of the Hawkesbury River between Windsor and Wilberforce.
	Although much altered due to removal of the original loft and gabled roof,
	and replacement with a flat roof truncating the overall form of the
	building, the barn retains evidence of mid to late 19 th century construction
	techniques including iron bolts and straps used to join beams to posts,
	remains of vertical slab wall cladding, remains of weatherboard cladding
	to skillion gables, and pole rafters and sawn battens for corrugated iron to
	skillion roof. The barn has some technical significance for demonstrating
	mid to late 19 th century construction methods for agricultural buildings.
	Meets the criterion on a Local level
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets the criterion on a Local level
CRITERIA E) RESEARCH	The form of the barn, with skillion, and retaining evidence of mid to late
POTENTIAL	19 th century construction techniques, has the potential to provide further
	information into 19 th century farming methods and construction methods
	for agricultural buildings of the period.
	Meets the criterion on a Local level
CRITERIA F) RARITY	The barn at 191 Wilberforce Road, Wilberforce is not considered to be
CKITEKIA I') KAKITI	rare within the context of the Hawkesbury City local government area.
	Does not meet the criterion
CRITERIA G)	The barn at 191 Wilberforce Road, Wilberforce is representative of the
REPRESENTATIVE	long history of agricultural development within the floodplains of the
REIRESENTATIVE	
	Hawkesbury River, which commenced in the late 18 th century and
	continues today. Meets the criterion on a Local level
INTEGRITATION CONTROL	
INTEGRITY/INTACTNESS	Moderate

IMAGES



Issue: March 2025

Caption: Barn at 191
Wilberforce Road,
Wilberforce (exterior)
Photographer: K. Denny
Copyright Owner: Lucas Stapleton
Johnson & Partners
Date: May 2023



Caption: Barn at 191
Wilberforce Road,
Wilberforce (exterior and

skillion)

Photographer: K. Denny

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: May 2023




Issue: March 2025

Caption: Barn at 191 Wilberforce Road, Wilberforce (interior) Photographer: K. Denny

Copyright Owner: Lucas Stapleton

Johnson & Partners
Date: May 2023

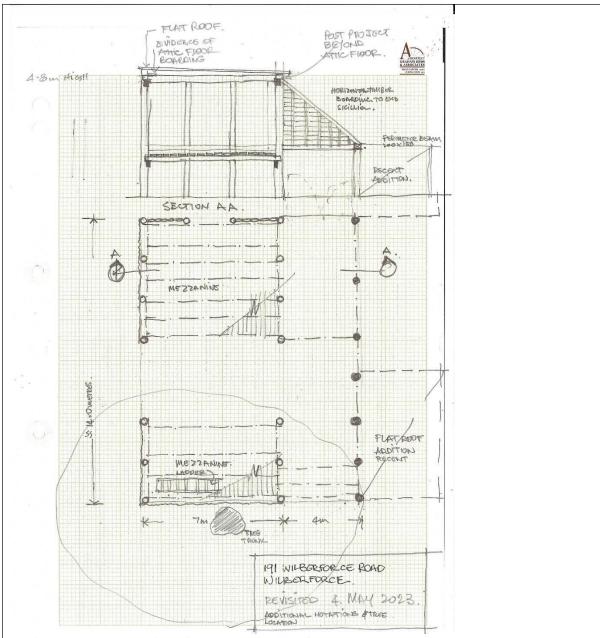

Caption: Measured drawing of barn at 191 Wilberforce Road,

Wilberforce

Copyright Owner: Graham Edds & Associates

Issue: March 2025

Date: May 2023

ITEM DETAILS	
NAME	Complex of two slab barns
ADDRESS	†
	235 Wilberforce Road, Wilberforce
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP	Lot 1 DP 197917
SHI No	1743065/1740199
EXISTING HERITAGE	No
ITEM PEGOMMENDED MANAGE	MENTE
RECOMMENDED MANAGE	
MANAGEMENT	Barn A: recommend for State heritage listing
SUMMARY ITEM CLASSIFICATION	Barn B: recommended for local listing
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn and Shed/Garage
DESCRIPTION	Balli aliu Sileu/Galage
CIRCA	Y
PERIOD	Early 19 th century/ Late 19 th century
CURRENT USE	Barn A: Machinery store
CORRECTIONS.	Barn B: Garage
FORMER USE	Barn and storage shed
LOCATION ON SITE	The property is located between the western bank of the Hawkesbury River
LOCATION ON SITE	and Wilberforce Road. The buildings are clustered closer to the road. From
	south to north there is a large barn (Barn A), a smaller slab barn/shed (Barn
	B), a late 19 th century weatherboard cottage and a more recent two-storey
	house.
DESCRIPTION: BARN A	
MAIN BARN STRUCTURE	Main posts are closely spaced, roughly squared with adze or axe and jointed
	to similarly squared beams using traditional pegged mortice and tenon joints.
	Condition: Good
	Date: Early 19 th century?
NO. OF BAYS	Nine closely spaced bays, central bay wider for doors.
ROOF STRUCTURE	Steep 50° pitch, formed of closely spaced pole rafters with shingle battens
	indicating an early date.
	Wooden pegs used to join cross beams to longitudinal beams.
LOPE	Condition: Good
LOFT	Small loft structure supported on pole beams at southern end approximately
	1.0m below eaves level.
	Larger loft at eaves level consisting of closely spaced round beams and loose
	flooring in centre only. Condition: Good
SKILLION 1	Shallow pitched skillion on eastern side
	Condition: Good
	Date: Late 20 th century?
ROOF CLADDING:	Corrugated iron short sheets.
	Condition: Moderate
WALL CLADDING	Vertical timber slabs except in central doorways which have timber
	ventilation grilles over. Exterior now clad in corrugated steel.
	Condition: Good
	Date: Early 19 th century?
OPENINGS	Central doorways in both sides of barn with ventilated panels over.
FLOORING (GROUND)	Earthen
FLOORING (LOFT)	Timber boarding
FLOORING (SKILLION)	Concrete.
INTERNAL STRUCTURE	Large, round, closely spaced beams to loft floors.

OTHER (Fixings?)	Camphor laurel tree at southern end causing damage. Post/ beam pegged
	mortice and tenon joints
	Wooden pegs used to join cross beams to longitudinal beams.
DESCRIPTION: BARN B	
MAIN BARN STRUCTURE	Small barn or garage constructed of round posts, adzed squared longitudinal
	beams.
	Condition: Moderate
NO. OF BAYS	Three
ROOF STRUCTURE	Bush pole rafters. Bracing and central tie added later. No shingle battens.
	Condition: Moderate
	Date: Late 19 th century?
LOFT	Small loft supported on poles 300mm below eaves level in western end.
	Condition: Moderate
	Date: Late 19 th century?
SKILLION 1	N/A
ROOF CLADDING:	Corrugated iron makers name: Gospel Oak (1850-1939).
	Condition: Moderate
WALL CLADDING	Vertical timber slabs, weatherboard cladding to gables, elsewhere corrugated
	iron.
	Condition: Moderate
	Date: Late 19 th century?
OPENINGS	Large doorway in gable end only.
FLOORING (GROUND)	Earthen
FLOORING (LOFT)	Loose timber boarding
	Condition: Moderate
	Date: Late 19 th century?
FLOORING (SKILLION)	N/A
INTERNAL STRUCTURE	Large, round, closely spaced beams to mezzanine and loft floors.
	Condition: Moderate
	Date: Late 19 th century?
OTHER (Fixings?)	Iron bolts and straps used to join beams to posts.
	Condition: Moderate
	Date: Late 19 th century?
HISTORY	

Matthew/Matthias Lock (various Locke) was granted 30 acres (Portion 60, Parish Wilberforce) in the district of Mulgrave Place on the River Hawkesbury on 19 November 1794. Lock had been transported to Australia for 7 years, arriving in 1790.

Lock originally concentrated on growing maize but switched to wheat, which had a ready market. Later, Lock acquired his neighbour David Lankey's 30 acre grant (Portion 61, Parish Wilberforce), and he eventually became one of the most successful ex-convict landholders in the district, obtaining various other grants of land including 50 acres on Robinson's (later Bushell's) Lagoon, 30 acres at Mulgrave Place, 60 acres at Kurrajong and a further 100 acres at Kurrajong.

In 1805 Lock was made one of the residential trustees of the Phillip (Wilberforce) Common, in 1808 he was made District Constable, and in 1810 he became the Chief Constable of the Hawkesbury.

Matthew (Matthias) Lock of Hawkesbury, yeoman, assigned his entire 1794 grant to Thomas Maloney, Hawkesbury, farmer on 3 April 1830. The transfer was for £150 and included a covenant permitting Lock and his wife Alice to reside on the farm for the term of the natural lives, free of rent or any demands. Matthew Lock died in April 1836. Alice was his second wife and she died on 2 December 1834. Maloney was an emancipist, who had arrived in NSW in 1811 with a life sentence and in 1818, he married Matthew Lock's daughter Mary Graham.

After this date, the land was in the hands of the Maloney family and appears to have been passed down through their line for many decades. It was not conveyed by any member of the Maloney family. During this time Lock's 30 acres was divided into two halves. In June 1864, a severe flood demolished Thomas Maloney senior's house as well as Thomas Maloney junior's house.

A road survey plan of February 1881 showed a barn on Lock's grant in the same position as today, plus another barn on Lankey's grant to the south as well as a house. Based on the physical evidence, it appears that the large barn (Barn A) may be a survivor of the 1864 flood.

In 1916, the southern part of Lock's grant was owned and occupied by Charles William Hawkins, farmer. He died on 9 September 1916 intestate. The property was auctioned on 31 July 1920. The southern part of Lock's 30 acre grant was sold as a parcel of 18 acres 3 roods and 18.5 perches to Margaret Harriett Daley, wife of Alfred James Daley of Freemans Reach, for £2,245/2/6. The auction notice for the sale by auctioneer A J Berkelman of Windsor advertised the land as well as agricultural equipment for sale plus livestock including dairy cattle and horses but gave no details of buildings on the site.

REFERENCES	Jan Barkley-Jack, Hawkesbury Settlement Revealed, pp 182, 347
	Old System Deed, No 796 Bk G
	Old System Deed, No 158 Bk J
	Advertising; <i>The Sydney Gazette and NSW Advertiser</i> , Sunday 20 June 1805, p. 1
	Government and General Orders; <i>The Sydney Gazette and NSW Advertiser</i> , Sunday 28 January 1810, p. 1
	https://convictrecords.com.au

STATEMENT OF SIGNIFICANCE

Issue: March 2025

Barn A and Barn B at 253 Wilberforce Road, Wilberforce are of historical significance as 19th century timber framed barns that are associated with the ex-convict Matthew Lock, who first obtained the land (known as Lock's Farm) in 1794 and went on to become one of the most successful ex-convict landholders in the district, a trustee of the Phillip (Wilberforce) Common, and District Constable and then Chief Constable of the Hawkesbury. The property subsequently passed to Lock's son-in-law Thomas Maloney in the 1830s, and it remained in the hands of the Maloney family until the early 20th century. Barn A, constructed in the early 19th century, may have direct associations with Matthew Lock and his period of ownership.

Located immediately next to Wilberforce Road, both Barn A and Barn B contribute to the historical character of the agricultural lands along Freeman's Reach Road and the Hawkesbury River floodplains. In their overall form and configuration, with gabled roofs, skillions and lofts, they are both representative examples of an historic timber framed barn type found throughout the Hawkesbury City local government area.

Retaining evidence of early 19th century construction techniques including closely spaced main posts, roughly squared with adze or axe and jointed to squared beams using pegged mortice and tenon joints; steep 50° pitch roof formed of closely spaced pole rafters with shingle battens indicating an early date with wooden pegs used to join cross beams to longitudinal beams and vertical timber slabs to walls, Barn A is considered to be rare. Both slab barns, Barn A and Barn B, are of technical significance for demonstrating early to late 19th century construction methods for agricultural buildings and both have the potential to provide further information into 19th century farming methods.

ASSESSED	State
SIGNIFICANCE TYPE	
CRITERIA A)	Barn A and Barn B at No. 253 Wilberforce Road, Wilberforce are of
HISTORICAL	historical significance as evidence of the long-term agricultural use of the
	land (known as Lock's Farm) by the Lock and Maloney families. First
	established in 1794 by ex-convict Matthew (Mathias) Lock and passing to his
	son-in-law Thomas Maloney by the 1830s, the Maloney family retained
	ownership of the property until (assumed) the early 20 th century.
	Meets the criterion on a State level
CRITERIA B)	Barn A has historical associations with Matthew Lock, an ex convict who
HISTORICAL	established Lock's Farm and was one of the most successful ex-convict
ASSOCIATION	landholders in the district, a trustee of the Phillip (Wilberforce) Common, and
	District Constable and then Chief Constable of the Hawkesbury.
	Constructed at a later date, Barn B is associated with Lock's extended family,
	Thomas Maloney and his descendants.
	Meets the criterion on a State level

CDITEDIA C)	Aldress have a been detailed and have a description of the property of the pro
CRITERIA C)	Although somewhat obscured by mature trees, Barn A and Barn B are located
AESTHETIC/TECHNICAL	immediately adjacent Wilberforce Road and both make a contribution to the
	historical character of the agricultural lands along Freeman's Reach Road and
	the Hawkesbury River floodplains.
	The large, corrugated metal clad Barn A is of technical significance for
	retaining evidence of early 19th century construction techniques including
	closely spaced main posts, roughly squared with adze or axe and jointed to
	squared beams using pegged mortice and tenon joints; steep 50° pitch roof
	formed of closely spaced pole rafters with shingle battens indicating an early
	date with wooden pegs used to join cross beams to longitudinal beams and
	vertical timber slabs to walls.
	Barn B has some technical significance as a small barn or garage constructed
	in the late 19th century of round posts, adzed squared longitudinal beams,
	bush pole rafters and vertical timber slab wall cladding.
	Meets the criterion on a State level
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
CDAMEDIA E) DEGE A D CH	Meets the criterion on a Local level
CRITERIA E) RESEARCH	Barn A at 253 Wilberforce Road, Wilberforce, with skillion and lofts, has the
POTENTIAL	potential to provide further information into 19 th century farming methods
	and construction techniques for agricultural buildings of the early 19 th
	century. Meets the criterion on a State level
CDUREDIA E/ DADURY	
CRITERIA F) RARITY	Barn A at 253 Wilberforce Road, Wilberforce is considered to be rare within
	the context of the Hawkesbury City local government area, for the extent of the surviving evidence of early 19 th century construction techniques and its
	relatively high level of integrity. Barn B, being constructed in the late 19 th century is not considered to be rare.
	Meets the criterion on a State level
CRITERIA G)	Barn A and Barn B at 253 Wilberforce Road, Wilberforce are representative
REPRESENTATIVE	of the long history of agricultural development within the floodplains of the
MEI RESERVIATIVE	Hawkesbury River, which commenced in the early 19 th century and continues
	today.
	The basic forms of the barns with gabled roofs, skillions and lofts are
	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level
INTEGRITY/INTACTNESS	Barn A: High integrity and intactness
I I I I I I I I I I I I I I I I I I I	Barn B: High integrity and moderate intactness
	0 0

IMAGES



Issue: March 2025

Caption: Barn A at 253 Wilberforce Road, Wilberforce (exterior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson &

Partners Pty Ltd Date: May 2023



Caption: Barn A at 253 Wilberforce Road, Wilberforce (interior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson &

Partners Pty Ltd Date: May 2023




Issue: March 2025

Caption: Barn B at 253 Wilberforce Road, Wilberforce (exterior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson &

Partners Pty Ltd Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

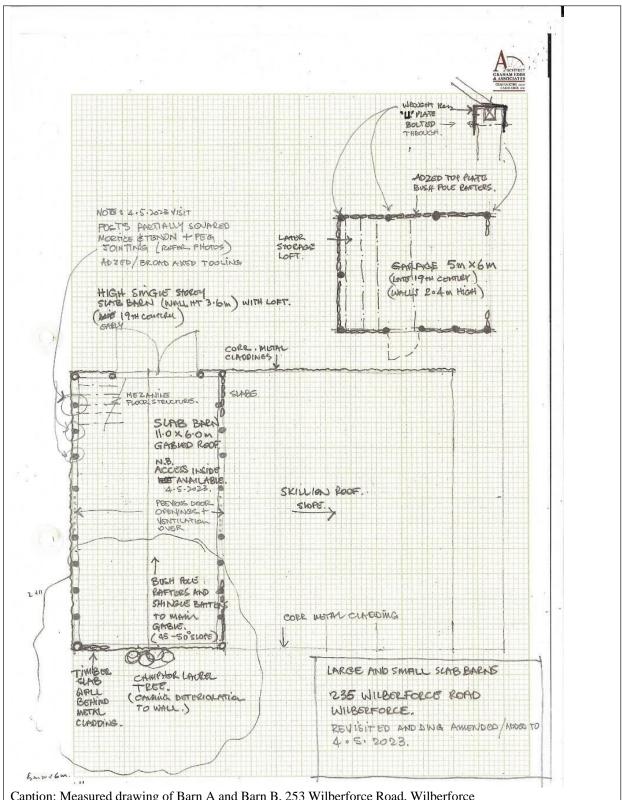

Caption: Measured drawing of Barn A and Barn B, 253 Wilberforce Road, Wilberforce

Copyright Owner: Graham Edds & Associates

Issue: March 2025

Date: May 2023

ITEM DETAILS	
NAME	Single Storey Slab Barn with Skillions
OTHER/FORMER NAMES	Cobcroft's Barn/Salter's Barn
ADDRESS	
TIDDRESS	496 Wilberforce Road, Wilberforce
LOCAL COVE ADEA	(Australiana Pioneer Village)
LOCAL GOVT AREA	Hawkesbury
PARISH	Wilberforce
LOT/DP SHI No.	Lot 22 DP 829589
	1743061
EXISTING HERITAGE ITEM?	Y (Item No. I01683 and SHR 01683)
RECOMMENDED MANAGEM	 FNT
MANAGEMENT SUMMARY	Retain as State item
WANAGEMENT SUMMAKT	Retain as Local item
ITEM CLASSIFICATION	retuin as Local tem
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Υ
PERIOD	Early 19 th century
MODIFICATION/DATES	Roof replaced mid 20 th century
CURRENT USE	Storage of machinery but barn is also an exhibit in the village.
FORMER USE	Barn
LOCATION ON SITE:	The barn is now part of the Australiana Pioneer Village complex but it is
	the only 'exhibit' located on its original site, approximately 50m east of the
	Wilberforce Road on the western boundary of the village site.
MAIN BARN STRUCTURE	A large single storey barn approximately 12 x 5.6m on plan with skillions
	on both sides making the overall plan a 12 metres square. It is supported on
	adzed square posts at close centres which are mortised and tenoned to
	longitudinal squared beams. Round pole cross beams divide the space into
	four bays and are bolted to the longitudinal beams with iron plates. There
	was once a loft as evidenced by rebates in the main posts.
	Condition: Good
NO. OF BAYS	Date: Early 19 th century Eleven
ROOF STRUCTURE	
ROOF STRUCTURE	Sawn rafters, battens and wind bracing of relatively light section size
	indicating that the roof structure has been rebuilt. The pitch however is convincingly steep at 45° indicating a faithful reconstruction.
	Condition: Good
	Date: Mid-20 th century replacement?
LOFT	N/A Removed
SKILLIONS	Skillion roofs have similar (later) construction to main barn but posts and
	beams and timber slab cladding are early. Horizontal squared timber ties are
	dovetail lap jointed to the main posts.
	Condition: Good.
	Date: Early 19th century with mid-20th century roof replacement
ROOF CLADDING:	Corrugated iron
	Condition: Moderate
	Date: Mid-20 th century?
WALL CLADDING	Vertical timber slabs to skillions, corrugated iron elsewhere.
	Condition: Moderate
ODENINGS	Date: Early 19 th to mid-20 th century.
OPENINGS	There are openings (double doors) in the northern end of both skillions and the main barn as well as single door opening at the south end.
FLOORING (GROUND)	Earth
FLOORING (GROUND) FLOORING (SKILLION)	Timber planks in northern end of eastern skillion, earth elsewhere.
FLOOKING (SKILLION)	Timoor planks in normerii end of eastern skillion, eafth eisewhere.

OTHER (Fixings?)	Mortise and tenon joints with timber pegs. Internal divisions formed by
	horizontal slabs. Gudgeon pin hinging to doors
DATING RATIONALE	Some elements are missing: (loft, skillion ties) or replaced: (roof structure)
	but the robust post and beam structure composed of closely spaced adzed or
	axed square hardwood, the use of pegged mortise and tenon joints and the
	impressive overall form of the barn indicate an early date.
HICTORY	

The barn at No. 496 Wilberforce Road, Wilberforce is located on part of a 30 acre grant (Portion 49, Parish Wilberforce), made to William MacKay in 1797. However, by the early 1800s, 6 acres 2 roods 19 perches of the property was owned by Richard William Cobcroft, probably following his marriage in 1812. Certainly, Richard Cobcroft was residing in Wilberforce in 1816, when he subscribed to contribute to the relief of the troops of the Duke of Wellington, following the Battle of Waterloo.

Richard was the son of John Cobcroft, an ex-convict who amassed a substantial amount of land throughout Wilberforce and becoming one of the Hawkesbury's most successful farmers of the early 19th century. John Cobcroft married another ex-convict Sarah Smith and together they raised a family of 10 and established a dynasty of many thousands of descendants, some of whom continue to reside in the Wilberforce locality.

Richard Cobcroft lived and worked on the property until his death in 1866. By a codicil to his will on 23 February 1866 Richard Cobcroft, devised 'the house land and premises upon which I now reside at Wilberforce' to his wife Mary Ann Cobcroft for her life and after her death the land would be divided into three equal lots. He devised lot 1 adjoining Yeoman' property and parallel with it to his daughter Emily Louisa Cobcroft; Lot 2 on which his house stood he devised to his daughter Ann Jane Hutchinson; Lot 3 to his daughter Mary Ann Eliza Cobcroft. His widow Mary Ann Cobcroft died on 28 April 1873. Emily Louisa Cobcroft married Thomas Pidgeon and subsequently died on the 26 August 1886 having made her will on 27 July 1886 appointing her husband Thomas as the devisee.

On 14 November 1905, Thomas Pidgeon of North Sydney, mercantile clerk, Ann Jane Hutchinson of Station Street, Petersham, widow and Mary Ann Eliza Cobcroft of Forest Lodge, spinster conveyed 6 acres 2 roods 19 perches part of William Mackay's grant bounded on the west by the main government road from Windsor to Wilberforce 4 chains, on the north by a fence dividing it from other property 13 chains, on the east by a fence 4 chains 62 links, on the south 8½ chains to the government road to Thomas Jerome Salter, Wilberforce, farmer for £100.

Subsequently, on 4 September 1920, Thomas Jerome Salter of Wilberforce, farmer conveyed 2 acres 3 roods 27 perches, being the northern portion of his Homestead property with a frontage of 3 chains 3 yards to Wilberforce Road, which was bounded on one side by the properties of Mrs Bowman and Mrs Gardiner 12 chains 18 yards on the rear by Humphries' property 1 chain 17 yards on the other side 'by property belonging to the said Vendor' 10 chains to the Wilberforce Road to William Salter junior, Wilberforce, farmer for £100.

By an acknowledgement under the Wills and Probate Act, on 27 August 1959 Garney Selwyn Salter and Valerie Salter, executors of the will of William Salter, Wilberforce, farmer made a devise to Garney Selwyn Salter, under the will being 2 acres 3 roods 27 perches at Wilberforce 'being the Northern portion of the Homestead property of the said Vendor having a frontage of three chains 3 yards to Wilberforce Road'. This property was later incorporated into the Australiana Pioneer Village including the barn, known as 'Salter's Barn'.

Although no evidence has been uncovered as yet as to when the barn was constructed, based on physical evidence, it is possible that it was built soon after the purchase of the land by Richard Cobcroft in c1812, making it one of a very small group of slab barns in the Hawkesbury district still surviving from the first decades of the 19th century.

REFERENCES	Will of Richard William Cobcroft, NRS 13660, Supreme Court, Probate
	Packet, Series 1 No 7394, State Archives of New South Wales 14/3411
	Old System Deed, No 259 Bk 792
	Old System Deed, No 916 Bk 1198
	Old System Deed, No 522 Bk 2498
	The Sydney Gazette and NSW Advertiser, Saturday 16 th March 1816, p. 2

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at the Australiana Pioneer Village, No. 496 Wilberforce Road, Wilberforce is of historical significance as a rare, surviving early 19th century timber framed barn of impressive size and integrity, that is associated with Richard William Cobcroft and his descendants who held the land throughout most of the 19th century. The Cobcrofts were early settlers and one of the most successful farming families in the Hawkesbury.

Visible in glimpse views from Wilberforce Road, the impressive, large barn continues to contribute to the

historical character of the locality. In its overall form and configuration, it is a representative, and notable, example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

Although some elements of the original construction of the barn are missing (loft, skillion ties) or have been replaced (roof structure), the barn is of technical significance for retaining evidence of its early 19th century construction including the robust post and beam structure composed of closely spaced adzed or axed square hardwood, and the use of pegged mortise and tenon joints.

hardwood, and the use of pegged r	nortise and tenon joints.
ASSESSED SIGNIFICANCE TYPE	State
CRITERIA A) HISTORICAL	The barn at the Australiana Pioneer Village, No. 496 Wilberforce Road, Wilberforce is of historical significance as a surviving early 19 th century timber framed barn that remains substantially intact, and as evidence of the long-term agricultural use of the land by the Cobcroft family, who held and worked the land potentially from as early as 1812 and throughout the 19 th century; and the Salter family, who held the land throughout much of the 20 th century. Meets the criterion on a State level.
CRITERIA B) HISTORICAL ASSOCIATION	The barn has historical associations with Richard William Cobcroft and his descendants, who owned the land for the majority of the 19 th century. The Cobcroft family, starting with John and Sarah, were one of the most successful farming families in the Hawkesbury region and held numerous land parcels throughout Wilberforce. Meets the criterion on a Local level.
CRITERIA C) AESTHETIC/TECHNICAL	Now forming part of the Australiana Pioneer Village, glimpse views of the barn are available from Wilberforce Road and with its impressive overall size, it continues to contribute to the historical character of the locality. Although some elements of the original construction of the bar are missing (loft, skillion ties) or have been replaced (roof structure), the barn is of technical significance for retaining evidence of its early 19 th century construction including the robust post and beam structure composed of closely spaced adzed or axed square hardwood, and the use of pegged mortise and tenon joints. Meets the criterion on a State level.
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level.
CRITERIA E) RESEARCH POTENTIAL	The form of the barn, with side skillion, its impressive size and retaining evidence of its early 19 th century construction (including the early use of Australian hardwoods), the barn at No. 496 Wilberforce Road, Wilberforce has the potential to provide further information into 19 th century farming methods. Meets the criterion on a State level.
CRITERIA F) RARITY	The barn at No. 496 Wilberforce Road, Wilberforce, being a surviving early 19 th century barn of impressive size, containing unusual wood technology of half dovetail timber jointing combined with wrought iron spikes and that remains substantially intact, with associations to a notable local family, the Cobcrofts, is considered to be very rare within the context of the Hawkesbury City local government area and the State of NSW. <i>Meets the criterion on a State level</i> .
CRITERIA G) REPRESENTATIVE INTEGRITY/INTACTNESS	The barn at No. 496 Wilberforce Road, Wilberforce is representative of the long history of agricultural development within the floodplains of the Hawkesbury River, which commenced in the early 19 th century and continues today. The basic form of the barn with gabled roof and skillion is representative of the typical form of barn found throughout the district. High to moderate

IMAGES



Caption: Barn at Australiana Pioneer Village, No. 496 Wilberforce Road, Wilberforce (exterior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: July 2023



Caption: Barn at Australiana Pioneer Village, No. 496 Wilberforce Road, Wilberforce (interior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: July 2023



Issue: March 2025


Caption: Detail of posts and beam separating main barn from skillion (note evidence of loft support), No. 496 Wilberforce Road,

Wilberforce

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: July 2023

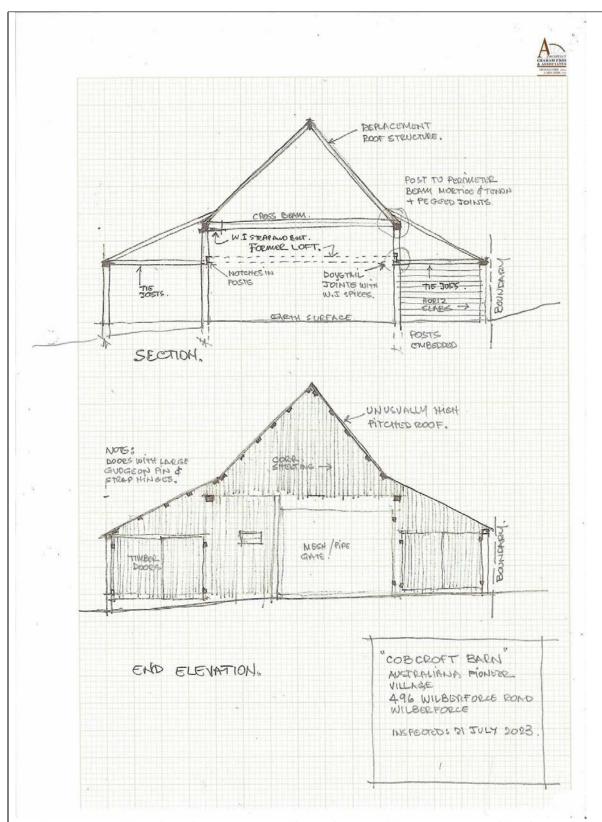

Caption: Measured drawing of Barn at Australiana Pioneer Village, No. 496 Wilberforce

Road, Wilberforce

Copyright Owner: Graham Edds & Associates

Date: July 2023

ITEM DETAILS		
NAME	Reconstructed Single Storey Slab Town Barn with Loft	
ADDRESS	2 Catherine Street, Windsor	
LOCAL GOVT AREA	Hawkesbury	
PARISH	St Matthew	
LOT/DP	Lot 371 DP 813236	
SHI No.	1743078/ 1741034	
EXISTING HERITAGE	Yes- Item I152	
ITEM		
RECOMMENDED MANAG	GEMENT	
MANAGEMENT	Not recommended for State listing	
SUMMARY	Not recommended for Local listing	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CONSTRUCTION YEAR	Reconstructed c.2008	
START & END		
MODIFICATION/DATES	c.2008	
CURRENT USE	Dwelling	
LOCATION ON SITE:	Town barn converted to secondary dwelling located immediately behind	
	single storey attached cottage.	
	No internal access.	
MAIN BARN	Treated pine posts, original cross beams (according to owner), steep roof.	
STRUCTURE	Condition: Good	
	Date: Reconstructed 2008	
NO. OF BAYS	Three	
ROOF STRUCTURE	Not inspected but approx. 45° pitch	
	Date: Reconstructed 2008	
ROOF CLADDING:	Wide pitch corrugated iron	
	Condition: Poor (rusty)	
	Date: Reconstructed 2008 using second hand sheets	
WALL CLADDING	Vertical timber slabs. Weatherboards to gables	
	Condition: Good	
	Date: Slabs old but weatherboards c2008	
OPENINGS	Two double doors and one window in front gable (recycled joinery?)	
FLOORING (GROUND)	Concrete slab	
HISTORY		

HISTORY

Issue: March 2025

No. 2 Catherine Street, Windsor is located on part of a 20 acre land grant (Portion 21, Windsor Town Plan) made to ex-convict Thomas Rickerby in 1789. Sentenced to 7 years transportation Rickerby (vars. Riccaby) arrived in 1791 aboard the *William and Ann* as part of the Third Fleet. By 1798, Rickerby had been appointed chief constable. Rickerby's property was known as Catherine Farm, named after his wife Catherine Smith, and Catherine Street is named after the property.

Catherine Farm was subsequently purchased by Maria Cope of Windsor in the early 1830s and subdivided the land.

The site of No. 2 Catherine Street was shown as vacant on the 1841 plan of Windsor.

On 17 September 1855, this allotment, part of Lot 37 of Maria Cope's subdivision with a frontage of 82 feet 6 inches to Catherine Street, was sold by William Hopkins, of Windsor, miller to John Cunningham, of Wilberforce, farmer for £150. John Cunningham died at Wilberforce on 16 December 1856. It later came into the ownership of Wellow Baldwin who died on 18 August 1869. Wellow Baldwin was the son of Henry Baldwin, an ex-convict who received a land grant at Freeman's Reach and who purchased a neighbouring farm known as Wellow Farm.

An 1871 plan of Windsor showed the footprint of two residences, now known as Numbers 2 and 4 Catherine Street, facing the street, but nothing of detail was shown on the rest of the site.

Following the death of Wellow Baldwin, the property remained in the hands of his inheritors who were Baldwin's sisters, Kate Helen Bower, Ruth Irene Baldwin and Ella Sybil Locke, all of Manly. The rents acquired from Baldwin's properties were assigned to his daughter Bona Baldwin for her lifetime. It appears that Wellow Baldwin was responsible for the construction of the house, and possibly the barn as well.

In 1932, a sale of house properties and business sites in Windsor was held under the instructions of the trustees of Wellow Baldwin's will. Amongst the properties sold was a semi-detached pair of brick houses in Catherine Street, Windsor, (Nos. 2 and 4 Catherine Street), which were purchased by Emily Cooney, licensee of the Royal Exchange Hotel, Windsor.

In 2008, the current owners obtained development consent to substantially alter the barn including an extension with concrete floor and adapt to tool shed and artists studio with bathroom.

REFERENCES	W.433a, Crown Plan
	W.1.1039, Crown Plan
	Old System Deed, No 44 Bk 40
	Old System Deed, No 587 Bk 1651
	Hawkesbury Pioneer Register, 1994, p 38
	Rickerby, Thomas (c. 1751–1818)', People Australia, National Centre of
	Biography, Australian National University,

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The reconstructed town barn at No. 2 Catherine Street is of some historical significance as forming part of the history of agricultural use of the land from the late 18th century through to the late 19th century and for its associations with ex-convict Thomas Rickerby, on whose 20 acre grant made in 1789, known as Catherine Farm, the barn is now located.

The barn forms part of a significant grouping, comprised of the aesthetically and historically significant pair of weatherboard semi-attached cottages at Nos. 2 and 4 Catherine Street, each with a slab barn located at the rear, which enhances the historic significance of the barn.

The barn at No. 2 Catherine Street, Windsor is a representative example of the adaptative reuse of an historic barn, made suitable for modern living requirements within a suburban setting and its sympathetic reconstruction is indicative of the community's appreciation of these types of historic agricultural buildings.

ASSESSED	Nil
SIGNIFICANCE TYPE	1/11
	The second of th
CRITERIA A)	The reconstructed town barn at No. 2 Catherine Street is of some historical
HISTORICAL	significance as forming part of the history of the longterm agricultural use of
	the land from the late 18 th century through to late 19 th century. As a town
	barn, the building would have been used in association with farmlands
	located outside of the town of Windsor.
	The barn forms part of a significant grouping, comprised of the aesthetically
	and historically significant pair of weatherboard semi-attached cottages at
	Nos. 2 and 4 Catherine Street, each with a slab barn located at the rear, which
	enhances the historic significance of the barn.
	Meets the criterion on a Local level
CRITERIA B)	The town barn at No. 2 Catherine Street has some historical associations with
HISTORICAL	ex convict Thomas Rickerby, who received a 20 acre grant of land in 1789,
ASSOCIATION	known as Catherine Farm, and with Wellow Baldwin who, it is assumed,
	built the original barn together with the house in the late 1860s.
	Meets the criterion on a Local level
CRITERIA C)	The town barn, located to the rear of the main dwelling, is not visible from
AESTHETIC/	the street and does not contribute to the historical character of the Catherine
TECHNICAL	Street or the locality.
	As a reconstruction, the barn utilises appropriate materials and details and
	retains (assumed) its original form and scale, although it has also been
	adapted for residential use.
	Does not meet the criterion
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
DO CHILI COLI CICILI	community and orders, come symbolic of the instory of the agricultural

	development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. The sympathetic reconstruction and adaptive reuse of historic barns is also indicative of the community's appreciation of these types of buildings. Meets the criterion on a Local level
CRITERIA E)	As a reconstruction, the town barn at No. 2 Catherine Street, Windsor has
RESEARCH	little research potential.
POTENTIAL	Does not meet the criterion
CRITERIA F) RARITY	The reconstructed and adapted town barn at No. 2 Catherine Street, Windsor is not considered to be rare within the Hawkesbury local government area. <i>Does not meet the criterion</i>
CRITERIA G)	The barn at No. 2 Catherine Street, Windsor is a representative example of
REPRESENTATIVE	the adaptative reuse and reconstruction of an historic barn, made suitable for
	modern living requirements within a suburban setting.
	Does not meet the criterion
INTEGRITY/	Moderate
INTACTNESS	

IMAGES



Caption: The town barn at No. 2 Catherine Street, Windsor. Photographer: K. Denny

Copyright Owner: Lucas Stapleton Johnson

& Partners
Date: May 2023




Issue: March 2025

Caption: The town barn at No. 2 Catherine Street, Windsor. Photographer: K. Denny

Copyright Owner: Lucas Stapleton Johnson

& Partners

Date: May 2023

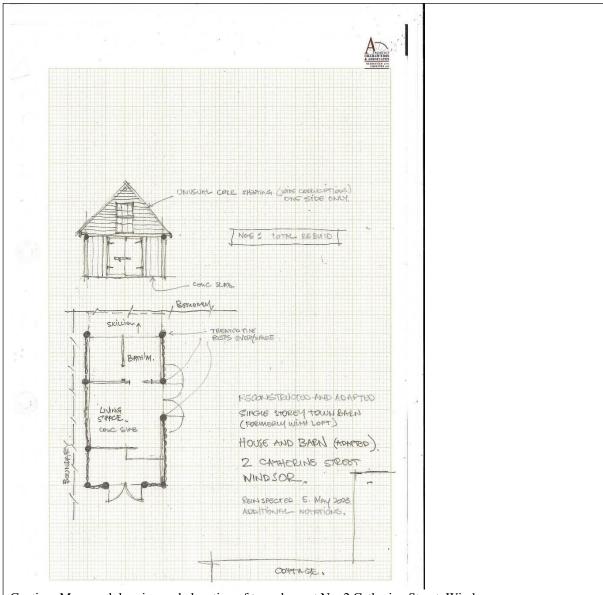

Caption: Measured drawing and elevation of town barn at No. 2 Catherine Street, Windsor

Copyright Owner: Graham Edds & Associates

Date: May 2023

ITEM DETAILS	
NAME	Single Storey Slab Town Barn with Loft
ADDRESS	4 Catherine Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 372 DP 813236
SHI No.	1743079/ 1741034
	Yes- Item I152
EXISTING HERITAGE ITEM	1 es- Item 1132
RECOMMENDED MANAGE	 MFNT
MANAGEMENT	Not recommended for State listing.
SUMMARY	Retain local listing.
ITEM CLASSIFICATION	Teetain 190ar iistiing.
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid 19 th century
CURRENT USE	Storage
FORMER USE	Town Barn
LOCATION ON SITE	Town barn located immediately behind single storey attached cottage.
MAIN BARN STRUCTURE	Single storey with loft. Size 8m x 5m. Adzed posts with loft floor beam let
WAIN BARN STRUCTURE	into posts. Eaves beam is flat section. Beams are pit sawn.
	Date: 1860s
	Condition: Moderate
NO. OF BAYS	Three bays
ROOF STRUCTURE	Pole rafters and shingle battens. Roof pitch approx. 45°.
	Date: 1860s (using earlier technique)
	Condition: Good
LOFT	Remains of loft floor joists only.
SKILLION	None
ROOF CLADDING:	Corrugated iron short sheets
Roof Chibbits.	Condition: Poor
WALL CLADDING	Vertical timber slabs to ground floor, remains of weatherboards to loft walls
	and gables.
	Corrugated iron over weatherboards to loft walls
	Date: 1860s (using earlier technique)
	Condition: Poor
OPENINGS	Door frame in loft gable
FLOORING (GROUND)	Concrete slab
FLOORING (FIRST)	N/A
FLOORING (LOFT)	None
FLOORING (SKILLION)	N/A
INTERNAL STRUCTURE	N/A
OTHER (Fixings?)	Hand forged iron connection plates
HISTORY	

No. 4 Catherine Street, Windsor is located on part of a 20 acre land grant (Portion 21, Windsor Town Plan) made to ex-convict Thomas Rickerby in 1789. Sentenced to 7 years transportation Rickerby (vars. Riccaby) arrived in 1791 aboard the *William and Ann* as part of the Third Fleet. By 1798, Rickerby had been appointed

chief constable. Rickerby's property was known as Catherine Farm, named after his wife Catherine Smith, and Catherine Street is named after the property.

Catherine Farm was subsequently purchased by Maria Cope of Windsor in the early 1830s and she subdivided the land for residential development

The site of No. 4 Catherine Street was shown as vacant on the 1841 plan of Windsor.

On 17 September 1855, this allotment, part of Lot 37 of Maria Cope's subdivision with a frontage of 82 feet 6 inches to Catherine Street, was sold by William Hopkins, of Windsor, miller to John Cunningham, of Wilberforce, farmer for £150. John Cunningham died at Wilberforce on 16 December 1856. It later came into the ownership of Wellow Baldwin who died on 18 August 1869. Wellow Baldwin was the son of Henry Baldwin, an ex-convict who received a land grant at Freeman's Reach known as Baldwin Farm, and who purchased a neighbouring farm known as Wellow Farm. The Baldwin family were extensive land holders, successful farmers and breeders of racehorses.

An 1871 plan of Windsor showed the footprint of two residences, now known as Numbers 2 and 4 Catherine Street, facing the street, but nothing of detail was shown on the rest of the site.

Following the death of Wellow Baldwin, the property remained in the hands of his inheritors who were Baldwin's sisters, Kate Helen Bower, Ruth Irene Baldwin and Ella Sybil Locke, all of Manly. The rents acquired from Baldwin's properties were assigned to his daughter Bona Baldwin for her lifetime. It appears that Wellow Baldwin was responsible for the construction of the houses at 2 and 4 Catherine Street, and possibly the barn as well in the 1860s. It is noted however that the existence of shingle battens to the barn indicates a pre-1850s construction date.

In 1932, a sale of house properties and business sites in Windsor was held under the instructions of the trustees of Wellow Baldwin's will. Amongst the properties sold was a semi-detached pair of brick houses in Catherine Street, Windsor (Nos. 2 and 4 Catherine Street), which were purchased by Emily Cooney, licensee of the Royal Exchange Hotel, Windsor.

i i jii ji	
REFERENCES	W.433a, Crown Plan
	W.1.1039, Crown Plan
	Old System Deed, No 44 Bk 40
	Old System Deed, No 587 Bk 1651
	Hawkesbury Pioneer Register, 1994, p 38
	Rickerby, Thomas (c. 1751–1818)', People Australia, National Centre of
	Biography, Australian National University

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 4 Catherine Street, Windsor is of historical significance as a surviving mid 19th century timber framed barn located on land that is associated with ex convict Thomas Rickerby, who received a 20 acre grant of land in 1789, known as Catherine Farm. The barn is located on part of a later of subdivision that is associated with Wellow Baldwin, descendant of Henry Baldwin a notable local landholder and farmer. It appears Wellow Baldwin built the pair of cottages at Nos. 2 and 4 Catherine Street and it is assumed the barn in the 1860s.

As a town barn, the building would have been used in association with farmlands located outside of the town of Windsor, emphasising the continued importance of agriculture in the district well into the 20th century. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

The barn forms part of a significant grouping, comprised of the aesthetically and historically significant pair of semi-attached cottages at Nos. 2 and 4 Catherine Street, each with a slab barn located at the rear, which enhances the historic significance of the barn.

The single storey barn is of technical significance for retaining evidence of its mid 19th century construction date including the remains of a loft, adzed posts with loft floor beam let into posts, pit sawn beams, pole rafters and shingle battens, vertical timber slabs to ground floor and remains of weatherboards to loft walls and gables, and hand forged iron connection plates. The barn continues to have the potential to provide further information into late 19th century farming methods, the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21st century.

ASSESSED	State
SIGNIFICANCE TYPE	

	T
CRITERIA A) HISTORICAL CRITERIA B) HISTORICAL ASSOCIATION	The barn at No. 4 Catherine Street, Windsor is of historical significance as a surviving mid 19 th century town barn that forms part of a group comprised of the aesthetically and historically significant pair of semi-attached cottages at Nos. 2 and 4 Catherine Street, each with a slab barn located at the rear, which enhances the historic significance of the barn. As a town barn, the building would have been used in association with farm lands located outside of the town of Windsor, emphasising the continued importance of agriculture in the district well into the 20 th century. Meets the criterion on a Local level The town barn at No. 4 Catherine Street, Windsor has some historical associations with ex-convict Thomas Rickerby, who received a 20 acre grant of land in 1789, known as Catherine Farm, on which the barn is now located on a later subdivision; and with Wellow Baldwin, descendant of
	Henry Baldwin a notable local landholder and farmer, who appears to have built the dwelling and it is assumed the barn in the 1860s. Meets the criterion on a Local level
CRITERIA C) AESTHETIC/TECHNICAL	Located at the rear of the main residence, the barn is not visible from the street and makes no contribution to the historical character of Catherine Street. The single storey barn is of technical significance for retaining evidence of its mid 19 th century construction date including the remains of a loft, adzed posts with loft floor beam let into posts, pit sawn beams, pole rafters and shingle battens, vertical timber slabs to ground floor and remains of weatherboards to loft walls and gables, and hand forged iron connection plates. Although documentary evidence suggests the barn was constructed in the 1860s, construction techniques used suggest an earlier date (pre 1850s). Meets the criterion on a Local level
CRITERIA D) SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level
CRITERIA E) RESEARCH POTENTIAL	The barn No. 4 Catherine Street, Windsor, has the potential to provide further information into mid 19 th century farming methods and the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21 st century. <i>Meets the criterion on a Local level</i>
CRITERIA F) RARITY	The barn at No. 4 Catherine Street, Windsor is rare within the context of the Hawkesbury City local government area, as a surviving mid 19 th century town barn that remains relatively intact. Meets the criterion on a State level
CRITERIA G) REPRESENTATIVE	The barn at No. 4 Catherine Street, Windsor is representative of the long history of agricultural development within the Hawkesbury area, which commenced in the late 18 th century and continues today. The basic form of the barn with gabled roof, remains of a loft and vertical timber slab wall cladding is representative of the typical form of barn found throughout the district. <i>Meets the criterion on a Local level</i>
INTEGRITY/ INTACTNESS	Moderate

IMAGES



Caption: The town barn at No. 4 Catherine Street, Windsor

(exterior).

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023



Caption: The town barn at No. 4 Catherine Street, Windsor

(exterior).

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023



Issue: March 2025

Caption: The town barn at No. 4 Catherine Street, Windsor

(interior).

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023




Caption: The town barn at No. 4 Catherine Street, Windsor

(interior detail). Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023

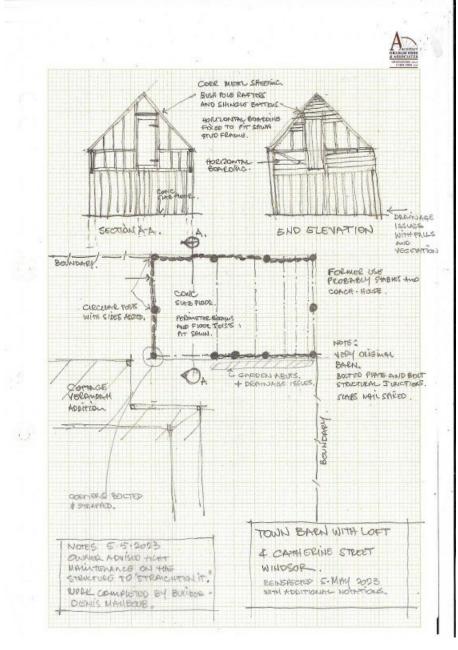

Issue: March 2025

Caption: Measured drawing and elevations of town barn at No. 4 Catherine Street, Windsor Copyright Owner: Graham Edds & Associates Date: May 2023

ITEM DETAILS	
NAME	Slab Milking Shed/Stables and Animal Shelter
FORMER NAMES	Trevallyn
ADDRESS	10 Day Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 50 DP 1137999
SHI No.	1743077
EXISTING HERITAGE	Yes- Item I158
ITEM	Yes- Item 1138
RECOMMENDED MANAG	EMENT
MANAGEMENT	Not recommended for State listing.
SUMMARY	Retain local heritage listing.
SCHWART	Whole property potentially worth considering for State heritage listing
	including house.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Milking shed and stables/ Animal shelter
DESCRIPTION	8
CIRCA	Y
PERIOD	Mid-late 19 th century with later alterations and additions
CURRENT USE	Animal shelter and hay store
FORMER USE	Milking shed and stables/ animal shelter
LOCATION ON SITE	Trevallyn is a farm complex consisting of the farmhouse and a series of
	outbuildings including four small timber framed buildings located well away
	from the house. There is no barn but a milking shed/ stables approximately
	100m east of the house and three small square sheds to the south of the house,
	one of which appears to be an early slab building.
DESCRIPTION: MILKING	SHED/ STABLES
MAIN STRUCTURE	There is a central spine of round posts and beams with vertical timber slab
	cladding under the ridge of the shallow pitched roof. The beam is flattened on
	two sides and held down with wire. On the north side of the spine are four
	milking bails and on the south is an open sided shelter or stable. Most the
	outer posts are of modern sawn timber but one original round post remains at
	the NE corner.
NO. OF BAYS	Six bay central spine
ROOF STRUCTURE	Sawn rafters over stable and bush poles over milking bails indicating that the
T OPPR	latter is the older structure.
LOFT	N/A
SKILLION	N/A
ROOF CLADDING:	Corrugated iron
WALL CLADDING OPENINGS	Vertical timber slabs.
	Open sided both sides
FLOORING (GROUND)	Brick paving in part, earthen elsewhere
FLOORING (FIRST) FLOORING (LOFT)	N/A N/A
FLOORING (LOF1) FLOORING (SKILLION)	N/A N/A
INTERNAL STRUCTURE	Timber milking bails and troughs.
CURRENT USE	Animal shelter
CHANGES FROM 2010?	Deterioration Deterioration
CONDITION	Poor
DESCRIPTION: TIMBER S	
MAIN STRUCTURE	
WIAIN STRUCTURE	Small 5m square shed or animal shelter with round corner posts and 3 sides clad in vertical timber slabs.
	Ciad in vertical tillioci statis.

NO. OF BAYS	One
ROOF STRUCTURE	Large diameter pole rafters at 35 degree pitch on adzed square beams.
	Roofing battens suitable for corrugated iron.
LOFT	N/A
SKILLION	N/A
ROOF CLADDING:	Corrugated iron rusty.
WALL CLADDING	Vertical timber slabs, gable clad in corrugated iron (probably originally weatherboards)
OPENINGS	One side is open
FLOORING (GROUND)	Earthen
FLOORING (FIRST)	N/A
FLOORING (LOFT)	N/A
FLOORING (SKILLION)	N/A
INTERNAL	N/A
STRUCTURE	
OTHER (Fixings?)	-
CURRENT USE	Hay store
CHANGES FROM 2010?	Deterioration – the building has developed a slight lean.
HISTORY	

No. 10 Day Street Windsor forms part of a grant of 50 acres made to Thomas Westmore and William Anderson on 1 June 1797 to be known as Marsden Farm in the district of Mulgrave Place, bounded on the south by Lewis farm. Westmore and Anderson were soldiers in the New South Wales Corps.

The land had been purchased by Samuel Marsden, assistant to the chaplain of New South Wales, farmer and substantial landowner in the Parramatta district. The transfer may have occurred prior to the registration of the grant which accounts for the fact it was recorded in the grant register as 'Marsden Farm'. A barn was shown on this land as well as Samuel Marsden's house then occupied by Thomas Tebbutt in the flood panorama painting of 1816 (although no barn survives at the property today).

On 30 November 1857, the land was conveyed in a sale with the following parties 1st George Campbell, Duntroon, esquire, 2nd Charles Simeon Marsden, esquire and his wife, Elizabeth 3rd Richard Ridge, Windsor, innkeeper (purchaser). The land had been granted to Westmore and Anderson but was then described as 60 acres. The transaction was for a payment of £200 to Elizabeth Marsden and £2,200 to George Campbell. Richard Ridge lived on the land where he built a residence known as Trevallyn. Ridge was an active member of the Hawkesbury community being one of the commissioners for the Windsor Road Trust, vice-president and member of the committee of the Hawkesbury Benevolent Asylum, Trustee of St. Matthew's Church, and councillor for the Borough of Windsor.

By a conveyance of 23 June 1886, Richard Ridge, of Windsor, esquire conveyed the land to William Hessel Dean, of Windsor, draper. The sale was for Westmore and Anderson's grant described as 60 acres plus another parcel of land in Macquarie Street measuring 2 acres 1 rood 34 perches. The sale price was £5,500.

William H. Dean had been a mayor of Windsor Council on 12 occasions and ran Trevallyn as a thoroughbred stud and dairy. Following W H Dean's death in 1931, the land remained in the hands of the Dean family for many years.

REFERENCES	Grants, Vol 2 No 149
	Jan Barkley-Jack, Hawkesbury Settlement Revealed, pp 67, 149-50, 259, 335, 337-
	8
	Old System Deeds, No 903 Bk 52 and No 326 Bk 341
	Windsor and Richmond Gazette, 4 June 1892, p 5
	Windsor and Richmond Gazette, Saturday 23 July 1898, p. 4
	"A Gazette Feature: Homes of the Hawkesbury- Trevallyn, A Georgian Style
	Home"; Windsor and Richmond Gazette, Wednesday 14 October 1964, p. 20

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The slab outbuildings at Trevallyn, No. 10 Day Street, Windsor are of historical significance as surviving mid to late 19th century agricultural outbuildings forming part of a farmstead, associated with former mayor Richard Ridge who named the property Trevallyn and subsequent owner William Hessel Dean, also a former Mayor of Windsor Council, who ran the property as a thoroughbred stud and dairy and whose family retained the property for a number of generations.

Together with the early Victorian house, the complex of outbuildings sited on the flood plains of South Creek, make a strong contribution to the historical character of the agricultural lands of the Windsor locality, with expansive views of the whole of the property available from Hawkesbury Valley Way.

The milking shed/stables is considered to be rare for its unusual configuration and surviving 19th construction techniques including the central spine of round posts and beams with vertical timber slab cladding under the ridge of the shallow pitched roof, with timber milking bails and troughs on the north side and an open sided shelter or stable on the south side. Sawn rafters over the stable and bush poles over milking bails indicating that the latter is the older structure.

As timber slab agricultural outbuildings that continue in use today, both the milking shed/stables and animal shelter/hay shed are of technical significance for demonstrating mid to late 19th century construction methods and are representative examples of historic timber agricultural outbuildings found through the Hawkesbury City local government area.

city local government area.	
ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A) HISTORICAL	The slab outbuildings (milking shed/stables and hay shed) at Trevallyn, No. 10 Day Street, Windsor are of historical significance as evidence of the long-term agricultural use of the land since at least 1797. Originally owned by Samuel Marsden and known as Marsden Farm, the land was granted to two soldiers of the NSW Corps, Thomas Westmore and William Anderson. By the mid 1800s the property was held by former Mayor, Richard Ridge who built the house and renamed the property Trevallyn. Dating from the mid to late 19 th century, the large milking shed/stables appears to be associated with William Hessel Dean, also a former Mayor of Windsor Council, who ran the property as a thoroughbred stud and dairy and whose family retained the property for a number of generations. <i>Meets the criterion on a Local level</i>
CRITERIA B)	The slab outbuildings have historical associations with William Hessel Dean,
HISTORICAL	former Mayor of Windsor Council, who operated Trevallyn as a successful
ASSOCIATION	thoroughbred stud and dairy and whose family retained the property for a
	number of generations. Meets the criterion on a Local level
CRITERIA C)	Associated with an early Victorian house and sited on the floodplains of
AESTHETIC/	South Creek, the group of slab outbuildings make a strong contribution to the
TECHNICAL	historical character of the locality. Expansive views of the property are
	available from Hawkesbury Valley Way.
CDETERIA D	The milking shed/stables is of technical significance for demonstrating mid to late 19 th century construction methods for agricultural buildings. Constructed with a central spine of round posts and beams with vertical timber slab cladding under the ridge of the shallow pitched roof, on the north side of the spine are four milking bails and on the south is an open sided shelter or stable. One original round post remains at the NE corner. Sawn rafters over the stable and bush poles over milking bails indicating that the latter is the older structure. The milking shed retains timber milking bails and troughs and evidence remains of brick paved flooring. The small animal shelter, clad on three side in vertical timber slabs with large pole rafters on adzed square beams with roof battens suitable for corrugated iron, is of aesthetic interest as being part of a farming complex and of some technical significance for demonstrating mid to late 19 th century construction methods for simple agricultural outbuildings. <i>Meets the criterion on a State level</i>
CRITERIA D) SOCIAL/CULTURAL	The historic slab barns and outbuildings of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated with these building types. Meets the criterion on a Local level

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

CRITERIA E) RESEARCH	The milking shed/stables at No. 10 Day Street, Windsor retains evidence of mid to late 19 th century construction techniques and its unusual configuration
POTENTIAL	combined with the notable history of the property makes the place of high
	potential to provide further information into 19 th century farming methods. <i>Meets the criterion on a Local level</i>
CRITERIA F) RARITY	The milking shed/stables at No. 10 Day Street, Windsor are considered to be rare within the context of the Hawkesbury City local government area for its unusual configuration and surviving timber troughs and milking bails. <i>Meets the criterion on a Local level</i>
CRITERIA G) REPRESENTATIVE	The milking shed/stables and small timber slab outbuilding/hay shed at No. 10 Day Street, Windsor are representative of the long history of agricultural development within the floodplains of the Hawkesbury River and South Creek, which commenced in the early 19 th century and continues today. The small outbuilding/hay shed with gabled roof, and timber slab wall cladding to three side is representative of the typical form of animal shelter/shed found throughout the district. <i>Meets the criterion on a Local level</i>
INTEGRITY/ INTACTNESS	Moderate
LITACITIESS	

IMAGES



Caption: Aerial photograph of Trevallyn, No. 10 Day Street, Windsor showing the location of the milking shed/stables and timber slab hay shed/animal shelter.

Source: NSW Spatial Services SixMaps Date: May 2023



Caption: Milking shed/stables at No. 10 Day Street, Windsor (exterior of stables) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: May 2023



Caption: Milking shed/stables at No. 10 Day Street, Windsor (interior- stables) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: May 2023



Issue: March 2025

Caption: Milking shed/stables at No. 10 Day Street, Windsor (interior- milking shed with troughs)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: May 2023



Caption: Timber milk bail in milking shed/stables at No. 10 Day Street, Windsor Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: May 2023




Caption: Timber slab animal shelter/hay shed at No. 10 Day Street, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: May 2023



Issue: March 2025


Caption: Timber slab animal shelter/hay shed at No. 10 Day Street, Windsor (interior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: May 2023

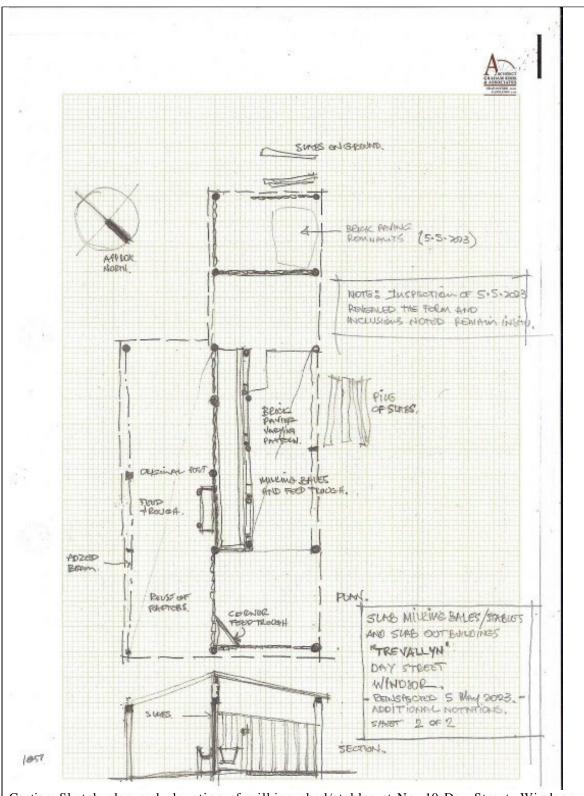

Caption: Sketch plan and elevation of milking shed/stables at No. 10 Day Street, Windsor Copyright Owner: Graham Edds & Associates

Date: May 2023

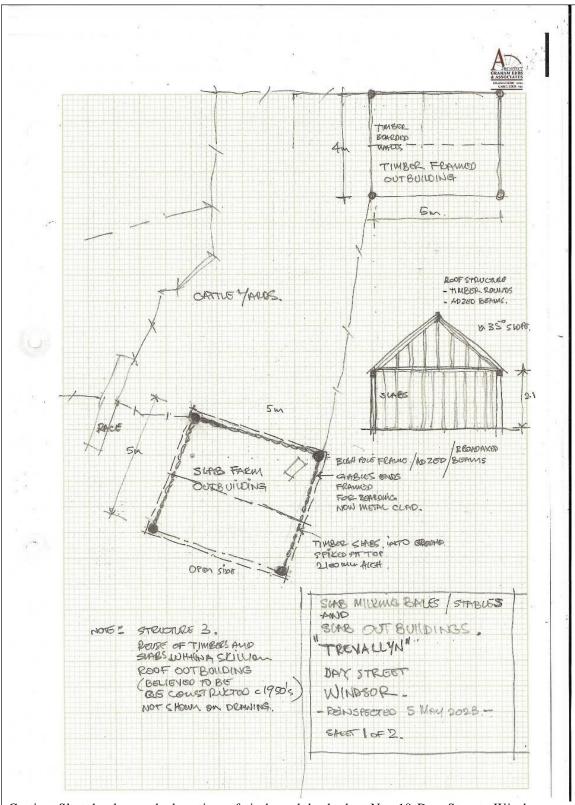

Caption: Sketch plan and elevation of timber slab shed at No. 10 Day Street, Windsor

Copyright Owner: Graham Edds & Associates

Date: May 2023

ITEM DETAILS	ITEM DETAILS	
NAME	Reconstructed and Adapted Two Storey Slab Barn	
OTHER/FORMER NAMES	Hannabas Dairy	
ADDRESS	23A George Street, Windsor	
LOCAL GOVT AREA	Hawkesbury	
PARISH	St Matthew	
LOT/DP	Lot 25 DP 1086733	
SHI No.	1743083	
EXISTING HERITAGE ITEM?	Included in listing with Hannabas Dairy, 26 George Street (I166)	
RECOMMENDED MANAGEMENT		
MANAGEMENT	Not recommended for State or local listing	
SUMMARY	· ·	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	Y	
PERIOD	Late 19 th century?	
MODIFICATION/DATES	Late 20 th and early 21 st century	
CURRENT USE	Entertainment area	
FORMER USE	Barn/Dairy	

2023 inspection revealed no changes had occurred. The following description is from the 2010 Hawkesbury Slab Barns Study by Graham Edds & Associates.

A large two storey barn with skillions and open verandah at front (north) that has been extensively adapted during the present and previous ownership to the extent that only the large form of the barn is discernible. The claddings externally are mainly corrugated metal and the interior has been fitted out as living space. The owners advised that the timber structure had been seriously affected by termites and a great deal of the structure has been replaced, some utilising second hand materials again making interpretation difficult. Structure: The post structure is generally covered with wall linings and not able to be described except at the very top of the posts and roof. The existing posts are bush poles and connected to the rectangular beams with bolted metal plates transitioning to a bent threaded rod and bolted. The roof frame is also constructed using thin bush poles at wide spacings for corrugated metal claddings. Although the roof sheeting has been renewed the earlier roof cladding and structure is partially exposed to view from the underside. It is understood that the new roof was constructed above the old retaining it insitu.

The western side skillion has not been lined and provides the best indication of the skillion structure and has insitu some remnant timber slabs. The white lime wash colouring on some of the round timbers that form the wall structure indicate that they were potentially associated with the cleaner areas of the barn and possibly associated with the dairy.

HISTORY

Issue: March 2025

Lots 5, 6, 7, 8 and 9 of Wilcox Farm measuring 2 acres 3 roods, bounded on the south by George Street, on the east by Palmer Street and on the north by the River Hawkesbury were conveyed by Frederick Campbell, of Queanbeyan, Esquire, and Ross Watt, esquire of Melbourne, trustees of the will of Charles Campbell to George Dickson of Windsor, storekeeper for £270 on 16 April 1890.

Dickson conducted an extensive produce store business and added dairy farming to his interests in the 1890s. His daughter, Jane, married Albert Hannabus who lived on the Peninsula. George Dickson died on 20 April 1897 after he was thrown from his horse. Dickson's property was auctioned on 29 September 1897. The second item offered in the auction was lots 4, 5, 6, 7, 8, 9, with frontages to George and Palmer Streets, together with 'large barn, corn-sheds dairy, and Cottage', then occupied by John Dickson. The purchaser was his daughter, 'Mrs A Hannabus'.

Lots 5 to 9 were conveyed to Jane Hannabus for £480. This property has been known for many years as Hannabus dairy. After her death, the property was partitioned between various members of the family on 26 May 1936. Lots 5 to 9 were later subdivided in 1962 creating the current parcel of land on which the barn stands.

REFERENCES Old System Deed, No 804 Bk 436

Old System Deed, No 898 Bk 608 Old System Deed, No 347 Bk 2613

Windsor and Richmond Gazette, 24 April 1897, p 7; 25 September 1897, p 8; 2 October 1897, p 12; 12 June 1931, p 3

STATEMENT OF SIGNIFICANCE

SUMMARY STATEMENT OF SIGNFICANCE

The barn/former dairy has been extensively modified and adapted making interpretation difficult and no longer resembles a dairy. The scale of the building provides a reminder of the types of rural structures that were on the periphery of the towns.

INTEGRITY/INTACTNESS Extensively modified and adapted.

IMAGES



Caption: Barn at 23A George Street,

Windsor (exterior) Photographer: LSJ

Copyright Owner: Lucas Stapleton Johnson &

Partners Pty Ltd Date: May 2023



Issue: March 2025

Caption: Caption: Barn at 23A George


Street, Windsor (interior)

Photographer: LSJ

Copyright Owner: Lucas Stapleton Johnson &

Partners Pty Ltd Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

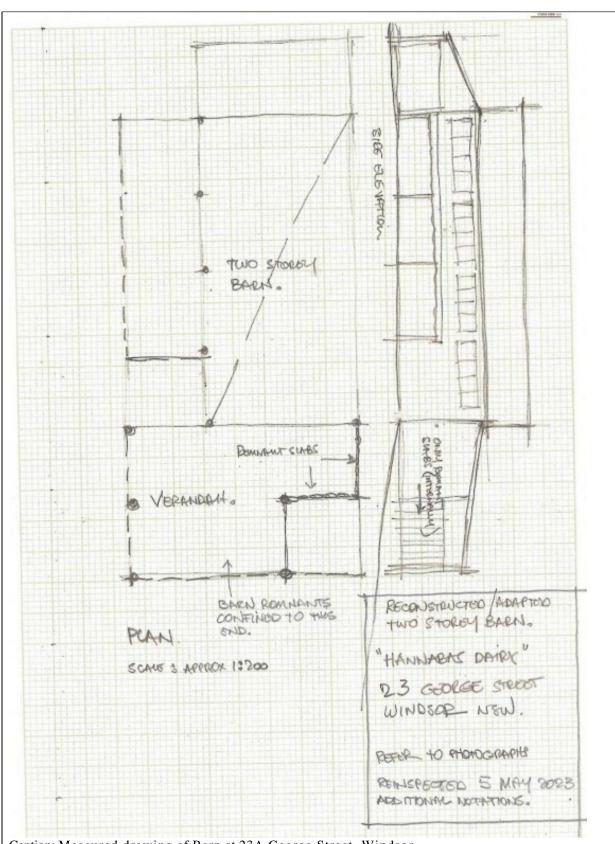

Caption: Measured drawing of Barn at 23A George Street, Windsor.

Copyright Owner: Graham Edds & Associates

Date: May 2023

ITEM DETAILS	
NAME	Compley of Clab Dorne
	Complex of Slab Barns
OTHER/FORMER NAMES	Tara
ADDRESS	31 George Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 3 DP 1119195
SHI No.	1743085
EXISTING HERITAGE	Y- Item I167 (SHI 1741342)
ITEM?	
RECOMMENDED MANAGE	MENT
MANAGEMENT	Not recommended for State listing
SUMMARY	Retain as Local item- update inventory sheet.
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Late 19 th century
MODIFICATION/DATES	20 th century
CURRENT USE	Artists studio, storage, guest accommodation
FORMER USE	Barn/Corn drying shed
LOCATION ON SITE:	The barn is located alongside the side boundary behind a stucco and cast
	iron Victorian villa approximately 40m from the street and 60m from the
	riverfront.
MAIN BARN STRUCTURE	A two-storey town barn adapted for use as an artist's studio. It is
	approximately 12.5 x 4.8m on plan and is supported on full height round
	posts with round cross beams at eaves level.
	Condition: Good
	Date: Late 1880s
NO. OF BAYS	Four
ROOF STRUCTURE	Roof is lined with beaded boards.
	Condition: Good
	D . 1000 0
	Date: 1880s?
FIRST FLOOR	Date: 1880s? Minimum height internally is 2.15m. Posts and external cladding are
FIRST FLOOR	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined.
FIRST FLOOR	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good
	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990
FIRST FLOOR ROOF CLADDING:	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel
	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate
	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel
ROOF CLADDING:	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown
	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate
ROOF CLADDING:	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs.
ROOF CLADDING:	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate
ROOF CLADDING: WALL CLADDING	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown
ROOF CLADDING: WALL CLADDING OPENINGS	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown Two large double door openings on ground floor. Recent windows to studio.
ROOF CLADDING: WALL CLADDING	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown Two large double door openings on ground floor. Recent windows to
ROOF CLADDING: WALL CLADDING OPENINGS	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown Two large double door openings on ground floor. Recent windows to studio.
ROOF CLADDING: WALL CLADDING OPENINGS FLOORING (GROUND) FLOORING (LOFT)	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown Two large double door openings on ground floor. Recent windows to studio. Concrete slab Timber boarding
ROOF CLADDING: WALL CLADDING OPENINGS FLOORING (GROUND)	Minimum height internally is 2.15m. Posts and external cladding are expressed inside but roof is lined. Condition: Good Date: Converted to studio post 1990 Corrugated steel Condition: Moderate Date: Unknown Corrugated steel short sheets, some remnant vertical timber slabs. Condition: Moderate Date: Slabs 1880s, iron unknown Two large double door openings on ground floor. Recent windows to studio. Concrete slab

The complex of barns at No. 31 George Street, Windsor are located on part of a 30 acre grant (Portion 25, Parish St Matthew) made to ex-convict Samuel Wilcox in 1794. By the early 19th century, Wilcox's land had been incorporated into a larger holding of 1500 acres known as Peninsula Farm, which was eventually

subdivided in the 1840s primarily for residential development.

A plan entitled "Allotments comprising the Penisula farm [sic]", dated 1842 by Mr. Laban White, shows Lot 3 as vacant.

By the late 1800s, the property was owned by John James Fitzpatrick, Senior Sergeant of Police and Sub-Inspector of Police at Windsor, and following his retirement in 1893, Alderman of the Borough of Windsor. Fitzpatrick's son, John Charles Lucas Fitzpatrick commenced publication of The Windsor and Richmond Gazette (now Hawkesbury Gazette) in 1888.

Fitzpatrick died in 1899 and the property remained in the Fitzpatrick family until 1905 when it was purchased by George John Gardner.

In 1912 the home was sold to Hilton Stanley Johnston a descendant of Andrew Johnston of Ebenezer and remained with the Johnston family until the 1990s when it was purchased by acclaimed local artist Greg Hansell.

REFERENCES	"Allotments comprising the Penisula farm [sic]", dated 1842 by Mr. Laban
	White, J. Armstrong Surveyor, NLA Map F 187
	Discover the Hawkesbury B. WINDSOR HERITAGE WALK – THE
	PENINSULA PRECINCT
	Windsor and Richmond Gazette, Saturday 9th December 1893, p. 5
	https://www.hawkesbury.org/name/tara-windsor.html

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 31 George Street, Windsor is of historical significance as a surviving late 19th century timber framed barn that is associated with John James Fitzgerald, Senior Sergeant and Sub Inspector of Police at Windsor and Alderman of the Borough of Windsor, appears to have built the dwelling and it is assumed the barn and outbuildings.

As a town barn, the building would have been used in association with farmlands located outside of the town of Windsor, emphasising the continued importance of agriculture in the district well into the 20th century. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

The two storey barn with adjacent elevated corn drying shed and timber hoist is of technical significance for retaining evidence of its late 19th century construction date and it continues to have the potential to provide further information into late 19th century farming methods, the relationship between the town barn and other agricultural lands, as well as the continuity of use of historic agricultural buildings into the 21st century.

ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A) HISTORICAL	The town barn at No. 31 George Street, Windsor is of historical significance as a surviving late 19 th century barn that provides evidence of the long-term agricultural use of the land from the late 18 th century through to the mid to late 19 th century prior to its residential development. Located on the edge of the town of Windsor on a suburban allotment, the building would have been used in association with farm lands located outside of the town, emphasising the continued importance of agriculture in the district well into the 20 th century. Meets the criterion on a Local level.
CRITERIA B)	The town barn at No. 31 George Street, Windsor has historical associations
HISTORICAL	with John James Fitzpatick, Senior Sergeant and Sub-Inspector of Police at
ASSOCIATION	Windsor and later Alderman of the Borough of Windsor, who it appears
	built the main house Tara and the collection of outbuildings at the rear in
	the late 19th century. Although not well known today, in his time,
	Fitzpatrick was a highly regarded member of the Windsor community.
	Meets the criterion on a Local level.
CRITERIA C)	Located at the rear of the main residence, the barn and outbuildings are not
AESTHETIC/TECHNICAL	clearly visible from the street and make little contribution to the historical
	character of George Street.
	The two-storey town barn adapted for use as an artist's studio is of technical
	significance for retaining evidence of its late 19 th century construction date
	and evidence of its former agricultural use including full height round posts with round cross beams at eaves level, attached elevated corn drying shed

	and timber hoist.
	Meets the criterion on a Local level.
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets the criterion on a Local level.
CRITERIA E) RESEARCH	
1	The barn No. 31 George Street, Windsor, has the potential to provide
POTENTIAL	further information into late 19 th century farming methods and the
	relationship between the town barn and other agricultural lands, as well as
	the continuity of use of historic agricultural buildings into the 21st century.
	Meets the criterion on a Local level.
CRITERIA F) RARITY	The barn at No. 31 George, Windsor is potentially rare within the context of
	the Hawkesbury City local government area, as a surviving late 19 th century
	town barn.
	Meets the criterion on a Local level.
CRITERIA G)	The barn at No. 31 George Street, Windsor is representative of the long
REPRESENTATIVE	history of agricultural development within the Hawkesbury area, which
	commenced in the late 18 th century and continues today.
	The basic form of the barn with gabled roof, loft and slab wall cladding is
	representative of the typical form of barn found throughout the district.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	Moderate

IMAGES



Caption: Barn at 31 George Street, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023



Issue: March 2025


George Street, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023

Caption: Barn at 31



Caption: Studio space within barn at 31 George Street, Windsor (interior) Photographer: S. Johnson

Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: June 2023

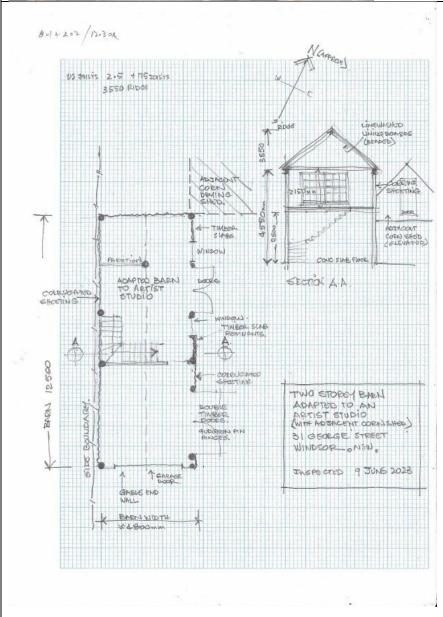

Issue: March 2025

Caption: Measured drawing of barn at No. 31 George, Windsor

Copyright Owner: Graham Edds & Associates Date: June 2023

ITEM DETAILS	ITEM DETAILS	
NAME	Reconstructed Slab Outbuilding with Loft	
ADDRESS	35 George Street, Windsor	
LOCAL GOVT AREA	Hawkesbury	
PARISH	St Matthew	
LOT/DP	Lot 2 DP 770964	
SHI No.	1743082	
EXISTING HERITAGE	Y- I170 (SHI 1741342)	
ITEM?	, , , , , , , , , , , , , , , , , , , ,	
RECOMMENDED MANAGE	MENT	
MANAGEMENT	Not recommended for State listing	
SUMMARY	Retain as local item	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Outbuilding	
DESCRIPTION		
PERIOD	Late 20th century	
CURRENT USE	Guest room/office	
LOCATION ON SITE	In back garden behind historic house.	
MAIN BARN STRUCTURE	Single-storey slab outbuilding with loft & dormer window, built using	
	salvaged materials to resemble an historical town barn. In use as guest	
	house/office	
	Date: Late-20 th century	
	Condition: Good	
NO. OF BAYS	N/A	
ROOF STRUCTURE	?	
LOFT	Fully lined, enough room to stand up only in middle.	
SKILLION	Wrap around verandah	
	Condition: Moderate	
ROOF CLADDING:	Corrugated iron short sheets	
	Date: ?	
Will Charles	Condition: Moderate	
WALL CLADDING	Vertical timber slabs to ground floor, corrugated steel to loft walls.	
	Date: Mid 19 th century	
ODENINGS	Condition: Poor	
OPENINGS EL CORING (CROUND)	Recycled six-pane sash windows.	
FLOORING (GROUND)	Concrete slab	
FLOORING (LOFT)	Timber butt jointed boarding	
	Date: Mid 19 th century Condition: Poor	
FLOORING (SKILLION)	Concrete slab	
INTERNAL STRUCTURE	N/A	
OTHER (Fixings?)	Built by local builder- using salvaged materials	
HISTORY	Dunt by local bullder- using sarvaged materials	

The slab outbuilding at No. 35 George Street, Windsor is located on part of a 30 acre grant (Portion 25, Parish St Matthew) made to ex-convict Samuel Wilcox in 1794. By the early 19th century, Wilcox's land had been incorporated into a larger holding of 1500 acres known as Peninsula Farm, which was eventually subdivided in the 1840s primarily for residential development.

A plan entitled "Allotments comprising the Penisula farm [sic]", dated 1842 by Mr. Laban White, shows Lot 2 as vacant and is annotated showing that Laban White owned this allotment. Laban White, ex-convict, was a successful auctioneer and druggist and later the coroner in Windsor. As an auctioneer, White was tasked with selling the allotments of land in The Peninsula Farm subdivision. References to Laban White residing in George Street in a cottage known as Eddington Cottage first appear in newspaper advertisement in 1840 and he resided there until his death in 1873.

The main dwelling at No. 35 George Street, Windsor is a single storey rendered masonry Victorian cottage and historical aerial photographs of the late 20th century indicate a barn located in the rear yard of the

property. However, in 1995, the original/early barn was demolished and rebuilt (assumed reusing some	
salvaged materials) as the existing outbuilding in use as a guest house/office.	
REFERENCES	"Allotments comprising the Penisula farm [sic]", dated 1842 by Mr. Laban
	White, J. Armstrong Surveyor, NLA Map F 187
	https://peopleaustralia.anu.edu.au/biography/white-laban-26926
	Evening News, Saturday 6th September 1873, p. 2

STATEMENT OF SIGNIFICANCE

Issue: March 2025


The late 20th century slab outbuilding at No. 35 George Street, Windsor is of some historical significance for being located on an allotment of land purchased in c1840 by Laban White, auctioneer, druggist and coroner, who it is assumed built the Victorian cottage at the property. The outbuilding is a recent sympathetic construction replacing an earlier barn, built in the form and style of an historical barn and using appropriate, salvaged materials. The practice of building new outbuildings in the form and style of an historical barn and using appropriate and often salvaged/recycled materials is indicative of the level of appreciation the original and early barns of the Hawkesbury are held in by the local community.

· ·	ury are neid in by the local community.
ASSESSED	Nil
SIGNIFICANCE TYPE	
CRITERIA A)	The timber slab outbuilding at No. 35 George Street, being a recent (late
HISTORICAL	20 th century) construction replacing an earlier barn is of little historical
	significance.
	Does not meet the criterion
CRITERIA B)	The property, No. 35 George Street, Windsor, has historical associations
HISTORICAL	with Laban White, auctioneer, druggist and coroner of Windsor from the
ASSOCIATION	1830s to the 1870s, who appears to have purchased the land in c1840 and
	built the original cottage and potentially the earlier barn. The current
	outbuilding is a recent replacement of the earlier barn.
	Does not meet the criterion
CRITERIA C)	The late 20 th century slab outbuilding at No. 35 George Street is of some
AESTHETIC/TECHNICAL	interest as a sympathetic recent construction in an historic form using
	appropriate materials.
	Does not meet the criterion
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
20022,0021012	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types. The practice of building new outbuildings in the
	form and style of an historical barn and using appropriate and often
	salvaged/recycled materials is indicative of the level of appreciation the
	original and early barns of the Hawkesbury are held in by the local
	community.
	Potentially meets the criterion.
CRITERIA E) RESEARCH	The slab outbuilding at No. 35 George Street Windsor has little research
POTENTIAL	potential.
	Does not meet the criterion
CRITERIA F) RARITY	The slab outbuilding at No. 35 George Street Windsor is not considered to
	be rare.
	Does not meet the criterion
CRITERIA G)	The slab outbuilding at No. 35 George Street, Windsor is representative of a
REPRESENTATIVE	late 20 th century outbuilding constructed in the form and style of the
	historical barns located throughout the Hawkesbury local government area.
	Meets the criterion on a Local level.
INTEGRITY/INTACTNESS	High
HALEGIGI I/HALACTAESS	111611

IMAGES



Caption: Slab outbuilding at 35 George Street, Windsor Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: May 2023

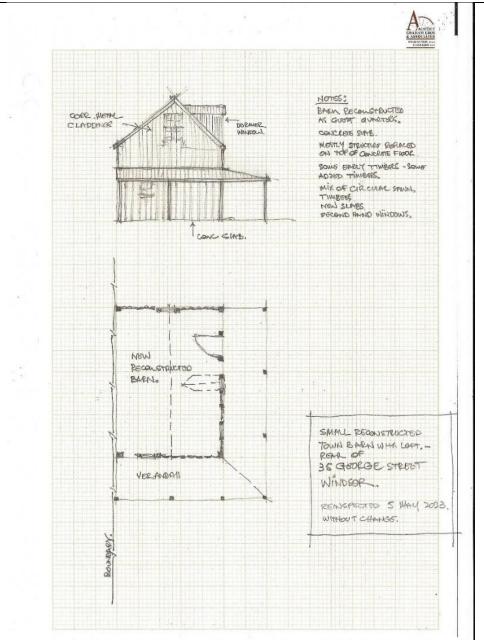

Issue: March 2025

Caption: Measured drawing of outbuilding at 35 George Street, Windsor Copyright Owner: Graham Edds & Associates Date: May 2023

ITEM DETAILS	
NAME	Slab Town Barn
ADDRESS	
	117 George Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 101 DP 737270
SHI No	1743139
EXISTING HERITAGE	Yes- Item I177
ITEM RECOMMENDED MANAGE	MENTE
MANAGEMENT	Not recommended for State listing.
SUMMARY	Retain as local heritage item- update inventory to include barn.
SUMMAKI	The main building (dwelling/store) is potentially worthy of State heritage
	listing.
ITEM CLASSIFICATION	noung.
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	Mid 19th century
CURRENT USE	Storage
FORMER USE	Town Barn
LOCATION ON SITE	Town barn situated behind two-storey house in centre of Windsor, built
	alongside north-eastern side boundary.
MAIN BARN STRUCTURE	Single-storey town barn with loft supported on closely spaced rectangular
	split and adzed posts. Embedment of post structure embedded in concrete
	slab.
	Date: Potentially early to mid 19th century
NO. OF BAYS	Condition: Poor- aggregated by concrete slab Eight
ROOF STRUCTURE	Sawn rafters and shingle battens.
ROOF STRUCTURE	Date: Mid 19 th century
	Condition: Poor
LOFT	Supported on circular sawn joists
	Date: Mid 19 th century
	Condition: Poor
SKILLION	Small lean-to
	Date: ?
	Condition: Poor
ROOF CLADDING:	Corrugated iron short sheets
	Date: Mid 19 th century?
	Condition: Poor
WALL CLADDING	Vertical timber slabs embedded in concrete slab extending up to eaves. Gable
	ends and skillion gable framed for weatherboards.
	Date: Early to mid 19 th century Condition: Poor
OPENINGS	Supports removed from SW side leading to partial collapse (supported on
OUTHINGS	temporary steel prop)
FLOORING (GROUND)	Concrete slab
220 July (GROUID)	Date: Recent/20th C
	Condition: Moderate
FLOORING (LOFT)	Timber butt jointed boarding
` '	Date: Mid 19 th century
	Condition: Poor
FLOORING (SKILLION)	Concrete slab
INTERNAL STRUCTURE	N/A

HISTORY

The barn at No. 117 George Street, Windsor is located within the 30 acre grant (Portion 24, Windsor Town Plan) made to James Whitehouse in 1799 and purchased by William Baker in 1800. Baker arrived in NSW as a marine in the First Fleet and by 1797 had been appointed the superintendent of convicts for the Hawkesbury region and by 1798 he was the government storekeeper.

The land was transferred by John Thomas Campbell, Provost Marshall to Edward Redmond on 25 March 1822. Edward Redmond, a successful ex-convict, publican, dealer and Catholic layman, later gifted the land to his step-son John Redmond, on 28 June 1828. Those transactions were listed in a later conveyance involving the Tebbutt Family and were not officially registered.

On 27 March 1829, by a deed of Release, John Redmond and Edward Redmond transferred this land to Thomas Tebbutt and John Tebbutt junior for £190. It was described as including a house, shop, and outhouses, part of Whitehouse Farm, fronting George Street in the town of Windsor bounded on the north by premises occupied by William Baker, and on the east by a house occupied by Henry Richardson, and on the west by a house occupied by George White.

A survey of Windsor dated December 1841 showed the footprint of this barn at the rear of the building marked as 'Store' facing George Street, next to a building marked in the ownership of 'Tebbutt'. The Tebbutt family also owned the Peninsula Farm to the west of the township, where they built a house in the mid 1840s and in the 1860s, John Tebbutt Jnr. built his observatory. The George Street site remained in the hands of the Tebbutt family for many years.

It was not until 1 December 1927, that the property was conveyed by members of the Tebbutt family to Eliza Buckton, wife of Charles Henry Buckton, Windsor, storekeeper.

REFERENCES	W.443a, Crown Plan
	Grants, Volume 2, No 172, LRS
	Sydney Gazette, 22 March 1822, p 1
	Old System Deeds, No 42 Bk C, No 230 Bk 35 and No 972 Bk 1495
	Vivienne Parsons, 'Redmond, Edward (1766–1840)', Australian Dictionary
	of Biography, National Centre of Biography, Australian National University

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The town barn at No. 117 George Street, Windsor, is of historical significance as a rare, surviving early 19th century timber framed town barn that documentary evidence suggests had been constructed by 1829. The barn is associated with successful ex-convict, publican, dealer and Catholic layman, Edward Redmond, who appears to have constructed the barn in association with the main dwelling/store, and with the Tebbutt family, (of John Tebbut Jnr, the astronomer fame) who owned the property from 1829 to 1927.

Although in poor condition, the town barn retains evidence of its early 19th century construction date and mid 19th century alterations including closely spaced rectangular split and adzed posts, circular sawn joists supporting the loft, sawn rafters and shingle battens and vertical timber slabs extending up to eaves. In its overall form and configuration, with gabled roof and loft, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

mame a carri type round amough	tout the Hawkesbury City focus government area.
ASSESSED	Local
SIGNIFICANCE TYPE	
CRITERIA A)	The barn at No. 117 George Street, Windsor is of historical significance as
HISTORICAL	an early 19 th century town barn (although in poor condition and altered),
	constructed in association with an early dwelling and store within the town
	centre of Windsor.
	Meets the criterion on a Local level
CRITERIA B)	The town barn has historical associations with Edward Redmond, a
HISTORICAL	successful ex-convict, publican, dealer and Catholic layman, who purchased
ASSOCIATION	the property in 1822 and who it is assumed built the dwelling, store and
	barn. Purchased shortly thereafter by John and Thomas Tebbutt, the father
	and uncle of noted Australian astronomer John Tebbutt Jnr, whose family
	held the property from 1829 to 1927, the town barn also has historical
	associations with the Tebbutt family.
	Meets the criterion on a State level
CRITERIA C)	The large, single storey town barn, although in poor condition, is of
AESTHETIC/TECHNICAL	technical significance for retaining evidence of its early 19 th century
	construction with mid 19 th century alterations, including closely spaced

	rectangular split and adzed posts, circular sawn joists supporting the loft,
	sawn rafters and shingle battens and vertical timber slabs extending up to
	eaves.
	Meets the criterion on a Local level
CRITERIA D)	The historic barns of the Hawkesbury district are appreciated by the local
SOCIAL/CULTURAL	community and others, being symbolic of the history of the agricultural
	development of the region, as evidenced by the numerous exhibitions,
	artworks, historical tours, heritage studies and heritage listings associated
	with these building types.
	Meets the criterion on a Local level
CRITERIA E) RESEARCH	The town barn at 117 George Street, Windsor, has the potential to provide
POTENTIAL	further information into early 19th century construction techniques for
	agricultural buildings and the role of town barns in the commercial
	development of the town of Windsor from the early 19 th century to date.
	Meets the criterion on a Local level
CRITERIA F) RARITY	The town barn at 117 George Street is considered to be rare within the
	context of the Hawkesbury City local government area, for being a
	surviving outbuilding potentially constructed in the 1820s and in continuous
	use since that time.
	Meets the criterion on a State level
CRITERIA G)	The town barn at 117 George Street, with gabled roof, loft and vertical
REPRESENTATIVE	timber slabs is representative of the typical form of barn found throughout
	the district.
	Meets the criterion on a Local level
INTEGRITY/	Moderate integrity/intactness
INTACTNESS	

IMAGES

Issue: March 2025



Caption: Town barn at 117 George Street, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: May 2023




Caption: Town barn at 117 George Street, Windsor (interior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd Date: May 2023



Caption: Town barn at 117 George Street, Windsor (detail) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Pty Ltd

Date: May 2023

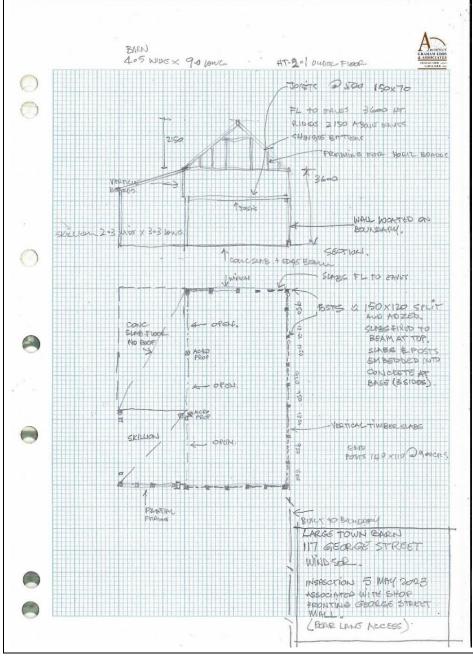

Issue: March 2025

Caption: Measured drawing and elevation of town barn at 117 George Street, Windsor Copyright Owner: Graham Edds & Associates Date: May 2023

ITEM DETAILS	ITEM DETAILS	
NAME	Single Storey Slab Barn	
ADDRESS	24 Greenway Crescent, Windsor	
LOCAL GOVT AREA	Hawkesbury	
PARISH	St Matthew	
LOT/DP	Lot 101 DP 884408	
SHI No.	1743081	
EXISTING HERITAGE	N	
ITEM?		
RECOMMENDED MANAGEMENT		
MANAGEMENT	Not recommended for State or Local listing.	
SUMMARY	Site inspection required to clarify age, construction methods, condition and	
	integrity.	
ITEM CLASSIFICATION		
ITEM TYPE	Built	
ITEM GROUP	Farming and Grazing	
ITEM CATEGORY	Barn	
DESCRIPTION		
CIRCA	?	
PERIOD	Mid to late 19 th century?	
MODIFICATION/DATES	?	
	?	
FORMER USE	Barn	
INTEGRITY/INTACTNESS	Unknown	
CIRCA PERIOD MODIFICATION/DATES CURRENT USE FORMER USE	Mid to late 19 th century? ? ? Barn	

2023: site access denied.

A large single storey barn clad in corrugated metal, located beside the street boundary. Worthy of further investigation.

HISTORY

Issue: March 2025

Charles Thomas was granted 20 acres (Portion 84, Windsor Town Plan) in the district of Mulgrave Place bounded on the northwest by Pugh to be known as Thomas Farm on 31 March 1802. Charles Thomas and his wife, Sarah (who had various surnames during her lifetime) appear to have been living on this land in 1800 before the grant was issued. Jan Barkley-Jack noted that the 1802 Muster showed they had cleared 9 acres of the land and planted 4 acres of wheat.

On 7 October 1805, Charles Thomas transferred 10 acres and 160 roods of his grant to Thomas Hobby. The other half of the grant measuring about 10 acres was transferred to John Jones on 27 May 1812. John Jones sold his land as well as part of Boulton's and Ezzy's grants to William Cox in September 1822. The Cox family also appears to have obtained possession of the 10 acres sold to Hobby. Alfred Cox, esquire of Windsor sold this land to James Hale, gentlemen of Fairfield House, Windsor on 30 December 1851.

The 1841 survey of Windsor showed a barn on this property, although not the existing barn which is larger and located to the east.

REFERENCES	Grants, Vol 3 No 78
	Barkley-Jack, Jan, Hawkesbury Settlement Revealed, pp 395-8
	Old System Deed, No 82 Bk 19
	Old System Deed, No 157 Bk 22
	W.443a, Crown Plan

IMAGES

Issue: March 2025



Caption: Barn at No. 24 Greenway Crescent, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023

ITEM DETAILS	
NAME	Reconstructed Single Storey Slab Barn with Loft
OTHER/FORMER NAMES	Peninsula Inn
ADDRESS	37-39 North Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 182 DP 593791
SHI No	1743076/ 5045187
EXISTING HERITAGE	Yes- Item No. 00110 /SHR 00110
ITEM	
RECOMMENDED MANAGE	EMENT
MANAGEMENT	Retain as State item
SUMMARY	Retain as Local item
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Barn
DESCRIPTION	
CIRCA	Y
PERIOD	1951-2000
LOCATION ON SITE	A reconstructed town barn located in the rear garden of the former
	Peninsula Hotel built 1842-6. The barn fronts Arndell Street.
MAIN BARN STRUCTURE	Reconstructed slab town barn on stone base with loft and steep roof.
NO. OF BAYS	Two
ROOF STRUCTURE	Modern sawn rafters and collar tiles with battens for corrugated steel.
LOFT	Loft along whole length of barn.
SKILLION 1	N/A
ROOF CLADDING:	Corrugated steel
WALL CLADDING	Vertical timber slab to ground floor, vertical weatherboard above.
OPENINGS	Ledged and braced double doors to street, side door also ledged & braced. Loft openings at both ends with boarded doors/ shutters.
FLOORING (GROUND)	Slate? tiles
FLOORING (LOFT)	Timber boarding on pole joists.
INTERNAL STRUCTURE	N/A
OTHER (Fixings?)	N/A
CURRENT USE	Garage/storage
HISTORY	

No. 37-39 North Street, Windsor is located on part of the 30 acre grant of land (Portion 25, Parish St Matthew) made to Samuel Wilcox in 1794, known as Wilcox Farm. By the early 19th century, Wilcox's land had been incorporated into a larger holding of 1500 acres known as Peninsula Farm, which was eventually subdivided in the 1840s primarily for residential development.

No. 37-39 North Street was Allotment 18 of the Peninsula Farm Subdivision and was owned by Charles Campbell and purchased by John Shearing in 1842. By 1864, Shearing had constructed the existing dwelling and hotel called the Peninsula Hotel (later The Court House Hotel).

The property passed through a number of hands and operated as a hotel, private dwelling and private girl's school throughout the 1800s. By the early 20^{th} century, the main building had been divided in half and used as two dwellings.

In 1974, Nos. 37-39 and 35 North Street were sold to John Fisher, architect, who sold the properties one month later to the National Trust of Australia (NSW). In 1976, the National Trust of Australia (NSW) classified the property and undertook substantial repairs and renovations, returning No. 37-39 to a single dwelling (it had been subdivided into two flats). This work also included the reconstruction of the barn at the rear of the main building. After 1976, the brick coach house was constructed using salvaged materials by artist Greg Hansell.

REFERENCES	Abridged history from SHR 00110 Heritage Item Id 5045187 with		
	additions.		
STATEMENT OF SIGNIFICA	STATEMENT OF SIGNIFICANCE		
The slab barn at 37-39 North Street, Windsor is of historical significance as an example of a reconstructed town barn, built in the 1970s as a conservation initiative of the National Trust of Australia (NSW) utilising design details and construction methods typical of 19 th century barns found throughout the Hawkesbury area. The reconstructed barn forms part of the interpretation of the former Peninsula Hotel, constructed in the mid 1840s and contributes to the historical character of this part of the town of Windsor.			
ASSESSED SIGNIFICANCE TYPE	Local		
CRITERIA A) HISTORICAL	The barn/coach house at 37-39 North Street, Windsor is of some historical significance as an example of a reconstructed town barn, built in the 1970s as a conservation initiative of the National Trust of Australia (NSW) utilising design and construction methods typical of the Hawkesbury Barns. <i>Meets the criterion on a Local level</i> .		
CRITERIA B) HISTORICAL ASSOCIATION	The reconstructed barn is associated with the National Trust of Australia (NSW), who were responsible for its construction in the 1970s as a conservation initiative. Meets the criterion on a Local level.		
CRITERIA C) AESTHETIC/TECHNICAL	Although dating from the 1970s, the barn was reconstructed using the form, design details and construction methods typical of 19 th century barns found throughout the Hawkesbury area, including timber slab cladding and pole joists for the roof structure. In appearance the barn is comparable to other 19 th century historic barns and it makes a strong contribution to the historical character of Arndell Street and this part of the town of Windsor. <i>Meets the criterion on a Local level</i> .		
CRITERIA D) SOCIAL/CULTURAL	As a reconstructed barn, associated with an historic inn building (the Peninsula Hotel) and constructed in a form and style comparable to other 19 th century historic barns of the Hawkesbury district, the barn at 37-39 North Street, Windsor may be appreciated by the local community and others, for contributing to the historic character of this part of Windsor. <i>Meets the criterion on a Local level</i> .		
CRITERIA E) RESEARCH POTENTIAL	The reconstructed barn at 37-39 North Street, Windsor holds little research potential, being constructed in the 1970s. Does not meet the criterion.		
CRITERIA F) RARITY	The reconstructed barn at 37-39 North Street, Windsor is not considered to be rare, although unusual as an example of the work of the National Trust of Australia (NSW). Does not meet the criterion.		
CRITERIA G) REPRESENTATIVE	The barn at 37-39 North Street, Windsor is representative of a late 20 th century outbuilding constructed in the form and style of the historical barns located throughout the Hawkesbury local government area. Meets the criterion on a Local level		
INTEGRITY/ INTACTNESS	High to moderate		

IMAGES

Issue: March 2025



Caption: Barn at 37 -39 North Street, Windsor

(exterior)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: May 2023




Caption: Barn at 37 -39 North Street, Windsor

(interior)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Pty Ltd

Date: May 2023

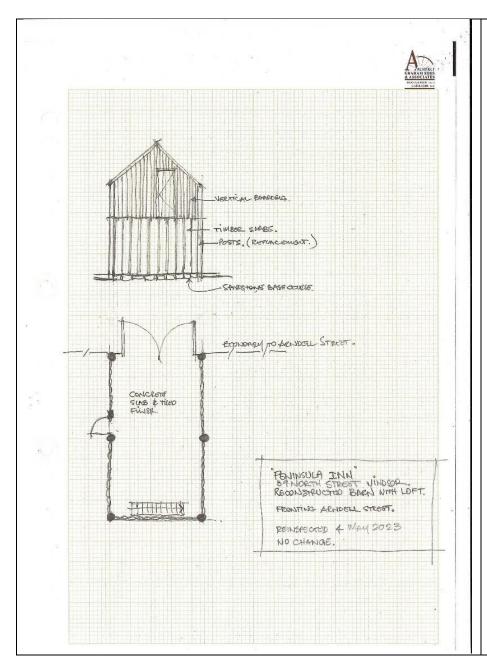

Caption: Measured drawing of Barn at 37-39 North Street, Windsor Copyright Owner: Graham Edds & Associates Date: May 2023

ITEM DETAILS	
NAME	Complex of Single Storey Slab Barn/Stables with Skillion and Adapted Corn
	Shed (Former)
OTHER/FORMER NAMES	Peninsula House/ Tebbutts Observatory
ADDRESS	50 Palmer Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 1 DP 731655
SHI No	1743075/ 5045697
EXISTING HERITAGE ITEM	Yes- Item I00028/ SHR 00028
RECOMMENDED MANAGE	EMENT
MANAGEMENT	Retain as State heritage item
SUMMARY	Retain as local heritage item
ITEM CLASSIFICATION	
ITEM TYPE	Built
ITEM GROUP	Farming and Grazing
ITEM CATEGORY	Stables/ Corn shed
DESCRIPTION CIRCA	Y
PERIOD	Mid- 19 th century
MODIFICATION/DATES	20 th century
CURRENT USE	Stables- storage and dog kennels/ Corn shed- garage/entertainment area
FORMER USE	Barn/Stables and Corn Shed
LOCATION ON SITE	The complex of farm buildings belonging to State Heritage Register-listed Peninsula House (1845) (SHR No. 00028, Heritage Item ID 5045697) includes a timber slab barn or corn shed to the SW of the house and a timber slab stables to the SE.
DESCRIPTION: STABLES	side stables to the SE.
MAIN STRUCTURE	Three rows of round columns with sawn longitudinal beams housed into the columns (double beams to outer columns). No cross beams but sawn joists at 450mm centres.
NO. OF BAYS	Six
ROOF STRUCTURE	Pole rafters at 45° pitch and shingle battens. Eaves overhang posts.
LOFT	Not accessed
SKILLION	Pole rafters and shingle battens
ROOF CLADDING:	Corrugated iron short sheets
WALL CLADDING	Vertical timber slabs and planks with weatherboard to skillion and gables
OPENINGS	Hayloft doors in both gables, series of stable doors along NW side.
FLOORING (GROUND)	Brick paving & timber boarding to NE end
FLOORING (FIRST)	N/A
FLOORING (LOFT)	Plywood
FLOORING (SKILLION)	Timber boarding
INTERNAL STRUCTURE	Horse stalls supported from main posts.
OTHER (Fixings?)	Bolts
CURRENT USE	Storage & dog kennels
CHANGES FROM 2010?	None

CONDITION	Moderate
DESCRIPTION: CORN SHE	D
MAIN STRUCTURE	Round posts with double longitudinal beams let into sides (similar to stables). No cross beams but sawn joists.
NO. OF BAYS	Four
ROOF STRUCTURE	Round pole rafters at 45° pitch and battens suitable for iron. Eaves overhang posts.
LOFT	No loft floor, joists only
SKILLION	Sawn rafters, longitudinal beam let into centre line of round posts.
ROOF CLADDING:	Corrugated iron short sheets
WALL CLADDING	Spaced round vertical poles (palisade) cladding to NE end, some vertical timber slabs, weatherboards to gables.
OPENINGS	Open on NW side
FLOORING (GROUND)	Brick
FLOORING (FIRST)	N/A
FLOORING (LOFT)	None
FLOORING (SKILLION)	Brick
INTERNAL STRUCTURE	N/A
OTHER (Fixings?)	Angle bracket connections at eaves
CURRENT USE	Garage, entertainment area
CHANGES FROM 2010?	None
CONDITION	Good
НІСТОВУ	1

HISTORY

Issue: March 2025

The land on which the Peninsula Farm, 50 Palmer Street, Windsor is located forms part of a 30 acre grant (Portion 30, Parish St Matthew) made to ex-convict John Brindley in 1794 and a 75 acre grant (Portion 29, Parish St Matthew) made to soldiers of the NSW Corps Charles Whalen, Henry Hughes and John Robertson in 1795. Brindley had been transported to New South Wales in 1788 on the *Alexander*, as part of the First Fleet.

In 1798, Whalen, Hughes and Robertson's grant and Brindley's grant were both purchased by John Stogdell, ex-convict and agent to Commissary John Palmer. Stogdell was a large landowner and successful businessman in his own right.

The amalgamated land grants purchased by Stogdell were known as The Peninsular (vars. Peninsula) Farm or Estate. Following Stogdell's death, the property was owned by George Thomas Palmer, the son of the Commissary John Palmer. Palmer Street is named for George Palmer.

In 1842, the Peninsular Farm was subdivided and sold off in building and cultivation allotments and in 1843 John Tebbutt Snr. purchased approximately 100 acres of land from Charles Campbell, agent to George Palmer, which included part of the land formerly granted to John Brindley and part of the land granted to Whalen, Hughes and Robertson. A real estate plan for the sale of the subdivided Peninsular Farm in 1842 shows the allotments purchased by Tebbutt as being cultivated land.

Tebbutt retained the name Peninsular Farm for his property and in c1845 built a two storeyed brick dwelling on a high knoll on the property facing east to South Creek. John Tebbutt, with his brother Thomas, opened a shop in George Street. The Tebbutt family were very involved in the development of the township of Windsor. Thomas Tebbutt was trustee for the receipt of deposits in Windsor for the newly established Savings Bank of NSW, churchwarden of St. Matthew's Anglican Church and treasurer for the Hawkesbury branch of the Church of England Lay Association for NSW. John Tebbutt Snr. was on the committee for the Church of England, Windsor and the committee for the Wesleyan Auxiliary Missionary Society of NSW in Windsor.

In 1871, following the death of his father, John Tebbutt Jnr. inherited the Peninsular Farm. John Tebbutt Jnr. become a significant Australian astronomer and in 1861 he gained a world-wide reputation as the discoverer of the orbit of a great comet (Tebbutt's Comet) and went on to discover a second great comet in 1881. In 1863, at the Peninsula Farm he built a small wooden observatory and in 1879 he erected 'a substantial observatory of brick' a few metres south of the old observatory.

The Peninsula Farm remained In the "hand" of John Tebbutt Jnr and continues to be held by his descendants today. Over the years, parts of the adjoining farming lands have been sold.

REFERENCES	Bk 2426 No. 378
	Bk 3720 No. 435
	Book 4 No. 156
	Plan entitled "Allotments comprising the Penisula farm [sic]", dated 1842
	by Mr. Laban White, J. Armstrong Surveyor, NLA Map F 187
	Heritage Impact Statement: Tebbutts Barn, Storm Damage Repairs and
	Long-Term Maintenance Works, prepared by Lucas Stapleton Johnson &
	Partners, April 2020

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The stables and corn shed at Peninsula House, No. 50 Palmer Street, Windsor are of historical significance as surviving mid 19th century agricultural outbuildings that are associated with notable Hawkesbury person John Tebbutt Snr. who purchased portions of the Peninsula Farm in c.1843 and was father of John Tebbutt Jnr, the Australian astronomer; and for being located on part of the land granted to ex-convict John Brindley in 1794 and soldiers Charles Whalen, Henry Hughes and John Robertson in 1795, later owned by John Stogdell, agent to Commissary John Palmer and successful businessman and extensive landholder.

As part of a significant complex of buildings including 1840s house and 1860s observatory, the stables and corn shed contribute to the historical character of the agricultural lands to the west of the township of Windsor and the Hawkesbury River/South Creek floodplains. In their overall form and configuration, both buildings are representative examples of historic timber framed agricultural buildings with vertical timber slab wall cladding found throughout the Hawkesbury City local government area.

The stables, with side skillion, is of technical significance for retaining evidence of its mid 19th century construction date including the three rows of round columns with sawn longitudinal beams housed into the columns (double beams to outer columns), pole rafters and shingle battens to main roof and skillion, and vertical timber slabs and planks with weatherboard to skillion and gables. Although adapted, the corn shed is also of technical significance for retaining evidence of its mid 19th century construction date including round posts with double longitudinal beams, no cross beams but sawn joists, round pole rafters and battens suitable for iron, angle brackets at eaves, spaced round vertical poles (palisade) cladding, some vertical timber slabs and weatherboards to gables. Both the stables and corn shed have the potential to provide further information into mid 19th century farming methods and the continuous use of historic agricultural structures into the 21st century.

,	
ASSESSED	State
SIGNIFICANCE TYPE	
CRITERIA A)	The former Stables and Corn Shed at Peninsula House, No. 50 Palmer
HISTORICAL	Street, Windsor are of historical significance as evidence of the long-term
	agricultural use of the land, first established in 1794 by ex-convict John
	Brindley and soldiers Charles Whalen, Henry Hughes and John Robertson
	in 1795 and in continuous agricultural use since that time. Dating from the
	early 19 th century, the slab outbuildings appear to be associated with John
	Tebbutt Snr, who purchased the property in c.1843 and known as Peninsula
	Farm, and continues to be owned by Tebbutt's descendants today.
	Meets the criterion on a State level
CRITERIA B)	The Stables and Corn Shed have historical associations with John Tebbutt
HISTORICAL	Snr, who purchased the land in c.1843, and was a prominent member of the
ASSOCIATION	Hawkesbury community, being on the committee for St Matthew's Church
	of England, Windsor and the committee for the Wesleyan Auxiliary
	Missionary Society of NSW in Windsor. He is also the father of John
	Tebbutt Jnr. the notable Australian astronomer.
	Meets the criterion on a State level

CDAMEDY (C)	
CRITERIA C)	As part of a farm complex with 1840s dwelling and adjacent observatory,
AESTHETIC/	the Stables and Corn Shed make a strong contribution to the historical
TECHNICAL	character of the agricultural lands to the west of the township of Windsor
	and the floodplains of South Creek and the Hawkesbury River.
	The former Stables with skillion and hay loft doors to both gable ends is of technical significance for retaining evidence of its mid 19 th century construction date including the three rows of round columns with sawn longitudinal beams housed into the columns (double beams to outer
	columns), pole rafters and shingle battens to main roof and skillion and vertical timber slabs and planks with weatherboard to skillion and gables.
	Although adapted for use as a garage and entertainment area, the former
	corn shed or barn is of technical significance for retaining evidence of its
	mid 19 th century construction date including round posts with double
	longitudinal beams, no cross beams but sawn joists, round pole rafters and
	battens suitable for iron, angle brackets at eaves, spaced round vertical
	poles (palisade) cladding, some vertical timber slabs and weatherboards to
	gables.
	Meets the criterion on a State level
CRITERIA D)	The historic barns and slab outbuildings of the Hawkesbury district are
SOCIAL/CULTURAL	appreciated by the local community and others, being symbolic of the
SOCIAL/COLTURAL	history of the agricultural development of the region, as evidenced by the
	numerous exhibitions, artworks, historical tours, heritage studies and
	heritage listings associated with these building types.
	Meets the criterion on a Local level
CRITERIA E) RESEARCH	The stables and corn shed at No. 50 Palmer Street, Windsor, have the
POTENTIAL	potential to provide further information into early to mid 19 th century
FOIENTIAL	farming methods, and approaches to the continuity of use of historic
	agricultural buildings into the 21st century.
	Meets the criterion on a Local level
CRITERIA F) RARITY	The stables and corn shed at No. 50 Palmer Street, Windsor are not
CRITERIA F) KARITI	considered to be rare within the context of the Hawkesbury City local
	government area.
	Meets the criterion on a Local level
CRITERIA G)	The stables and corn shed at No. 50 Palmer Street, Windsor are
REPRESENTATIVE	representative of the long history of agricultural development within the
	floodplains of the Hawkesbury River and South Creek, which commenced
	in the early 19 th century and continued well into the 20 th century.
	The form of both outbuildings with gabled roofs, skillions and vertical
	timber slab wall cladding are representative of the typical form of
	outbuildings found throughout the district.
	Meets the criterion on a Local level
INTEGRITY/	Moderate to high intactness and integrity.
INTACTNESS	
	1

IMAGES



Caption: The stables at No. 50 Palmer Street, Windsor

(exterior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023



Caption: The stables at No. 50 Palmer Street, Windsor

(exterior)

Photographer: S. Johnson

Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023



Issue: March 2025

Caption: The stables at No. 50 Palmer Street, Windsor

(interior)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD



Caption: The corn shed at No. 50 Palmer Street, Windsor (exterior) Photographer: S. Johnson Copyright Owner: Lucas Stapleton Johnson & Partners

Date: May 2023



Caption: The corn shed at No. 50 Palmer Street, Windsor (exterior)

Photographer: S. Johnson Copyright Owner: Lucas Stapleton


Johnson & Partners Date: May 2023



Issue: March 2025


Caption: The corn shed at No. 50 Palmer Street, Windsor (interior detail) Photographer: S. Johnson Copyright Owner: Lucas Stapleton

Johnson & Partners Date: May 2023

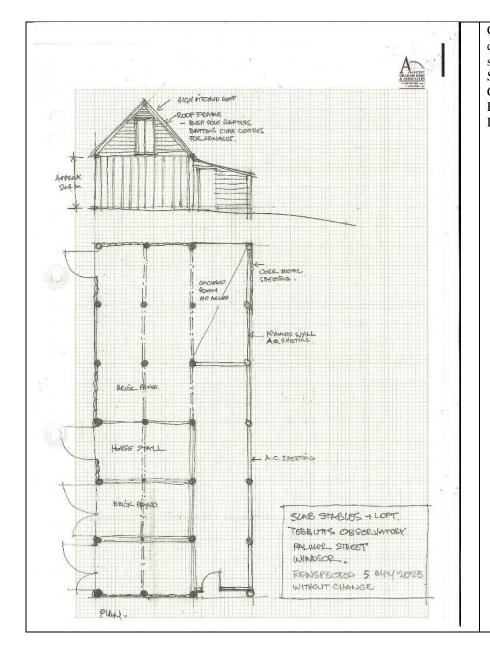

Caption: Measured drawing and elevation of stables at No. 50 Palmer Street, Windsor

Copyright Owner: Graham Edds & Associates Date: May 2023

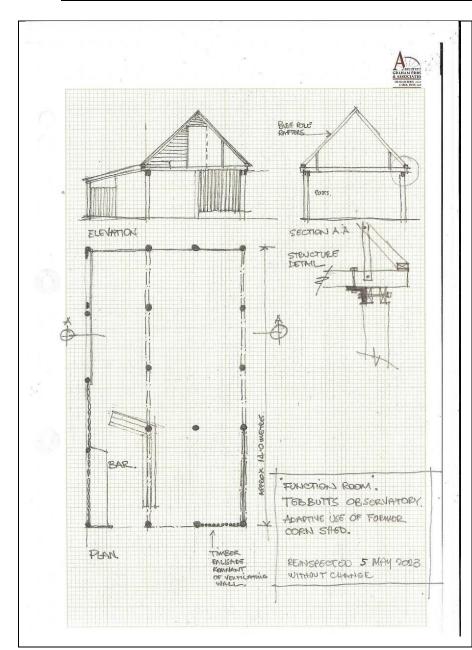

Caption: Measured drawing and elevation of corn shed at No. 50 Palmer Street, Windsor Copyright Owner: Graham Edds & Associates Date: May 2023

ITEM DETAILS	
NAME	Slab Barn with Skillion
OTHER/FORMER NAMES	Tebbutts Barn
ADDRESS	40 Ditt Street Window
	40 Pitt Street, Windsor
LOCAL GOVT AREA	Hawkesbury
PARISH	St Matthew
LOT/DP	Lot 1 DP 770404
SHI No	1743084
EXISTING HERITAGE	No
ITEM PEGOMMENDED MANAGE	DA ALDIA (AL
RECOMMENDED MANAGE	
MANAGEMENT	Recommend for State heritage listing Recommend for Local heritage listing.
SUMMARY ITEM CLASSIFICATION	Recommend for Local nertiage listing.
ITEM CLASSIFICATION ITEM TYPE	Built
ITEM TYPE ITEM GROUP	Farming and Grazing
ITEM GROUP ITEM CATEGORY	Barn
DESCRIPTION	Datii
CIRCA	Y
PERIOD	Early to mid 19 th century
MODIFICATION/DATES	Partially demolished following storm damage post 2020
CURRENT USE	Derelict
FORMER USE	Barn
LOCATION ON SITE	Located on The Peninsula overlooking South Creek and accessed via
	Palmer Street. The barn is historically associated with adjacent Peninsula Farm/Tebbutts Observatory, the home of astronomer John Tebbutt,
	therefore known as Tebbutt's Barn.
MAIN BARN STRUCTURE	This large barn is sadly now partially dismantled. The main roof structure
WAIN BARN STRUCTURE	has been removed and materials stored on the ground. Still standing are the
	main round posts, longitudinal beams and round cross beams. Corners
	between longitudinal and cross beams braced at 45°.
	Date: Early 19 th century
	Condition: Poor
NO. OF BAYS	Seven
ROOF STRUCTURE	N/A roof removed
LOFT	N/A
SKILLION 1	Steep 45° skillion along whole south-western side of barn. Pole rafters and
	shingle battens indicate an early date.
	Date: Early 19 th century
	Condition: Moderate
ROOF CLADDING:	N/A
WALL CLADDING	Remains of vertical timber slabs and weatherboard cladding to skillion
	gables, elsewhere corrugated iron.
	Date: Early 19 th century
EL CODINIC (CROTAIR)	Condition: Poor
FLOORING (GROUND)	Earthen
FLOORING (SKILLION)	Earthen
OTHER (Fixings?)	Mortise & tenon joints between posts and longitudinal beams.
HISTORY	

The land on which Tebbutt's Barn, No. 40 Pitt Street, Windsor is located forms part of a 30 acre grant (Portion 30, Parish St Matthew) made to ex-convict John Brindley in 1794. Brindley had been transported to New South Wales in 1788 on the *Alexander*, as part of the First Fleet.

John Palmer, NSW commissary, appointed in 1790 made the acquaintance of convict John Stogdell/Stockdale, who had arrived on the First Fleet on the ship, *Alexander*. Stogdell had administrative skills, as well as the ability to read and write. Palmer was soon using him in responsible roles managing his

business concerns. Stogdell commenced acquiring land on the Peninsula beginning in August 1795, beginning with William Bond's 30 acres. From September 1796, to November 1800, whilst John Palmer was overseas, Stogdell was agent for Palmer and supervised the construction and completion of Palmer's unfinished residence at Woolloomooloo, supervising the tradesmen and overseeing the fitting out of the premises, so that the building was complete by the time Palmer returned.

At the Hawkesbury, Stogdell acquired the 30 acre grant of John Brindley, his former shipmate from the *Alexander* in August 1798, though Jan Barkley-Jack (2009) believes the deal may have been agreed a year earlier. The purchase of Brindley's farm gave him the higher land in the Peninsula and according to Barkley-Jack (2009), Stogdell built a house and barn and operated the property as an inn (the Bush Inn), and it may have been located on the high ground on Brindley's grant (such as the location of Tebbutt's Observatory and Tebbutt's Barn today). In 1798, he substantially increased his landholdings with the purchase of a combined 75 acres south of William Bond's 30 acres from soldiers Charles Whalan, Henry Hughes and John Robertson. Soon, after the purchase of John Ruffler's 30 acres on 8 February 1800 for £180, Stogdell built what Jan Barkley has described as 'a fine barn'. John Stogdell drowned in 1801 en route to his Hawkesbury farm. The subsequent valuation and inventory of his property has been carefully researched by Jan Barkley-Jack (2009) which has provided the early evidence for this property.

By the early 1800s, Brindley's Farm had been amalgamated with the adjacent allotments to the north and east between South Creek and the Hawkesbury River and together the area was known as The Peninsular (vars. Peninsula) Farm or Estate. The estate was later owned by George Thomas Palmer, the son of the NSW Commissary, John Palmer. Palmer Street is named for George Palmer.

In 1842, the Peninsular Farm was subdivided and sold off in building and cultivation allotments and in 1843 John Tebbutt Snr. purchased approximately 100 acres of land from Charles Campbell, which included part of the land formerly granted to John Brindley. A real estate plan for the sale of the subdivided Peninsular Farm shows the allotment that now contains the barn as being cultivated land.

Tebbutt retained the name Peninsular Farm for his property and in c1845 built a two storeyed brick dwelling on a high knoll on the property facing east to South Creek. John Tebbutt with his brother Thomas opened a shop in George Street. The Tebbutt family were very involved in the development of the township of Windsor. Thomas Tebbutt was trustee for the receipt of deposits in Windsor for the newly established Savings Bank of NSW, churchwarden of St. Matthew's Anglican Church and treasurer for the Hawkesbury branch of the Church of England Lay Association for NSW. John Tebbutt Snr. was on the committee for the Church of England, Windsor and the committee for the Wesleyan Auxiliary Missionary Society of NSW in Windsor.

In 1871, following the death of his father, John Tebbutt Jnr. inherited the Peninsular Farm. John Tebbutt become a significant Australian astronomer and in 1861 he gained a world-wide reputation as the discoverer of the orbit of a great comet (Tebbutt's Comet) and went on to discover a second great comet in 1881. In 1863 at the Peninsula Farm he built a small wooden observatory and in 1879 he erected 'a substantial observatory of brick' a few metres south of the old observatory.

The Peninsula Farm remained in the hands of John Tebbutt Jnr and continues to be held by his descendants today.

In 1957, Robert Tebbutt sold to Peter Mulligan, farmer, 20 acres of the Peninsula Farm (Lot G in Registered Plan 1709). It is this allotment that now contains the barn formerly associated with the Peninsular Farm and the Tebbutt's property. The land passed to son Stephen Mulligan and in 1987 the land was sold to Hawkesbury City Council.

REFERENCES	Bk 2426 No. 378 Bk 3720 No. 435 Book 4 No. 156 Plan entitled "Allotments comprising the Penisula farm [sic]", dated 1842 by Mr. Laban White, J. Armstrong Surveyor, NLA Map F 187 Heritage Impact Statement: Tebbutts Barn, Storm Damage Repairs and Long-Term Maintenance Works, prepared by Lucas Stapleton Johnson & Partners, April 2020
	Partners, April 2020 Barkley-Jack, Jan, Hawkesbury Settlement Revealed: A new look at Australia's third mainland settlement, 1793-1802, pp 190-201

STATEMENT OF SIGNIFICANCE

Issue: March 2025

The barn at No. 40 Pitt Street, Windsor is of historical significance as a surviving early 19th century slab barn, located on part of the land granted to ex-convict John Brindley in 1794 and in continuous agricultural use from the early 19th century until the 21st century. The timber framed barn may have associations with John Stogdell, valet and agent to Commissary John Palmer, who formed The Peninsula Farm incorporating Brindley's grant, and is known to have built a house and barn on the farmlands in the late 1790s. The barn is also associated with notable Hawkesbury person John Tebbutt Snr. who purchased a portion of The Peninsula Farm in c.1843, developed the farm complex, which includes Tebbutt's Observatory built by his son. The barn formed part of the Tebbutt farm complex until the late 20th century.

The barn, although partially dismantled, could be restored and continues to makes a strong contribution to the historical character of the agricultural lands to the west of the township of Windsor and the Hawkesbury River/South Creek floodplains. In its overall form and configuration, it is a representative example of an historic timber framed barn type found throughout the Hawkesbury City local government area.

The large single storey barn with side skillion is of technical significance for retaining evidence of its early 19th century construction date, including the main round posts, longitudinal beams and round cross beams and mortise & tenon joints between posts and longitudinal beams. Pole rafters and shingle battens indicate an early date for the skillion. The remains of vertical timber slabs and weatherboard cladding survive to the skillion gables. The barn continues to have the potential to provide further information into early 19th century farming methods and the continuous use of historic agricultural structures into the 20th century.

	Gran
ASSESSED	State
SIGNIFICANCE TYPE	
CRITERIA A) HISTORICAL	The early 19 th century barn at No. 40 Pitt Street, Windsor is of historical significance as evidence of the long-term agricultural use of the land, first established in 1794 by ex-convict John Brindley, and in continuous agricultural use until the 21 st century. Meets the criterion on a State level
CRITERIA B)	Dating from the early 19 th century, the barn may be associated with John
HISTORICAL ASSOCIATION	Stogdell, valet and agent to Commissary John Palmer. Stogdell purchased Brindley's and the surrounding grants and formed The Peninsula Farm and
ASSOCIATION	it is known that Stogdell built a house and barn on the farmlands in the late 1790s (location unknown). The barn is also associated with John Tebbutt Snr, who owned The Peninsula Farm from c.1843, developed the farm complex and where his son, John Tebbutt Jnr. the notable Australian astronomer, built his observatory (Tebbutt's Observatory); although the barn is now separated from its original allotment it was in use by the Tebbutt family until the late 20 th century. John Tebbutt Snr was a prominent member of the Hawkesbury community, being on the committee for St Matthew's Church of England, Windsor and the committee for the Wesleyan Auxiliary Missionary Society of NSW in Windsor. <i>Meets the criterion on a State level</i>
CRITERIA C) AESTHETIC/TECHNICAL	Although partially dismantled, the barn could be restored and continues to make a strong contribution to the historical character of the agricultural lands to the west of the township of Windsor and the floodplains of South Creek. The large single storey barn with side skillion is of technical significance for retains evidence of its early 19 th century construction date, including the main round posts, longitudinal beams and round cross beams. Corners between longitudinal and cross beams are braced at 45°. Pole rafters and shingle battens indicate an early date for the skillion. The remains of vertical timber slabs and weatherboard cladding survive to the skillion gables. Meets the criterion on a State level
CRITERIA D)	
SOCIAL/CULTURAL	The historic barns of the Hawkesbury district are appreciated by the local community and others, being symbolic of the history of the agricultural development of the region, as evidenced by the numerous exhibitions, artworks, historical tours, heritage studies and heritage listings associated


	24. 4 1. 242
	with these building types.
	Meets the criterion on a Local level
CRITERIA E) RESEARCH POTENTIAL	The remains of the barn and skillion at No. 40 Pitt Street, Windsor, has the potential to provide further information into early 19 th century farming methods, and continuity of use of historic agricultural buildings into the 20 th century. Meets the criterion on a Local level
CRITERIA F) RARITY	As a surviving early 19 th century barn, associated persons important in the development of the colony and the Hawkesbury, the barn at No. 40 Pitt Street, Windsor is considered to be rare within the context of the Hawkesbury City local government area. Meets the criterion on a State level
CRITERIA G) REPRESENTATIVE	The barn at No. 40 Pitt Street, Windsor is representative of the long history of agricultural development within the floodplains of the Hawkesbury River and South Creek, which commenced in the early 19 th century and continued well into the 20 th century. The basic form of the barn with gabled roof and skillion is representative of the typical form of barn found throughout the district. Meets the criterion on a Local level
INTEGRITY/	Moderate to little intactness- although removed fabric is stored on site and
INTACTNESS	able to be restored.

IMAGES

Issue: March 2025



Caption: The derelict barn at No. 40 Pitt Street, Windsor. Photographer: K. Denny Copyright Owner: Lucas Stapleton Johnson & Partners Date: May 2023

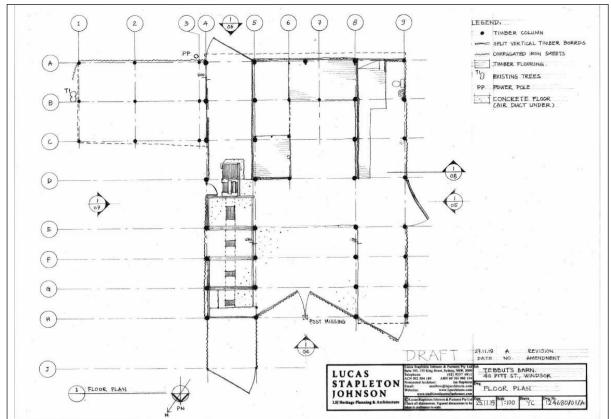


Caption: Measured drawing of floor plan of barn at 40 Pitt Street Windsor (prior to storm damage)

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: November 2019

Appendices LUCAS STAPLETON JOHNSON & PARTNERS PTY LTD

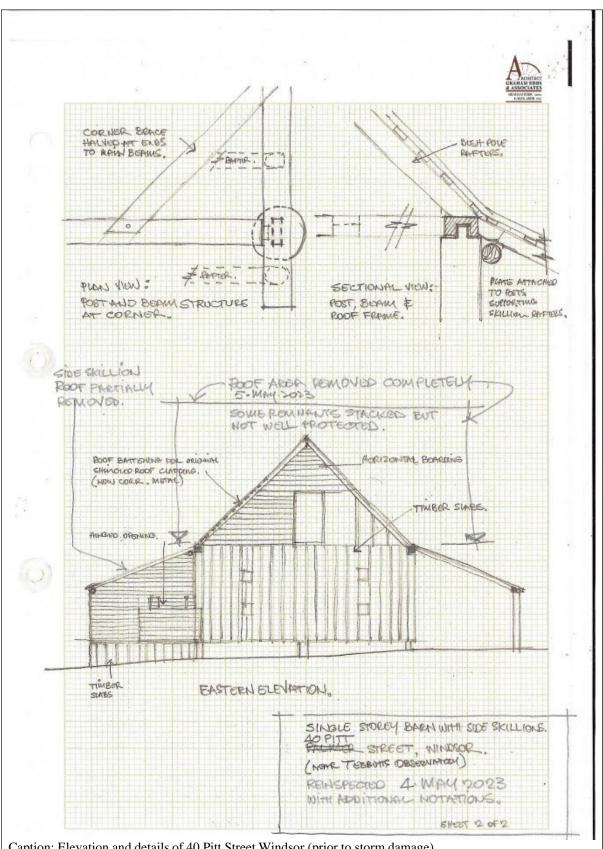

Caption: Elevation and details of 40 Pitt Street Windsor (prior to storm damage)

Copyright Owner: Lucas Stapleton Johnson & Partners

Date: 2010 updated May 2023